

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	1
FILE	1
U.S.G.S.	
LAND OFFICE	
OPERATOR	1

OIL CONSERVATION DIVISION

RECEIVED BY P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

OCT 15

Form C-103
Revised 10-1-78

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

BLM 1

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- P & A	7. Unit Agreement Name
2. Name of Operator Clements Energy, Inc.	8. Farm or Lease Name Drum "A" Com
3. Address of Operator P. O. Box 20500, Oklahoma City, OK 73156	9. Well No. 1
4. Location of Well UNIT LETTER G, 1980 FEET FROM THE North LINE AND 1980 FEET FROM THE East LINE, SECTION 33 TOWNSHIP 14S RANGE 26E NMPM.	10. Field and Pool, or Wildcat W. Buffalo Valley-Penn
15. Elevation (Show whether DF, RT, GR, etc.) 3,427' GR	12. County Chaves

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>

SUBSEQUENT REPORT OF:

REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- existing perms 6,789-95'
- bridge plug set @ 6,750' w/35' cmt on top.
- cut off csg @ 6,050'
- set plug from 6,150-6,000' w/35 sxs cmt, and tag.
- set plug from 5,380-5,280' (Top of Wolfcamp) w/25 sxs cmt.
- set plug from 4,350-4,250' (Top of Abo) w/25 sxs cmt.
- set plug from 2,460-2,360' w/25 sxs cmt.
- set plug from 1,418-1,318' w/35 sxs cmt (shoe plug), & tag.
- Pull to 420-320' cmt w/35 sxs. Run 1 jt & circ. Set dry hole marker & cut off.

mud between all plugs

Notify MAO.C.C. in sufficient time to witness

Plugging

8. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED R. E. Harris TITLE Division Engineer DATE October 4, 1985

APPROVED BY Mike Williams TITLE OIL AND GAS INSPECTOR DATE OCT 17 1985