

STATE OF NEW MEXICO  
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	<input checked="" type="checkbox"/>
FILE	<input checked="" type="checkbox"/>
U.S.G.S.	
LAND OFFICE	
OPERATOR	<input checked="" type="checkbox"/>

OIL CONSERVATION DIVISION BY  
P. O. BOX 2083  
SANTA FE, NEW MEXICO 87501  
JAN 20 1984

Form C-103  
Revised 10-1-73

O. C. D.  
ARTESIA, OFFICE

3a. Indicate Type of Lease  
State ☐ Fee ☒  
3. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Sanders Oil & Gas Company ✓	8. Farm or Lease Name C. P. Wilson
3. Address of Operator 14679 Midway Road, Suite 101, Dallas, Texas 75234	9. Well No. 1
4. Location of Well UNIT LETTER C 660 FEET FROM THE North LINE AND 1930 FEET FROM THE West LINE, SECTION 13 TOWNSHIP 10 S RANGE 24 E NMPM.	10. Field and Pool, or Wildcat Undes. Abo
15. Elevation (Show whether DF, RT, GR, etc.) 3543 GR 3555 RT	12. County Chaves

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐  
TEMPORARILY ABANDON ☐  
PULL OR ALTER CASING ☐  
OTHER ☐

PLUG AND ABANDON ☐  
CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐  
COMMENCE DRILLING OPNS. ☐  
CASING TEST AND CEMENT JOBS ☐  
OTHER ☐  
ALTERING CASING ☐  
PLUG AND ABANDONMENT ☒

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

12-7-83

Set CIBP at 3382'. Cut pipe off at 2670' w/CRC Jet Cutter. Pull pipe. Go in hole w/2 3/8" tubing. Tag BP at 3382'. Set 6 sx. Class "C" + 3% Cacl cement plug on top of BP. WOC 1 hr. Tag top of cement @ 3322'. Set 25 sx. Class "C" + 3% Cacl inside 4 1/2" at 2725' and 50' out of 4 1/2" casing. WOC 1 hr. Tag cement at 2612'. Load hole w/125 bbls. 9.5 mud. Set 40 sx. Class "C" + 3% Cacl at 1138'. WOC 1 hr. Tag top of cement at 1006'. Set 30 sx. Class "C" + 3% Cacl plug at 630'. WOC 1 hr. Tag top of cement at 512'. Set 10 sx. Class "C" + 3% Cacl in top of 8 5/8" casing. Cement in dryhole maker.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Exploration Manager DATE 12-22-83  
APPROVED BY [Signature] TITLE Geologist DATE 4/23/87  
CONDITIONS OF APPROVAL, IF ANY: