

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-005-62177
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. LG-7986
7. Lease Name or Unit Agreement Name Pioneer 26 State
8. Well No. 1
9. Pool name or Wildcat Wildcat

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL ☐ GAS WELL ☒ OTHER	
2. Name of Operator Manzano Oil Corporation 505/623-1996	
3. Address of Operator P.O. Box 2107/Roswell, NM 88202-2107	
4. Well Location Unit Letter G : 1980 Feet From The North Line and 1980 Feet From The East Line Section 26 Township 8 South Range 27 East NMPM Chaves County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3912.8' GR	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☐
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- * If CIBP @ 6300' has no cement on it spot 35' cmt on CIBP.
1. Set CIBP @ 5542'. Cap w/35' of cement.
 2. Find free point of 4-1/2" csg. Cut and recover 4-1/2".
 3. If recovery is below 8-5/8" shoe, set 100' cement plug (50' in and 50' out) @ 4-1/2" csg stub. TAG
 4. Set 100' cement plug (50' below and 50' above) 8-5/8" csg shoe. TAG
 5. Set 100' cement plug (50' below and 50' above) 13-3/8" csg shoe.
 6. Set 10 sks surface plug.
 7. Install dry hole marker.

* Brine gel between all cement plugs.

* Notify NMOC before beginning plugging operations

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Allison Hernandez TITLE Engineering Technician DATE 4/3/98
TYPE OR PRINT NAME Allison Hernandez TELEPHONE NO. 623-1996

(This space for State Use)

APPROVED BY mae Stufflefield TITLE Field Rep. II DATE April 8, 1998
CONDITIONS OF APPROVAL, IF ANY:

APR 1998
RECEIVED
OCD - ARTESIA

Pioneer "26" State No 1
 1980' FN & FWD Sec 26, T8S, R27E
 Chavez Co., New Mexico

