

Operator Petroleum Development Corp.
Well Mary K #1
Unit D Section 29 Township 10
API # 30-005-62232

TOPS

San Andres	528'
Gleniata	1280'
Abe	3528'

- * Contact OCD 24 hrs. prior to any work done.
- * Salt gel mud consisting of 10# brine with 25# of gel per barrel must be placed between each plug.
- * Install dry hole marker as per Rule 202.B.2
- * Plugs are to be set from point indicated up.
- * Plugs must not be less than 100' or 25 Sacks of cement, whichever is greater, unless specifically indicated.
- * Shoe and stub plugs will be 50' above and below shoe or stub and tagged.
- * Surface plug will be from 0' - 60'
- * Where plugs are required, cement must be placed inside and outside of all casing string(s) in the correct footage or sacks required, if no cement exists.
- * Plugs to be tagged will be indicated.

Diagram illustrating a wellbore profile with various plug and shoe locations. The profile is shown as a vertical line with arrows pointing to specific features.

- Surface Plug
- Shoe Plug 297' Tag
- Shoe Plug 824' Tag
- Plug 1280'
- Plug 3500' Tag
- 3551'-3586'
- 4 1/2" @ 3981'
- 3 3/8" @ 247' CIRC
- 8 5/8" @ 774' CIRC

✓

