

Stevens Operating Co.

O'Brien EA # 1

Sec.33-7-29-F

1. Run in hole with tbg. @ tag plug at 6324'. If there is no plug proceed to 7884' @ spot a 40 sx. plug. WOC @ tag plug.
2. Spot a 40 sx. plug @ 6324'. WOC @ tag plug.
3. Spot a 25 sx. plug @ 5600'.
4. Spot a 25 sx. plug @ 3430'.
5. Cut 5 1/2 csg @ 2260' if free. Run in hole to 2287' @ bring cement to 2200'. WOC and tag plug.
6. Spot a 35 sx. plug @ 1135'
7. Perforate 85/8 csg. @ 458', squeeze @ bring cement to surface leaving 85/8 and back side full.
8. Set P@A marker, clean and level location.
9. Mud will be placed between pluggs at 25 lb. per bbl. of brine.