	ED STATES OF THE INTER	OR verse side	5. LEASE DESIGNATION AND SEEIAL NO). C
BUREAU OF 1	AND MANAGEMENT	rtesia, NM 88210	<u>NM 289623</u>	
SUNDRY NOTICES	and reports Ö	ON WELLS	6. IF INDIAN, ALLOTTEE OR TEIBE NAM	4 E
Use "APPLICATION F	UR PERMIT- IN BUCH P		7. UNIT AGREEMENT NAME	
OIL GAS WELL X. OTHER		RECEIVED BY		
WELL WELL _A. OTHER	//////	RELIVED	8. FARM OR LEASE NAME	
Yates Petroleum Corpo	ration 🗸	MAY 19 1987	Filaree AEL Federa 9. WHLL NO.	<u>1</u>
105 South 4th St., Ar	tesia, NM 882	¹⁰ ocp.	1	
LOCATION OF WELL (Report location clearly an	ad in accordance with any	State requirements. • ARTESIA, OFFICE	10. FIELD AND POOL, OR WILDCAT	
See also space 17 below.) At surface	L	ARTEON, CT	Pecos Slope Abo	
660' FSL & 1650'	FEL, Sec. 33	-T8S-R26E	11. SBC., T., R., M., OR BLK. AND SURVEY OR AREA	
		,	Unit O, Sec. 33-85-	- <u>2</u> 6E
PERMIT NO. 15. E	LEVATIONS (Show whether DF		12. COUNTY OF PARISH 13. STATE Chaves NM	
1	3850.1'	GR	Chaves NM	
Check Appropri	ate Box To Indicate N	lature of Notice, Report		
NOTICE OF INTENTION TO	:	1	UBSEQUENT EBPORT OF:	
TEST WATER SHUT-OFF PULL OR	ALTER CASING	WATER SHUT-OFF	REPAIRING WELL	
	E COMPLETE	FRACTUBE TREATMEN	ALTERING CASING	
SHOOT OR ACIDIZE ABANDON		SHOOTING OR ACIDIZI		
REPAIR WELL CHANGE		(Other) Produc	tion Casing, Perf. X	
(Other)		(Note: Report Completion or)	results of multiple completion on Well Recompletion Report and Log form.)	
	: (Clearly state all pertine) rilled, give subsurface loca	it details, and give pertinen tions and measured and true	t dates, including estimated date of starting vertical depths for all markers and zones p	any erti-
guide shoe set 5000'	, float collar 2° C	r = 3 and 5#/sa	ng set 5000'. 1-Regula Cemented w/225 sacks ck salt. PD 12:15 AM	.r
guide shoe set 5000', 65/35 Poz with .4% Ha 4-9-87. Bumped plug held okay. WOC 18 ha setter Lite. Circula WIH and perforated 4'	, float colla: alad-4, .3% C to 1000 psi, rs. Ran l''te ated 20 sacks 750-56' w/24 d Frac'd (v	FR-3 and 5#/sac released press 0 1500'. Cemen .42" holes (4 5 12 4-1/2" casi	ck salt. PD 12:15 AM sure, float and casing nted w/250 sacks Pace- SPF). Acidized w/1000 ng) perforations 4750-5	r
guide shoe set 5000', 65/35 Poz with .4% Ha 4-9-87. Bumped plug held okay. WOC 18 ha setter Lite. Circula	, float colla: alad-4, .3% C to 1000 psi, rs. Ran l''te ated 20 sacks 750-56' w/24 d Frac'd (v	FR-3 and 5#/sac released press 0 1500'. Cemen .42" holes (4 5 12 4-1/2" casi	ck salt. PD 12:15 AM sure, float and casing nted w/250 sacks Pace- SPF). Acidized w/1000 ng) perforations 4750-5 sand.	r
guide shoe set 5000' 65/35 Poz with .4% Ha 4-9-87. Bumped plug held okay. WOC 18 ha setter Lite. Circula WIH and perforated 4' gals 7-1/2% NEFE acie w/30000 gals gelled 1	, float collar alad-4, .3% C to 1000 psi, rs. Ran 1" to ated 20 sacks 750-56' w/24 d. Frac'd (v KCL water and	FR-3 and 5#/sac released press 0 1500'. Cemen .42" holes (4 5 12 4-1/2" casi	ck salt. PD 12:15 AM sure, float and casing nted w/250 sacks Pace- SPF). Acidized w/1000 ng) perforations 4750-5 sand.	r
guide shoe set 5000' 65/35 Poz with .4% Ha 4-9-87. Bumped plug held okay. WOC 18 ha setter Lite. Circula WIH and perforated 4' gals 7-1/2% NEFE acie w/30000 gals gelled 1	, float collar alad-4, .3% C to 1000 psi, rs. Ran 1" to ated 20 sacks 750-56' w/24 d. Frac'd (v KCL water and	FR-3 and 5#/sac released press 0 1500'. Cemen .42" holes (4 5 12 4-1/2" casi	ck salt. PD 12:15 AM sure, float and casing nted w/250 sacks Pace- SPF). Acidized w/1000 ng) perforations 4750-5 sand. APR 17 1987	r
guide shoe set 5000' 65/35 Poz with .4% Ha 4-9-87. Bumped plug held okay. WOC 18 ha setter Lite. Circula WIH and perforated 4' gals 7-1/2% NEFE acid w/30000 gals gelled 1 8. I have by certify that the foregoing is true of	, float collar alad-4, .3% C to 1000 psi, rs. Ran 1" to ated 20 sacks 750-56' w/24 d. Frac'd (v KCL water and KCL water and	F Set 4938.73 FR-3 and 5#/sac released press o 1500'. Cemen .42" holes (4 S ia 4-1/2" casi 60000# 20/40	cvisor DATE 4-15-87	r
guide shoe set 5000' 65/35 Poz with .4% Ha 4-9-87. Bumped plug held okay. WOC 18 hi setter Lite. Circula WIH and perforated 4' gals 7-1/2% NEFE acid w/30000 gals gelled 1 8. I hereby certify that the foregoing is true to SIGNED Contact of the space for Federal or State office use)	, float collar alad-4, .3% C to 1000 psi, rs. Ran 1" to ated 20 sacks 750-56' w/24 d. Frac'd (v KCL water and KCL water and	F Set 4938.73 FR-3 and 5#/sac released press o 1500'. Cemen .42" holes (4 S ia 4-1/2" casi 60000# 20/40	Concentration and the salt. PD 12:15 AM sure, float and casing ited w/250 sacks Pace- SPF). Acidized w/1000 ing) perforations 4750-5 sand. APR 17 1987 APR 17 1987 New MEAN APR 17 1987	r
guide shoe set 5000' 65/35 Poz with .4% Ha 4-9-87. Bumped plug held okay. WOC 18 hi setter Lite. Circula WIH and perforated 4' gals 7-1/2% NEFE acid w/30000 gals gelled 1 	, float collar alad-4, .3% C to 1000 psi, rs. Ran 1" to ated 20 sacks 750-56' w/24 d. Frac'd (v KCL water and KCL water and	F Set 4938.73 FR-3 and 5#/sac released press o 1500'. Cemen .42" holes (4 S ia 4-1/2" casi 60000# 20/40	Concentration and the salt. PD 12:15 AM sure, float and casing ited w/250 sacks Pace- SPF). Acidized w/1000 ing) perforations 4750-5 sand. APR 17 1987 APR 17 1987 BOSMILL, NEW MELT PETER W. CHESTER PETER W. CHESTER	r
guide shoe set 5000' 65/35 Poz with .4% Ha 4-9-87. Bumped plug held okay. WOC 18 has setter Lite. Circula WIH and perforated 4' gals 7-1/2% NEFE acid w/30000 gals gelled 1 W/30000 gals gelled 1 (NED Contact Voltage 18 true of the space for Federal or State office use) APPROVED BY	, float colla: alad-4, .3% C to 1000 psi, rs. Ran 1" to ated 20 sacks 750-56' w/24 d. Frac'd (v KCL water and KCL water and Mand correct TITLE	r Set 4938.73 FR-3 and 5#/sac released press o 1500'. Cemen 42" holes (4 S ia 4-1/2" casi 60000# 20/40 coduction Super	Concentration and the salt. PD 12:15 AM sure, float and casing ited w/250 sacks Pace- SPF). Acidized w/1000 ng) perforations 4750-5 sand. APR 17 1987 APR 17 1987 Perfer date definition of the second Perfer w. CHESTER MAY 14 1987	