

12-10-93

Set cement plugs as follows:

45 sxs @6690-6540', Premium Plus neat cmt.
45 sxs @6128-6100', " " " "
40 sxs @4940-4800', " " " "
40 sxs @4440-4300', " " " "
250 sxs @ 2972-2300', tagged @2300' Premium Plus Neat cmt. W/2% CaCl2
35 sxs @1870-1750', Premium Plus Neat cmt.
35 sxs @1550-1430', " " " "
30 sxs @578-450', " " " "
15 sxs @60' to surf.

Cut off wellheads. Installed dry hole marker. Jet and cleaned pits.
Well Plugged and Abandoned