
## STATE OF NEW MEXICO ENERGY AND MINERALS DEPARTMENT

CONTRACTOR CAN LON		
	3	
DISTRIBUTION		
BANTA FE	1.1	
FICE	1/-	
U.S.O.S.	1	
LAND OFFICE		
OPERATOR	1/	

## OIL CONSERVATION DIVISION

Form C-103

DISTRIBUTION	P. O. BOX THE CETVED SANTA FE, NEW MEXICO 87501	Revised 19-1-73
SANTAFE	SANTA FE, NEW MEXICO 87501	5a. Indicate Type of Lease
U.S.O.S.	<b>JUN 4 1979</b>	State X Fee
LAND OFFICE		5. State Off 6 Gas Lease No.
OPERATOR	0, C, C,	Kirring 647
SUNDRY I	NOTICES AND REPORTS ON WELLS TO MALL OF TO BEFORE THE BLOW BACK TO A DIFFERENT RESERVOIR.	
(DO NOT USE THIS FORM FOR PROPES USE "APPLICATION	ALS TO DRILL ON TO DEPTH ON NEW BACK (V A)	7. Unit Agreement Name Empire Abo Pressure
OIL X WILL	OTHER-	Maintenance Project
	Gas Company	6. Farm or Lease Name
Division of	Atlantic Richfield Company	Empire Abo Unit "G"
3. Address of Operator		25
Box 1710, Hobbs, New Mex	rico 88240	10. Field and Pool, or Wildcat
4. Location of well	1650	Empire Abo
UNIT LETTER 99	00 FEET FROM THE West LINE AND 1650 FEET FRO	
Count	32 TOWNSHIP 17S RANGE 28E NMPH	
THE SOUTH LINE, SECTION		7777
	15. Elevation (Show whether DF, RT, GR, etc.)	12. County
	3676' GR	Eddy   Charles
	propriate Box To Indicate Nature of Notice, Report or C	Ither Data NT REPORT OF:
NOTICE OF INT	ENTION TO:	WI KEI OKI OI.
	PLUG AND ABANDON REMEDIAL WORK	ALTERING CASING
PERFORM REMEDIAL WORK	COMMENCE DRILLING OPHS.	PLUG AND A AANDONMENT
PULL OR ALTER CASING	CHANGE PLANS CASING TEST AND CEMENT JOB	
	OTHER	
OTHER Cement Squeeze Pro	od Csg X	
12 Describe Proposed or Completed Oper	otions (Clearly state all pertinent details, and give pertinent dates, include	ing estimated date of starting any proposed
work) SEE RULE 1103.		
TD 6123', PBD 6095'. P	resently completed in Abo perfs 5996-6012'. et @ 728' & cmt circ w/225 sx.	
- 1 /011 OD 15 E# 7 E5 000	oot 0 6125' & cmtd w/450 sx. TOC @ 2460'.	
Propose to cement squeez	e behind $5-1/2$ " OD csg to eliminate any possition	oility of a water flow to
surface in accordance w/	OCD request in the following manner:	
<ol> <li>Rig up, kill well, i</li> </ol>	nstall BOP & POH w/compl assy.	
2. Run cased hole survey	1. A common 2250! Actablish circ	
3. Periorate 4 squeeze n	oles @ approx 2350', establish circ. set BP @ 2400' w/2 sx sd on top, set retr @ 2	2325' & cmt squeeze w/150 sx
c1 c w/2% cac1, circ	to surf.	
5. Drill out cmt & cmt r	etr. Pressure test squeeze job w/1000# 30 min	ns.
6. Circ out sd on BP, re	ec RBP.	
7. RIH w/compl assy, ret	urn to production .	•
·		•
		•
If I hereby certify that the information	above is true and complete to the best of my knowledge and belief.	
10. 1 nereoy		5/31/79
Tople	Dist. Drlg. Supt.	DATE
.7	Diameter H	JUN 7 1979
1:00	SUPERVISOR, DISTRICT II	JUH - 1313

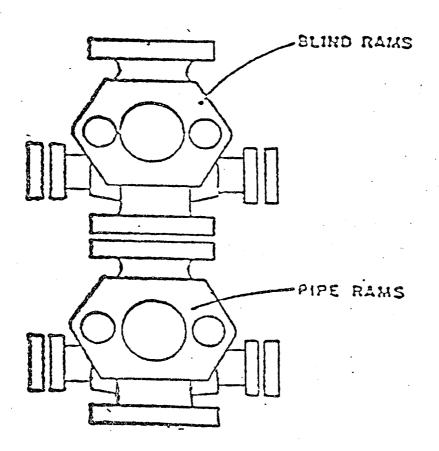

ATIANTIC RICHFIELD COMPANY Blow Out Preventer Program

Lease Name	Empire Abo Unit "G"
well No.	25
Location	990' FWL & 1650' FSL
	Sec 32-17S-28E, Eddy County

BOP to be tested before installed on well and will be maintained in good working condition during drilling. wellhead fittings to be of sufficier pressure to operate in a safe manner.