

Submit 3 Copies To Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

CIS

Form C-103
Revised March 25, 1999

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-015-01740
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator B-P America		6. State Oil & Gas Lease No.
3. Address of Operator P.O. Box 1089 Eunice, New Mexico 88231		7. Lease Name or Unit Agreement Name Empire Abo Unit "F"
4. Well Location Unit Letter <u>H</u> : <u>1650</u> feet from the <u>North</u> line and <u>990</u> feet from the East <u> </u> line Section <u>35</u> Township <u>17S</u> Range <u>28E</u> NMPM Eddy County NM		8. Well No. F-40
10. Elevation (Show whether DR, RKB, RT, GR, etc.) <u>CLH</u> <u>3671 GR</u>		9. Pool name or Wildcat Abo

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation. PROCEDURE TO P&A. NO UP HOLE POTENTIAL.

1. MIRU & NUBOP.
2. TIH. TAG CIBP @ 6124' & cap w/25 sxs. cmt.
3. Circulate hole w/9.5# salt gel mud.
4. Perf 5 1/2" csg. @ 3600'.
5. TIH w/pkr. Squeeze 35 sxs. cmt. 3600'-3500'. Covers Glorieta.
6. Perf 5 1/2" csg. @ 807'.
7. TIH w/pkr. Squeeze 50 sxs. cmt. 807'-707'. 8 5/8" shoe plug. TAG.
8. Perf 5 1/2" csg. @ 530'.
9. TIH w/pkr. Squeeze 35 sxs. cmt 530'-430'. Covers Yates.
10. Perf 5 1/2" csg. @ 60'.
11. Circulate 5 1/2" & 8 5/8" csg. w/ 10 sxs. cmt. to surface.
12. Cut off well head 7 anchors 3' BGL. Clean up location. Set Dry Hole Marker.

Notify OCD 24 hrs. prior to any work done

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kellie D. Murrish TITLE Asst Admin Asst DATE 07.22.02

Type or print name KELLIE D. MURRISH Telephone No. 505.394.1649
(This space for State use)

APPROVED BY [Signature] TITLE Field Rep II DATE JUL 30 2002

Conditions of approval, if any: