

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C-103  
Revised 1-1-89

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

AUG 13 '90

O. C. D.

WELL API NO. 30-015-01753
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. B-11593
7. Lease Name or Unit Agreement Name EMPIRE ABO UNIT "E"
8. Well No. 37
9. Pool name or Wildcat EMPIRE ABO

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	
2. Name of Operator ARCO OIL AND GAS COMPANY	
3. Address of Operator BOX 1710, HOBBS, NEW MEXICO 88240	
4. Well Location Unit Letter <u>D</u> : <u>660</u> Feet From The <u>WEST</u> Line and <u>660</u> Feet From The <u>NORTH</u> Line Section <u>35</u> Township <u>17S</u> Range <u>28E</u> NMPM <u>EDDY</u> County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3689' DF	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐  
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐  
CASING TEST AND CEMENT JOB ☐  
OTHER: TEMPORARILY ABANDON ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

TA AND HOLD WELL BORE FOR FIELD BLOW DOWN

TD 6350'; Perfs: 6040-6048'

8/6/90 MIRU. DDP. Well dead. N/D W/H N/U BOP. Unset TAC. Pick up 3 jts tbg, tag up in well @ 6100'. POH w/tbg, TAC, SN, PN & MA. RIH w/5-1/2" CIBP, running tool, and tbg. Set CIBP. POH w/1 jt tbg. Circ well w/8.6# brine w/WT-675 chemical. SDON.

8/7/90 RO. Well dead. R/U pump truck. Load well w/1 brrl 8.6# brine. Press up to 500#. Held for 15 mins. (Chart attached.) RD kill truck. POH w/tbg and CIBP running tool. Laying tbg down in singles. N/D BOP N/U W/H. Left 1 jt 2-3/8" tbg on W/H flange. CIBP set @ 6022.26'.

Pressure test witnessed by Mike Stubblefield-NMOCD. Chart Attached.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE James D. Cogburn TITLE Administrative Supervisor DATE 8/10/90  
TYPE OR PRINT NAME James D. Cogburn TELEPHONE NO. 392-3551

(This space for State Use)

APPROVED BY Gary W. Williams TITLE OIL AND GAS DIVISION DATE 8/20/90  
CONDITIONS OF APPROVAL, IF ANY:

This Approval of Temporary  
Abandonment Expires 8/7/95

