	DEPAR	TME OF T	HE INTERIOR	Other Instruction in room OTH COMS. C 1551 Wer DD	LC-067610-a
·	SUNDRY NO			WEI DD WEI S <sup>NN</sup> 88210	6. 3P INDIAN, ALLATTEE OR TRIBE NAME
6 8 Per - 124	of use this form for pro-	socials to drill or to		a differenteret suls	
i. WELL GAN GAN WELL OTHER Water Inj			ection	AUG 19 1985	7. UNIT AGREEMENT NAME
2. NAME OF C	al American Oil	Company of	Tevas	0. C. D.	R. FAMI OR LEASE NAME
	3. ADDREAN OF OFENATOR			ARTESIA, OFFICE	U. WELL NO.
		oco Hills, N		255	4
200 BISO 8J	or write (Report location pace 17 below.)	10. FIELD AND PHOL, OR WILDCAT			
Al surface 990' FSL and 990' FEL					High Lonesome
-					AUEVET OR ABEA
			·		Sec. 14, T-16S, R-29E
14. PERMIT NO	ı.		(Show whether DF, NT, CI 9' DF	s. etc.)	Eddy New Mexic
16.	Check A	Appropriate Box	To Indicate Nature	of Notice, Report, or (	Other Data
	NOTICE OF INT		1		UENT REPORT OF:
TERT WAT	TER BHUT-OFF	PULL OR ALTER CA	SING	WATER SHUT-OFF	REPAIRING WELL
FRACTURE	TREAT	MULTIPLE COMPLET	TF.	FRACTURE TREATMENT	ALTERING CABING
KHOOT OR		ABANDON*		RHOUTING OR AFIDIZING	ABANDON MENT. X
REPAIR W	•···· []	CHANGE PLANE	*	(Other)(Note : Report results	of multiple completion on Well
the office of the second	BOROSED OF COMPLETED OF 8 work. If well is direct this work.) •	DERATIONS (Clearly ) tionally drilled, give	state all pertinent deta subsurface locations a	Its and glass together at dates	iction Report and Log form.) , including estimated date of starting any al depths for all markers and zones perti-
The foll	lowing work was	completed I	March 20 — 26	5, 1981	
1.	Tubing and pa	cker pulled	•		
2.	Set 145 sack	plug, 2079'-	-1400', (Open	hole section 207	9'-2050').
3.	No casing det	ermined free	2.		
4.	Perforated 4 (Plug insid	holes at 888 e casing 938	3' and squeeze 3'-800').	e <mark>d 55 sa</mark> cks <mark>c</mark> emen	t into Base of Salt,
5.	Perforated 4 the water z	holes at 460 one.	)' and squeeze	d 55 sacks cement	t into Top of Salt and
~	Sat 25 sack n	lug inside d	casing to plug	to 300'	
б.	Jet 20 Sack p		• •		
6. 7.		lug at surfa			
7.		•	ace.		. •
7. . 8. Add	Set 10 sack p Permanent dry	hole marker	ace. ^ installed. omitted when t		eaned-up at the end
7. 8. Add of	Set 10 sack p Permanent dry Jitional report the 10 well ab	hole marker will be sub andonment pr	ace. ^ installed. omitted when t		eaned-up at the end
7. 8. Add of	Set 10 sack p Permanent dry ditional report the 10 well ab	hole marker will be sub andonment pr	ace. installed. pmitted when t rogram.	he location is cl	
7. 8. Add of	Set 10 sack p Permanent dry Jitional report the 10 well ab	hole marker will be sub andonment pr	ace. ^ installed. omitted when t	he location is cl	eaned-up at the end
7. 8. Add of 18. I bereby ce signed	Set 10 sack p Permanent dry ditional report the 10 well ab	hole marker will be sub andonment pr	ace. installed. pmitted when t rogram. Engin	he location is cl	

\*See Instructions on Reverse Side

••