Form 3160-5 (June 1990)

Conditions of approval, if any:

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

N.M. DIV-Distor APPROVED 1301 W. Grand A. Burgar No. 1004-0135 Artesia, Meas 88 24 10 and Serial No.

NM 05523 SUNDRY NOTICES AND REPORTS ON WELLS 6. If Indian, Allottee or Tribe Name Do not use this form for proposals to drill or to deepen or reentry to a different reservoir. Use "APPLICATION FOR PERMIT—" for such proposals 7. If Unit or CA, Agreement Designation SUBMIT IN TRIPLICATE 1. Type of Well 8. Well Name and No. Oil Well Water Injection Well Gas Well X Other High Lonesome Penrose #6 2. Name of Operator 9. API Well No. 30-015-02720 Vintage Drilling, LLC 3. Address and Telephone No. 10. Field and Pool, or Exploratory Area P.O. Box 158, Loco Hills, NM 88255 (505)\746-16694. Location of Well (Footage, Sec., T., R., M., or Survey Description) 11. County or Parish, State 990 FNL & 2310' FEL 24 Eddy County, NM Sec. 15, T-16-S, R-39-E CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA 12 TYPE OF ACTION TYPE OF SUBMISSION Change of Plans Notice of Intent Abandonment **New Construction** Recompletion Non-Routine Fracturing Plugging Back Subsequent Report Water Shut-Off Casing Repair Conversion to Injection K Final Abandonment Notice Altering Casing Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) 13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)* 3-28-02 Rig up unit. 3-29-02 Spot 25 sx cmt. @ 1966', WOC over the weekend. 4-01-02 RIH to tag cmt. plug (Did Not Tag), mix 4 sx Maxi Seal (LCM) Spot 25 sx cmt. w/ 2% CaCl, WOC 4 hrs. RIH to tag (Did Not Tag). Mix another 4 sx LCM, spot 25 sx cmt., WOC until next day. 4-02-02 RIH to tag cmt. plug, tagged @ 1885', spot another 25 sx on top. WOC until next day. 4-03-02 Tag cmt. plug @ 1851', mud up hole, perf 4 holes @ 875', spot 30 sx, WOC 4 hrs., RIH to tag cmt. plug, tagged @ 1766', mix 7 sx of sand, let it set 30 min, mix 4 sx of Maxi Seal (LCM), let it set one hr. Spot 30 sx cmt. on top, WOC until next day. 4-04-02 Tag cmt. plug @ 682', perf 4 holes @ 467', spot 30 sx @ 520' w/ 2% CaCl WOC 4 hrs, RIH to tag plug. Tagged @ 285', spot 10 sx to surface, rig down unit and cement equipment. Install dry hole marker, clean location. Approved as to plugging of the well bore Uability under bond is retained until surface restoration is completed. 14. I hereby certify that the foregoing is true and correct 04/24/02 Agent Title Date Approved by (ORIG. SGD.) ALEXIS C. SWC MAY 1 0 2002 PETROLEUM ENGINEER