

30-0 - 03821

3654'N/330'E - 2-16-30

Salado Operating L.L.C.

East Henshaw UT Tr. 10 #4

Before

1. Run + set CIBP @ 2891' w/35' cement.
or Run tubing to 2891'
Set 25 sk cement @ 2891'-2791'. TAH

2. Circulate brine gel.

3. Perforate 2 7/8" casing @ 1520'

4. Run packer. Squeeze cement
100' cement Plug inside + outside 2 7/8" casing. TAH

5. Perforate 2 7/8" casing @ 500'

6. Circulate cement to surface
Inside + outside 2 7/8" casing.
Pull tubing + Top off cement to surface.

8. Cut + level all surface pits
Cut dead men, Clear location of junk.
Erect dry hole marker.

5 1/4" hole = Perfs 2991'-3001'

2 7/8" casing
set @ 3147'

cmtd w/2005X

Temp. Survey Toc
2070'