

30-15-03821

3654'N/330'E - 2-16-30

Salado Operating L.L.C.

East Henshaw UT Tr. 10 #4

After

1. Run & set CIBP @ 2891' w/35' cement.
or Run tubing to 2891'
Set 25 sx cement @ 2891'-2991'. TA4

2. Circulate brine gel.

3. Perforate 2 7/8" casing @ 1520'.

4. Run packer. Squeeze cement
100' cement Plug inside & outside 2 7/8" casing. TA4

5. Perforate 2 7/8" casing @ 500'

6. Circulate cement to surface
Inside & outside 2 7/8" casing.
Pull tubing & top off cement to surface.

8. Cut & level all surface pits
Cut dead men, clear location of junk.
Erect dry hole marker.

7" casing
set @ 110'

6 1/4" hole
Perfs 2991'-3001'

2 7/8" casing
set @ 3147'

cmtd w/2005X

Temp. Survey To c
2070'