

297.5 / 1650 E - 2 - 16.30
Salado Operating L.L.C.
East Henshaw UT Tr. 15 #6

Before

1. Run + set CIBP @ 2890' w/ 35' cement.
or Run tubing to 2890'
Set 25 sx cement Plug 2890' - 2790'. TAG
2. Circulate brine gel.
3. Perforate 2 7/8" casing @ 1510'
4. Run packer. Squeeze cement
100' cement Plug inside + outside 2 7/8" casing. TAG
5. Set Tubing @ 500'.
Circulate cement to surface.
6. Cut + level all surface pits,
Cut dead men, clear junk from location,
Erect dry hole marker.

= Perfs. @ 90' - 95'

7 7/8" hole

2 7/8" casing

set @ 3009'

Cmtd w/ 250 sx 1" from 500' to surface.

Temp. Survey To
2020' 500' to surface.