

30-015-03843

2920 S / 1650 E - 2-16-30

Salado Operating L.L.C.

East Henshaw UT Tr. 15 #6

After

1. Run + set CIBP @ 2890' w/ 35' cement.
or Run tubing to 2890'
Set 25 sx cement Plug 2890' - 2790'. TAG

2. Circulate brine gel.

3. Perforate 2 7/8" casing @ 1510'

4. Run packer. Squeeze cement
100' cement Plug inside + outside 2 7/8" casing. TAG

5. Set Tubing @ 500'. Perforate 500'.
Circulate cement to surface.

6. Cut + level all surface pits,
Cut dead men, clear junk from location,
Erect dry hole marker.

Perfs. @ 90'-95'

7 7/8" hole

2 7/8" casing

set @ 3009'

Circulated w/ 250 sx 1" from 500' to surface.

Temp. Survey To

2020' 500' to surface.