

## ATTACHMENT "A"

We propose to drill and complete this well without setting surface casing using the following procedure.

1. Drill 6 3/4" or 6 1/4" hole to total depth.
2. Set 2 7/8" oil string casing at total depth.
3. Cement first stage from the bottom of the shoe back into the salt section using 300 sacks of 4% Gel cement.
4. Run a small retrievable string of tubing outside the oil string casing to 500' and circulate cement to the surface of the ground using 250 sacks of 4% Gel cement.
5. All available logs and information indicate no surface water in this area.
6. This method of completion would adequately protect any fresh water encountered.

Two cores in the Gravgurg Zone. One at 2900' and one at 3000'.

HOWCO method of cementing to be used.

Min. mud for samples.