

30-015-03825

1480'S / 660'E - 2-16-30

Salado Op. LLC.

E. Henshaw Ut. Tr. 24 #1

After

1. Run & Set CIBP w/35' cement @ 2921'
or Run tubing to 2921'

Set 255K cement Plug 2921'-2821'. TAG

2. Circulate brine gel.

3. Perforate 2 7/8" casing @ 1532'.

4. Run Packer & Squeeze
100' cement Plug inside & outside
2 7/8" casing. TAG

5. Set tubing @ 500'.
Circulate cement to surface.
Pull tubing & top off cement to surface.

6. Cut & level all surface pits,
cut deadmen, clear location of junk.
Erect dry hole marker.

7 7/8" hole
Perfs 3021'-28'

2 7/8" csq
set @ 3075'

Cased w/2505K 1" 500' to surface

Temp. survey TOC

1825' 500' to surface.