

30-015-03825

1980'S / 660'E - 2-16-30

Salado Op. LLC.

After

E. Henshaw Ut. Tr. 24 #1

1. Run + Set CIBP w/35' cement @ 2921'
or Run tubing to 2921'
Set 25sx cement Plug 2921': 2821'. TAG

2. Circulate brine gel.

3. Perforate 2 7/8" casing @ 1537'.

4. Run Packer + Squeeze
100' cement Plug inside + outside
2 7/8" casing. TAG

5. Set tubing @ 500'.
Circulate cement to surface.
Pull tubing + Top off cement to surface.

6. Cut + level all surface pits,
cut deadmen, clear location of junk.
Erect dry hole marker.

7 7/8" hole
± Perfs 3021'-28'

2 7/8" csq
set @ 3075'

Cmtd w/250sx 1" 500' to surface.

Temp. survey TOC

1825' 500' to surface.