

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

Drawer DU
Artesia, NM 88210

FORM APPROVED
Budget Bureau No. 1004-1035
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir
Use "APPLICATION FOR PERMIT--" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Merit Energy Company

3. Address and Telephone No.

P.O. Drawer NN - Jal, NM 88252 (505)395-2173

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

Sec 24, T16S, R30E, 660 FSL 1980 FEL

5. Lease Designation and Serial No.

NM 074951

6. If Indian, Allottee of Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Henshaw Deep #2

9. API Well No.

30-015-03918

10. Field and Pool, or Exploratory Area

Henshaw Wolfcamp

11. County or Parish, State

Eddy, NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other _____

- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report of multiple completion on Well
Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

See Attached

14. I hereby certify that the foregoing is true and correct

Signed

Adam Salameh

Title West District Operations Supt

Date 27-Mar-95

(This space for Federal or State office use)

Approved by

Orig. Signed by Adam Salameh

Title

Petroleum Engineer

Date

3/31/95

Conditions of approval, if any:

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

*See Instruction on Reverse Side

P&A PROCEDURE
Henshaw Deep Unit #2
7 Miles NE of Loco Hills
Eddy County, New Mexico -

CASING PROGRAM: 13-3/8" @ 492'
8 5/8" @ 3098', TOC surface
5-1/2" @ 9750, 15.5 & 17#, (calc) 6838'

- 1) MIRU well service unit and plugging equipment. Dig and line 200 bbl working pit. Blow down well. RU pump truck and test tbg to 500#. Unseat pump and POOH w/rods & pump.
- 2) ND wellhead and NU tbg BOP. Load hole w/ +/- 40 bbl 9 ppg mud laden brine (25 sx gel per 100 bbl water). Release TAC and POOH w/ tbg standing back 6550' and laying remainder down.
- 3) RU wireline truck and set 5-1/2" CIBP @ 7750'. POOH w/ setting tool, RIH w/ dump bailer and dump 35' C cmt on top of CIBP. POOH w/ dump bailer.
- 4) RIH w/ tbg to 6550'. Circulate hole w/ 60 bbl 9 ppg mud up to +/- 3000'. POOH w/ tbg standing back.
- 5) RIH w/ wireline and cut csg @ +/- 6000'. POOH w/ wireline. ND BOP and wellhead, spear 5-1/2" csg. NU csg BOP and RU csg tools, POOH w/ 5-1/2" csg. RD csg tools.
- 6) RIH w/ tbg to 50' inside csg stub. Load hole w/ mud and pump 120 sx C cmt to cover 50' inside stub to 5650'. WOC a minimum of 4 hrs and tag plug. POOH w/ tbg to 3120'. Spot 100' plug across intermediate csg. WOC tag 4 hrs.
- 6a) Perf and squeeze @ 515'.
- 7) Load hole w/ mud and pump 45 sx C cmt from 565' to 465'. WOC 4 hrs and tag plug. POOH w/ tbg to 30'.
- 8) Pump surface plug from 50' to surface. RDMO location. Empty work pit and haul to disposal.
- 9) Cut off wellhead at least 3' below ground level. Install dry hole marker. Cover cellar and work pit. Cut off anchors.

In reference to our conversation on 3/23/95 with Joe Lara & Russell Whited.
BLM (505)887-6544