

Plug & Abandonment Procedure
Tenneco Hagerty Federal #1
BLM # NM-7724

September 10, 1997:

Notify BLM RU. MIRU Texas Lease Works. NU BOP & RIH to 943' with 30 joints 2 3/8" workstring.

September 11, 1997:

RU Halliburton and circulate 100 bbl 10# brine followed by 130 bbl 10# mud.

Mix & pump 60 sacks class 'C' to spot plug from 943'. Shut in well. WOC 2 hours and tag cement at 764'.

Pull out of hole with 14 joints of tubing to +/- 498'. Mix and pump 155 sacks class 'C' cement through tubing. Pull out of hole and WOC 2 hours. Tag cement on plug #2 at 210'.

Nipple down BOP and run 2 joints 2 3/8" tubing. Circulate cement from 60' to ground surface. Cut off wellhead and set PA marker. RD service unit.

September 23, 1997:

Close reserve pit and push caliche to State pit beside location.


September 24, 1997:

Finish ripping location, back drag, and re seed.

NOTES: No casing was cut or pulled during this plugging operation.

Please feel free to call me at (915) 688-0650 if you have any questions.

Thank you,

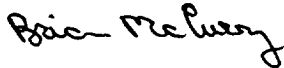

Brian McCurry