

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	<input checked="" type="checkbox"/>
FILE	<input checked="" type="checkbox"/>
U.S.G.B.	
LAND OFFICE	
OPERATOR	<input checked="" type="checkbox"/>

RECEIVED BY
JUN 18 1984
O. C. D.
ARTESIA, OFFICE

5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.
7. Unit Agreement Name
8. Farm or Lease Name Aid State Comm.
9. Well No. 1
10. Field and Pool, or Wildcat Aid Morrow (Gas)
12. County Eddy

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPLN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. ☐ OIL WELL ☒ GAS WELL ☐ OTHER-

2. Name of Operator
Pennzoil Company

3. Address of Operator
P.O. Drawer 1828, Midland, Texas 79702

4. Location of Well
UNIT LETTER A 660 FEET FROM THE North LINE AND 660 FEET FROM
THE East LINE, SECTION 24 TOWNSHIP 17-S RANGE 28-E NMPM.

15. Elevation (Show whether DF, RT, GR, etc.)
3715 GR

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Circulate hole w/salt gel mud.
2. Run CIBP & set @ 10,550, dump 35' cmt. on top. + 1 plug 10163 - 10063
3. Spot 100' plug (25 sx plug from 6900-7050) + 1 plug 8623 - 8523
4. Free point 5 1/2 casing cut off @ ± 5000'. 50' in & out & bag
5. Spot 100' plug (35 sx plug) across Csg. stub.
6. Spot 100' plug (35 sx plug) across 8 5/8" csg shoe. & bag 1932 - 2032 & bag
7. Spot 100' plug (35 sx plug) across 13 3/8" Csg. shoe @ 420'. 470 - 370 & bag
8. Spot 35' plug (25 sx plug) @ surface.
9. Clean-up location, fill pits and install surface marker.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Donald R Cray TITLE District Engineer DATE 6/13/84

APPROVED BY Barry Bueck TITLE Geologist DATE 8/1/84