

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE	<input checked="" type="checkbox"/>	
FILE	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
U.S.G.S.		
LAND OFFICE		
OPERATOR	<input checked="" type="checkbox"/>	

# NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-85

5a. Indicate Type of Lease
State <input type="checkbox"/> Free <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.

## SUNDY NOTICES AND REPORTS ON WELLS RECEIVED (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT - I" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER- <u>JUL 12 '89</u>	7. Unit Agreement Name
2. Name of Operator Beard Oil Company (405) 842-2333 ✓	8. Farm or Lease Name Hagstrom
3. Address of Operator Enterprise Plaza, 5600 N. May, Ste 200, Oklahoma City, OK 73112	9. Well No. #1
4. Location of Well UNIT LETTER <u>K</u> , <u>1983</u> FEET FROM THE <u>South</u> LINE AND <u>1992</u> FEET FROM THE <u>West</u> LINE, SECTION <u>8</u> TOWNSHIP <u>17S</u> RANGE <u>24E</u> N.M.P.M.	10. Field and Pool, or Wildcat East High Hope Atoka
15. Elevation (Show whether DF, RT, GR, etc.) 3818' RT	12. County Eddy

### Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

#### NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐  
TEMPORARILY ABANDON ☐  
PULL OR ALTER CASING ☐  
OTHER ☐

PLUG AND ABANDON ☐  
CHANGE PLANS ☐  
OTHER ☐

#### SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐  
COMMENCE DRILLING OPNS. ☐  
CASING TEST AND CEMENT JOB ☐  
OTHER ☐

ALTERING CASING ☐  
PLUG AND ABANDONMENT ☒  
OTHER ☐

### 17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

6-22-89: Release packer & trip out of hole w/tubing & packer  
6-23-89: Plug #1 - 25 sx cement from 6975'-6748', WOC, tag plug, load hole w/fresh water gelled mud (25# gel/bbl).  
Plug #2 - 25 sx cement from 5904'-5677'  
Plug #3 - 25 sx cement from 4750'-4523', cut off 4½" casing @ 3700', circ hole full of fresh water gelled mud (25# gel/bbl). Lay down 4½" casing.  
Plug #4 - 35 sx cement from 3750'-3645', in and out of casing stub, woc, tag plug  
Plug #5 - 35 sx cement from 3038'-2905'  
Plug #6 - 35 sx cement from 1715'-1582'  
Plug #7 - 40 sx cement from 1148'-1000', in & out of 8 5/8" surface casing, set @ 1107' WOC, tag plug  
6-24-89: Plug #8 - 75 sx cement from 250'-3' inside 8 5/8" csg, cut off csg 3' below ground & weld steel cap over top of csg. Install 4½" monument w/ 4½' above ground w/following welded on monument: Beard Oil Company Hagstrom #1, Eddy County, 1983' FSL & 1992' FWL, June 24, 1989  
Plugging witnessed by Mike Stubblefield of the New Mexico Oil Conservation Commission, Artesia, New Mexico. All Pits have been filled, location has been leveled and cleared of junk.

Part FD-2  
7-21-89  
P+H

### 18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Ronnie L. Richards TITLE Asst. Operations Manager DATE 7/10/89

APPROVED BY DK G.W. 12-28-89 TITLE \_\_\_\_\_ DATE \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY: