

Form 3160-5
(June 1990)

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

NM OIL CONS COMMISSION
Drawer DD
Artesia, NM 88210

CISF

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

United Meridian Corp. (Formerly General Atlantic Resources, Inc.)

3. Address and Telephone No.

410 17th Street, Suite 1400 Denver, CO 80202 (303) 573-5100

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1980' FEL & 660' FWL. Section 1-T16S-R27E

FORM APPROVED

Budget Bureau No. 1004-0135
Expires: March 31, 1993

5. Lease Designation and Serial No.

NM-8436-A

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Diamond Mound Federal #1

9. API Well No.

30-015-22419

10. Field and Pool, or Exploratory Area

Diamond Mound/Morrow

11. County or Parish, State

Eddy NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☐ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☒ Other Re-perforate
☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)


13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

Work was completed on 12/12/94. The following was done to re-perf the well in the same zone:

- 1) Move in rig-up wireline, rig-up pressure lubricator, go in hole with 1-11/16" sinker bar.
- 2) Tag PBDT at 8805', pull out of hole with sinker bar, rig-up strip gun and collar locator.
- 3) Go in hole to packer and tag bottom, line up and perforate Morrow zone with 29-.38 diameter holes at the following intervals:

8763, 8763.5, 8764, 8764.5, 8765, 8765.5 8766, 8766.5, 8767, 8767.6, 8768, 8768.5, 8769, 8774, 8779.5, 8780, 8780.5, 8781, 8781.5, 8782, 8784, 8784.5, 8785, 8785.5, 8786, 8786.5, 8787, 8787.5 and 8788.

- 4) Pull out of hole, rig-down wireline, turn well to sales line.

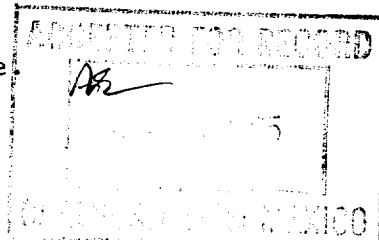

14. I hereby certify that the foregoing is true and correct

Signed Scott M. Webb Title Regulatory Coordinator

Date 12/14/94

(This space for Federal or State office use)

Approved by _____
Conditions of approval, if any:

Title _____

Date _____