

- b. If non-productive. Kill well and POOH w/ packer. Set CIB₁ @ 5950. Load and test casing to 500 psi.
- 9. Perforate Abo 5912'-5920' w/ 2 JSPF. Observe same procedure as above.
 - a. If on vacuum swab test.
 - b. If not on vacuum. TIH and spot acid and acidize w/ 1500 gallons 15% NEFE.
- 10. Swab test to evaluate.
 - a. If productive kill well and run CA as per production supervisor. ND BOPE.
 - b. If non-productive kill well and POOH. Set CIBP @ 5890' on tubing. Circulate hole w/ TFW and lay down tubing string. ND BOPE
- 11. TOTPS

M. W. Gore

Concur: ^{RCR 7-11-90} R. D. Reynolds J. E. Shields