

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

457

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

WELL API NO.

30-015-22707

5. Indicate Type of Lease

STATE ☒

FEE ☐

6. State Oil & Gas Lease No.

L-1604-2

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

OIL
WELL ☐

GAS
WELL ☒

OTHER

2. Name of Operator

Kaiser-Francis Oil Company

3. Address of Operator

P. O. Box 21468, Tulsa, OK 74121-1468

4. Well Location

Unit Letter G : 1980 Feet From The North Line and 1980 Feet From The East Line

Section 31 Township 17S Range 24E NMPM Eddy County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

3889 GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐

ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐

PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

The proposed plugging procedure is as follows:

1. Retrieve RBP's # 5039' and 7414'.
2. Set CIBP @ 7435' & spot 25 sx cmt plug on top of CIBP to 7200'.
3. Circ hole from 7200' to 4800' w/9.5 ppg SW gel. 10#
4. Set 20 sx cmt plug from 7060' - 6960'.
5. Set CIBP @ 4780' & dump 35' cmt on top.
6. Circ hole w/9.5 ppg SW gel. 10#
7. Locate free-point @ approx. 2000'. Cut off and pull 5" casing.
8. Set 50 sx cmt plug in top of casing stub. — Tag
9. Set 50 sx cmt plug from 1750' - 1650'. — Tag
10. Set 50 sx cmt plug from 250' - 150'. — Tag or bring to surface
11. Set 10 sx cmt plug at surface.
12. Cut off WH & install DH marker.

Notify NMO.CC in sufficient
time to witness cementing

the Tag of casing
plugs.

Estimated starting date: 7/15/97

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE C. Jan Valkenburg

TITLE Technical Coordinator

DATE 6/19/97

TYPE OR PRINT NAME Charlotte Van Valkenburg

918-491-4314 TELEPHONE NO.

(This space for State Use)

APPROVED BY Jim W. Gurn B6A

TITLE District Supervisor

DATE JUN 25 1997

CONDITIONS OF APPROVAL, IF ANY: