

- a. If productive kill well and run CA as per production supervisor.
 - b. If non-productive. Kill well and POOH w/ packer. Set CIBP @ 5970'. Load and test casing to 500 psi.
9. Perforate Abo 5915'-5925' w/ 2 JSPF. Observe same procedure as above.
- a. If on vacuum swab test.
 - b. If not on vacuum. TIH and spot acid and acidize w/ 1500 gallons 15% NEFE.
10. Swab test to evaluate.
- a. If productive kill well and run CA as per production supervisor. ND BOPE.
 - b. If non-productive kill well and POOH. Set CIBP @ 5890' on tubing. Circulate hole w/ TFW and lay down tubing string. ND BOPE. NU well head.
11. TOTPS

M. W. Gore

Concur:

RDR 7-11-70
R. D. Reynolds

J. E. Shields