Subant 3 Copies to Appropriate	Form C-103 Revised 1-1-59
Example Office	
DISTRICT 1         State of New Mexico           P.O. Box 1980, Hobbs, NM 88240         Energy, Minerals and Natural Resources Department	WELL API NO. 30-015-28607
DISTRICT II OIL CONSERVATION DIVISION	5. Indicate Type of Lease
P.O. Drawer DD, Artesia, NM 88210 P.O. Box 2088 Santa Fe, New Mexico 87504-2088	STATE FEE X
DISTRICT III	6. State Oil & Gas Lease No.
1000 Rio Brazos Rd., Aztec, NM 87410	
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A	7. Lease Name or Unit Agreement Name
DIFFERENT RESERVOIR USE "APPLICATION FOR PERMIT"	. Dense rum e e om r Ereemen rum
(FORM C-101 FOR SUCH PROPOSALS)	LEWIS "19"
1. Type of Well:	
OIL GAS WELL X OTHER	
WELL         WELL         X         OTHER           2. Name of Operator	8. Well No.
KCS Medallion Resources, Inc.	1
	•
3. Address of Operator	9. Pool Name or Wildcat
7130 South Lewis Ave., Ste 700, Tulsa, OK 74136	Eagle Creek; Atoka Morrow (East)
4. Well Location	
Unit Letter K ; 1980 Feet From The South Line and	1980 Feet From The West Line
	NTOW Edda Grants
Section 19 Township 17S Range 26E	NMPM Eddy County
GL = 3427'	
11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIA	SUBSEQUENT REPORT OF: L WORK ALTERING CASING
PERFORM REMEDIAL WORK	
TEMPORARILY ABANDON CHANGE PLANS COMMEN	CE DRILLING OPNS. PLUG AND ABONDONMENT X
SELL OR ALTER CASING	EST AND CEMENT JOB
	EST AND CEMENT JOB
OTHER OTHER	
OTHER OTHER OTHER	
OTHER OTHER OTHER OTHER OTHER OTHER OTHER OTHER	
OTHER OTHER OTHER 12. Describe Proposed or Completed Operations (Clearly state all pertinent details and give pertinent dates, including work) SEE RULE 1103. 7-16-97 Release packer. POOH with tubing. Set CIBP @ 8000'.	estimated date of starting any proposed
OTHER OTHER OTHER 12. Describe Proposed or Completed Operations (Clearly state all pertinent details and give pertinent dates, including work) SEE RULE 1103. 7-16-97 Release packer. POOH with tubing. Set CIBP @ 8000'. 7-17-97 RIH with tubing and loaded hole with 9.5 ppg mud laden brine. Spotted 25sk. Cl. C 14.8	estimated date of starting any proposed
OTHER       OTHER         12. Describe Proposed or Completed Operations (Clearly state all pertinent details and give pertinent dates, including work) SEE RULE 1103.       OTHER         7-16-97       Release packer. POOH with tubing. Set CIBP @ 8000'.         7-17-97       RIH with tubing and loaded hole with 9.5 ppg mud laden brine. Spotted 25sk. Cl. C 14.8         7-18-97       Freepoint and severed 4-1/2" casing .a. 6403'. POOH with 6403' of 4-1/2" casing.	estimated date of starting any proposed ppg cement plug from 8000' to 7661'. POOH.
OTHER       OTHER         12. Describe Proposed or Completed Operations (Clearly state all pertinent details and give pertinent dates, including work) SEE RULE 1103.       OTHER         7-16-97       Release packer. POOH with tubing. Set CIBP @ 8000!.         7-17-97       RIH with tubing and loaded hole with 9.5 ppg mud laden brine. Spotted 25sk. Cl. C 14.8         7-18-97       Freepoint and severed 4-1/2" casing .a 6403'. POOH with 6403' of 4-1/2" casing.         7-21-97       RIH with tubing and spotted 35 sk. 148 ppg coment plug from 6453' to 6324'. Tag top of	estimated date of starting any proposed ppg cement plug from 8000' to 7661'. POOH.
OTHER       OTHER         12. Describe Proposed or Completed Operations (Clearly state all pertinent details and give pertinent dates, including work) SEE RULE 1103.       OTHER         7-16-97       Release packer. POOH with tubing. Set CIBP @ 8000!.       RIH with tubing and loaded hole with 9.5 ppg mud laden brine. Spotted 25sk. Cl. C 14.8         7-18-97       Freepoint and severed 4-1/2" casing .a. 6403'. POOH with 6403' of 4-1/2" casing.         7-21-97       RIH with tubing and spotted 35 sk. 14.8 ppg cement plug from 6453' to 6324'. Tag top of from 5100' to 5200'.	estimated date of starting any proposed ppg cement plug from 8000' to 7661'. POOH.
OTHER       OTHER         12. Describe Proposed or Completed Operations (Clearly state all pertinent details and give pertinent dates, including work) SEE RULE 1103.       OTHER         7-16-97       Release packer. POOH with tubing. Set CIBP @ 8000!.         7-17-97       RIH with tubing and loaded hole with 9.5 ppg mud laden brine. Spotted 25sk. Cl. C 14.8         7-18-97       Freepoint and severed 4-1/2" casing :a; 6403'. POOH with 6403' of 4-1/2" casing.         7-21-97       RIH with tubing and spotted 35 sk. 14.8 ppg. cement plug from 6453' to 6324'. Tag top of from 5100' to 5200'.         7-22-97       Spotted additional 14.8 ppg Cl. C cement plugs as follows:	estimated date of starting any proposed ppg cement plug from 8000' to 7661'. POOH. same @ 6324'. Pulled up hole and spotted 35 sk. 14.8 ppg cement plug.
OTHER       OTHER         12. Describe Proposed or Completed Operations (Clearly state all pertinent details and give pertinent dates, including work) SEE RULE 1103.       OTHER         7-16-97       Release packer. POOH with tubing. Set CIBP @ 8000'.         7-17-97       RIH with tubing and loaded hole with 9.5 ppg mud laden brine. Spotted 25sk. Cl. C 14.8         7-18-97       Freepoint and severed 4-1/2" casing i.g. 6403'. POOH with 6403' of 4-1/2" casing.         7-21-97       RIH with tubing and spotted 35 sk. 14.8 ppg cment plug from 6453' to 6324'. Tag top of from 5100' to 5200'.         7-22-97       Spotted additional 14.8 ppg Cl. C cement plugs as follows:         35 sk       3100' - 3000'	estimated date of starting any proposed ppg cement plug from 8000' to 7661'. POOH. same @ 6324'. Pulled up hole and spotted 35 sk. 14.8 ppg cement plug.
OTHER       OTHER         12. Describe Proposed or Completed Operations (Clearly state all pertinent details and give pertinent dates, including work) SEE RULE 1103.       OTHER         7-16-97       Release packer. POOH with tubing. Set CIBP @ 8000'.         7-17-97       RIH with tubing and loaded hole with 9.5 ppg mud laden brine. Spotted 25sk. Cl. C 14.8         7-18-97       Freepoint and severed 4-1/2" casing :a, 6403'. POOH with 6403' of 4-1/2" casing.         7-21-97       RIH with tubing and spotted 35 sk. 14.8 ppg cement plug from 6453' to 6324'. Tag top of from 5100' to 5200'.         7-22-97       Spotted additional 14.8 ppg Cl. C cement plugs as follows:         35 sk       3100' - 3000'         180 sk       1445' - 1201'	estimated date of starting any proposed ppg cement plug from 8000' to 7661'. POOH. same @ 6324'. Pulled up hole and spotted 35 sk. 14.8 ppg cement plug.
OTHER       OTHER         12. Describe Proposed or Completed Operations (Clearly state all pertinent details and give pertinent dates, including work) SEE RULE 1103.       OTHER         7-16-97       Release packer. POOH with tubing. Set CIBP @ 8000'.         7-17-97       RIH with tubing and loaded hole with 9.5 ppg mud laden brine. Spotted 25sk. CL C 14.8         7-18-97       Freepoint and severed 4-1/2" casing :a; 6403'. POOH with 6403' of 4-1/2" casing.         7-21-97       RIH with tubing and spotted 35 sk. 14 8 ppg cement plug from 6453' to 6324'. Tag top of from 5100' to 5200'.         7-22-97       Spotted additional 14.8 ppg CL C cement plugs as follows:         35 sk       3160' - 3000'         180 sk       1445' - 1201'         34 sk       545' - 445'	estimated date of starting any proposed ppg cement plug from 8000' to 7661'. POOH. same @ 6324'. Pulled up hole and spotted 35 sk. 14.8 ppg cement plug. $P_{ab} = \frac{1}{2} \frac{1}{2}$
OTHER       OTHER         12. Describe Proposed or Completed Operations (Clearly state all pertinent details and give pertinent dates, including work) SEE RULE 1103.       OTHER         7-16-97       Release packer. POOH with tubing. Set CIBP @ 8000'.         7-17-97       RIH with tubing and loaded hole with 9.5 ppg mud laden brine. Spotted 25sk. CL C 14.8         7-18-97       Freepoint and severed 4-1/2" casing .a. 6403'. POOH with 6403' of 4-1/2" casing.         7-21-97       RIH with tubing and spotted 35 sk. 14 8 ppg cement plug from 6453' to 6324'. Tag top of from 5100' to 5200'.         7-22-97       Spotted additional 14.8 ppg CL C cement plugs as follows:         35 sk       3100' - 3000'         180 sk       1445' - 1201'         34 sk       545' - 445'         15 sk       3' - 33'	estimated date of starting any proposed ppg cement plug from 8000' to 7661'. POOH. same @ 6324'. Pulled up hole and spotted 35 sk. 14.8 ppg cement plug. $P_{ab} = \frac{1}{2} \frac{1}{2}$
OTHER       OTHER         12. Describe Proposed or Completed Operations (Clearly state all pertinent details and give pertinent dates, including work) SEE RULE 1103.       OTHER         7-16-97       Release packer. POOH with tubing. Set CIBP @ 8000'.         7-17-97       RIH with tubing and loaded hole with 9.5 ppg mud laden brine. Spotted 25sk. Cl. C 14.8         7-18-97       Freepoint and severed 4-1/2" casing .a. 6403'. POOH with 6403' of 4-1/2" casing.         7-21-97       RIH with tubing and spotted 35 sk. 14 8 ppg cement plug from 6453' to 6324'. Tag top of from 5100' to 5200'.         7-22-97       Spotted additional 14.8 ppg Cl. C cement plugs as follows:         35 sk       3100' - 3000'         180 sk       1445' - 1201'         34 sk       545' - 445'         15 sk       3' - 43'         Installed dry hole marker.	estimated date of starting any proposed ppg cement plug from 8000' to 7661'. POOH. same @ 6324'. Pulled up hole and spotted 35 sk. 14.8 ppg cement plug. $P_{ab} = \frac{1}{2} \frac{1}{2}$
OTHER       OTHER         12. Describe Proposed or Completed Operations (Clearly state all pertinent details and give pertinent dates, including work) SEE RULE 1103.       OTHER         7-16-97       Release packer. POOH with tubing. Set CIBP @ 8000'.         7-17-97       RIH with tubing and loaded hole with 9.5 ppg mud laden brine. Spotted 25sk. CL C 14.8         7-18-97       Freepoint and severed 4-1/2" casing .a. 6403'. POOH with 6403' of 4-1/2" casing.         7-21-97       RIH with tubing and spotted 35 sk. 14 8 ppg cement plug from 6453' to 6324'. Tag top of from 5100' to 5200'.         7-22-97       Spotted additional 14.8 ppg CL C cement plugs as follows:         35 sk       3100' - 3000'         180 sk       1445' - 1201'         34 sk       545' - 445'         15 sk       3' - 33'	estimated date of starting any proposed ppg cement plug from 8000' to 7661'. POOH. same @ 6324'. Pulled up hole and spotted 35 sk. 14.8 ppg cement plug. $P_{ab} = \frac{1}{2} \frac{1}{2}$
OTHER       OTHER         12. Describe Proposed or Completed Operations (Clearly state all pertinent details and give pertinent dates, including work) SEE RULE 1103.       OTHER         7-16-97       Release packer. POOH with tubing. Set CIBP @ 8000'.         7-17-97       RIH with tubing and loaded hole with 9.5 ppg mud laden brine. Spotted 25sk. Cl. C 14.8         7-18-97       Freepoint and severed 4-1/2" casing .a. 6403'. POOH with 6403' of 4-1/2" casing.         7-21-97       RIH with tubing and spotted 35 sk. 14 8 ppg cement plug from 6453' to 6324'. Tag top of from 5100' to 5200'.         7-22-97       Spotted additional 14.8 ppg Cl. C cement plugs as follows:         35 sk       3100' - 3000'         180 sk       1445' - 1201'         34 sk       545' - 445'         15 sk       3' - 43'         Installed dry hole marker.	estimated date of starting any proposed ppg cement plug from 8000' to 7661'. POOH. same @ 6324'. Pulled up hole and spotted 35 sk. 14.8 ppg cement plug. Post JD - 2 18 - 17 - 97 RECEIVED
OTHER       OTHER         12. Describe Proposed or Completed Operations (Clearly state all pertinent details and give pertinent dates, including work) SEE RULE 1103.       OTHER         7-16-97       Release packer. POOH with tubing. Set CIBP @ 8000!.         7-17-97       RIH with tubing and loaded hole with 9.5 ppg mud laden brine. Spotted 25sk. Cl. C 14.8         7-18-97       Freepoint and severed 4-1/2" casing .a 6403'. POOH with 6403' of 4-1/2" casing.         7-21-97       RIH with tubing and spotted 35 sk. 14 8 ppg cement plug from 6453' to 6324'. Tag top of from 5100' to 5200'.         7-22-97       Spotted additional 14.8 ppg Cl. C cement plugs as follows:         35 sk       3100' - 3000'         180 sk       1445' - 1201'         34 sk       545' - 445'         15 sk       3' - 43'         Installed dry hole marker.       7-23-97         7-23-97       Cleared location, P&A complete.	estimated date of starting any proposed ppg cement plug from 8000' to 7661'. POOH. same @ 6324'. Pulled up hole and spotted 35 sk. 14.8 ppg cement plug. $P_{ab} = \frac{1}{2} \frac{1}{2}$
OTHER       OTHER         12. Describe Proposed or Completed Operations (Clearly state all pertinent details and give pertinent dates, including work) SEE RULE 1103.       OTHER         7-16-97       Release packer. POOH with tubing. Set CIBP @ 8000'.         7-17-97       RIH with tubing and loaded hole with 9.5 ppg mud laden brine. Spotted 25sk. Cl. C 14.8         7-18-97       Freepoint and severed 4-1/2" casing .a. 6403'. POOH with 6403' of 4-1/2" casing.         7-21-97       RIH with tubing and spotted 35 sk. 14 8 ppg cement plug from 6453' to 6324'. Tag top of from 5100' to 5200'.         7-22-97       Spotted additional 14.8 ppg Cl. C cement plugs as follows:         35 sk       3100' - 3000'         180 sk       1445' - 1201'         34 sk       545' - 445'         15 sk       3' - 43'         Installed dry hole marker.	estimated date of starting any proposed ppg cement plug from 8000' to 7661'. POOH. same @ 6324'. Pulled up hole and spotted 35 sk. 14.8 ppg cement plug. $P_{ab} = \frac{1}{2} \frac{1}{2}$
OTHER       OTHER         12. Describe Proposed or Completed Operations (Clearly state all pertinent details and give pertinent dates, including work) SEE RULE 1103.       7-16-97         7-16-97       Release packer. POOH with tubing. Set CIBP @ 8000'.         7-17-97       RIH with tubing and loaded hole with 9.5 ppg mud laden brine. Spotted 25sk. Cl. C 14.8         7-18-97       Freepoint and severed 4-1/2" casing .a. 6403'. POOH with 6403' of 4-1/2" casing.         7-21-97       RIH with tubing and spotted 35 sk. 14 8 ppg cement plug from 6453' to 6324'. Tag top of from 5100' to 5200'.         7-22-97       Spotted additional 14.8 ppg Cl. C cement plugs as follows:         35 sk       3100' - 3000'         180 sk       1445' - 1201'         34 sk       545' - 445'         15 sk       3' - 63'         Installed dry hole marker.       7-23-97         7-23-97       Cleared location. P&A complete.	estimated date of starting any proposed ppg cement plug from 8000' to 7661'. POOH. same @ 6324'. Pulled up hole and spotted 35 sk. 14.8 ppg cement plug. $P_{out} J D - 2$ $I_{out} J D - 2$ $I_{out}$
OTHER       OTHER         12. Describe Proposed or Completed Operations (Clearly state all pertinent details and give pertinent dates, including work) SEE RULE 1103.       7-16-97         7-16-97       Release packer. POOH with tubing. Set CIBP @ 8000'.         7-17-97       RIH with tubing and loaded hole with 9.5 ppg mud laden brine. Spotted 25sk. Cl. C 14.8         7-18-97       Freepoint and severed 4-1/2" casing i.g. 6403'. POOH with 6403' of 4-1/2" casing.         7-21-97       RIH with tubing and spotted 35 sk. 14 8 ppg cement plug from 6453' to 6324'. Tag top of from 5100' to 5200'.         7-22-97       Spotted additional 14.8 ppg Cl. C cement plugs as follows:         35 sk       3100' - 3000'         180 sk       1445' - 1201'         34 sk       545' - 445'         15 sk       3' - 63'         Installed dry hole marker.       7-23-97         7-23-97       Cleared location. P&A complete.	estimated date of starting any proposed ppg cement plug from 8000' to 7661'. POOH. same @ 6324'. Pulled up hole and spotted 35 sk. 14.8 ppg cement plug. $P_{ab} = \frac{738970777}{1273}$
OTHER       OTHER         12. Describe Proposed or Completed Operations (Clearly state all pertinent details and give pertinent dates, including work) SEE RULE 1103.       OTHER         7-16-97       Release packer. POOH with tubing. Set CIBP @ 8000'.       Point and severed 4-1/2" casing .a. 6403'. POOH with 6403' of 4-1/2" casing.         7-18-97       RTH with tubing and loaded hole with 9.5 ppg mud laden brine. Spotted 25sk. CL C 14.8         7-18-97       RTH with tubing and spotted 35 sk. 14 8 ppg cement plug from 6453' to 6324'. Tag top of from 5100' to 5200'.         7-22-97       Spotted additional 14.8 ppg CL C cement plugs as follows:         35 sk       3100' - 3000'         180 sk       1445' - 1201'         34 sk       545' - 445'         15 sk       3' - 43'         Installed dry hole marker.       7-23-97         7-23-97       Cleared location. P&A complete.         Thereby certify that the information above is true and complete to the best of my knowledge and belief.         SIGNATURE       Mary Marker       TTHE	estimated date of starting any proposed ppg cement plug from 8000' to 7661'. POOH. same @ 6324'. Pulled up hole and spotted 35 sk. 14.8 ppg cement plug. $P_{out} J D - 2$ $I_{out} J D - 2$ $I_{out}$
OTHER       OTHER         12. Describe Proposed or Completed Operations (Clearly state all pertinent details and give pertinent dates, including work) SEE RULE 1103.       OTHER         7-16-97       Release packer. POOH with tubing. Set CIBP @ 8000'.       PooH with tubing and loaded hole with 9.5 ppg mud laden brine. Spotted 25sk. Cl. C 14.8         7-17-97       RIH with tubing and loaded hole with 9.5 ppg mud laden brine. Spotted 25sk. Cl. C 14.8         7-18-97       Freepoint and severed 4-1/2" casing 4.6403'. POOH with 6403' of 4-1/2" casing.         7-21-97       RIH with tubing and spotted 35 sk. 14 8 ppg cement plug from 6453' to 6324'. Tag top of from 5100' to 5200'.         7-22-97       Spotted additional 14.8 ppg Cl. C cement plugs as follows:         35 sk       3100' - 3000'         180 sk       1445' - 1201'         34 sk       545' - 445'         15 sk       3' - 63'         Installed dry hole marker.       7-23-97         7-23-97       Cleared location. P&A complete.         Thereby certify that the information above is true and complete to the best of my knowledge and belief.         SIGNATURE       Dir. Cased J	estimated date of starting any proposed ppg cement plug from 8000' to 7661'. POOH. same @ 6324'. Pulled up hole and spotted 35 sk. 14.8 ppg cement plug. $P_{out} JD - 2$ $I_{out} JD - 2$
OTHER       OTHER         12. Describe Proposed or Completed Operations (Clearly state all pertinent details and give pertinent dates, including work) SEE RULE 1103.       7-16-97         7-16-97       Release packer. POOH with tubing. Set CIBP @ 8000'.         7-17-97       RIH with tubing and loaded hole with 9.5 ppg mud laden brine. Spotted 25sk. Cl. C 14.8         7-18-97       Freepoint and severed 4-1/2" casing :a, 6403'. POOH with 6403' of 4-1/2" casing.         7-21-97       RIH with tubing and spotted 3's sk. 1'8 ppg cement plug from 6453' to 6324'. Tag top of from 5100' to 5200'.         7-22-97       Spotted additional 14.8 ppg Cl. C cement plugs as follows:         35 sk       3100' - 3000'         180 sk       1445' - 1201'         34 sk       545' - 445'         15 sk       3' - 63'         Installed dry hole marker.         7-23-97       Cleared location. P&A complete.         Thereby certify that the information above is true and complete to the best of my knowledge and belief.         SIGNATURE       TIFLE         TYPE OR PRINT NAME       Terry L. Reeves	estimated date of starting any proposed ppg cement plug from 8000' to 7661'. POOH. same @ 6324'. Pulled up hole and spotted 35 sk. 14.8 ppg cement plug. $P_{out} JD - 2$ $I_{out} JD - 2$
OTHER       OTHER         12. Describe Proposed or Completed Operations (Clearly state all pertinent details and give pertinent dates, including work) SEE RULE 1103.       7-16-97         7-16-97       Release packer. POOH with tubing. Set CIBP @ 8000'.         7-17-97       RIH with tubing and loaded hole with 9.5 ppg mul laden brine. Spotted 25sk, CL C 14.8         7-18-97       Freepoint and severed 4-1/2" casing :a, 6403'. POOH with 6403' of 4-1/2" casing.         7-21-97       RIH with tubing and spotted 35 sk. 14 8 ppg cement plug from 6453' to 6324'. Tag top of from 5100' to 5200'.         7-22-97       Spotted additional 14.8 ppg Cl. C cement plugs as follows:         35 sk       3100' - 3000'         180 sk       1445' - 1201'         34 sk       545' - 445'         15 sk       3' - 63'         Installed dry hole marker.       7-23-97         7-23-97       Cleared location. P&A complete.         Thereby certify that the information above is true and complete to the best of my knowledge and belief.         SIGNATURE       Tertry L. Reeves -         TYPE OR PRINT NAME       Tertry L. Reeves -	estimated date of starting any proposed ppg cement plug from 8000' to 7661'. POOH. same @ 6324'. Pulled up hole and spotted 35 sk. 14.8 ppg cement plug. $P_{out} JD - 2$ $I_{out} JD - 2$
OTHER       OTHER         12. Describe Proposed or Completed Operations (Clearly state all pertinent details and give pertinent dates, including work) SEE RULE 1103.       7-16-97         7-16-97       Release packer. POOH with tubing. Set CIBP @ 8000'.         7-17-97       RIH with tubing and loaded hole with 9.5 ppg mul laden brine. Spotted 25sk, CL C 14.8         7-18-97       Freepoint and severed 4-1/2" casing :a, 6403'. POOH with 6403' of 4-1/2" casing.         7-21-97       RIH with tubing and spotted 35 sk. 14 8 ppg cement plug from 6453' to 6324'. Tag top of from 5100' to 5200'.         7-22-97       Spotted additional 14.8 ppg Cl. C cement plugs as follows:         35 sk       3100' - 3000'         180 sk       1445' - 1201'         34 sk       545' - 445'         15 sk       3' - 63'         Installed dry hole marker.       7-23-97         7-23-97       Cleared location. P&A complete.         Thereby certify that the information above is true and complete to the best of my knowledge and belief.         SIGNATURE       Tertry L. Reeves -         TYPE OR PRINT NAME       Tertry L. Reeves -	estimated date of starting any proposed ppg cement plug from 8000' to 7661'. POOH. same @ 6324'. Pulled up hole and spotted 35 sk. 14.8 ppg cement plug. $P_{ab}T TD-2$ $I_{ab}TTD-2$
OTHER       OTHER         12. Describe Proposed or Completed Operations (Clearly state all pertinent details and give pertinent dates, including work) SEE RULE 1103.       7-16-97         7-16-97       Release packer. POOH with tubing. Set CIBP @ 8000'.         7-17-97       RIH with tubing and loaded hole with 9.5 ppg mud laden brine. Spotted 25sk. Cl. C 14.8         7-18-97       Freepoint and severed 4-1/2" casing :a, 6403'. POOH with 6403' of 4-1/2" casing.         7-21-97       RIH with tubing and spotted 3's sk. 1'8 ppg cement plug from 6453' to 6324'. Tag top of from 5100' to 5200'.         7-22-97       Spotted additional 14.8 ppg Cl. C cement plugs as follows:         35 sk       3100' - 3000'         180 sk       1445' - 1201'         34 sk       545' - 445'         15 sk       3' - 63'         Installed dry hole marker.         7-23-97       Cleared location. P&A complete.         Thereby certify that the information above is true and complete to the best of my knowledge and belief.         SIGNATURE       TIFLE         TYPE OR PRINT NAME       Terry L. Reeves	estimated date of starting any proposed ppg cement plug from 8000' to 7661'. POOH. same @ 6324'. Pulled up hole and spotted 35 sk. 14.8 ppg cement plug. $P_{out} JD - 2$ $I_{out} JD - 2$
OTHER       OTHER         OTHER       OTHER         12. Describe Proposed or Completed Operations (Clearly state all pertinent details and give pertinent dates, including work) SEE RULE 1103.       7-16-97         7-16-97       Release packer. POOH with tubing. Set CIBP @ 8000'.       7-17-97         7-17-97       RIH with tubing and loaded hole with 9.5 ppg mud laden brine. Spotted 25sk. CL C 14.8         7-18-97       Freepoint and severed 4-1/2" casing. a, 6403'. POOH with 6403' of 4-1/2" casing.         7-21-97       RIH with tubing and spotted 35 sk. 14 8 ppg cement plug from 6453' to 6324'. Tag top of from 5100' to 5200'.         7-22-97       Spotted additional 14.8 ppg CL C cement plugs as follows:         35 sk       3100' - 3000'         180 sk       1445' - 1201'         34 sk       545' - 445'         15 sk       3' - 63         Installed dry hole marker.       7-23-97         7-23-97       Cleared location. P&A complete.         Threeby certify that the information above is true and complete to the best of my knowledge and belief.         SIGNATURE       TITLE         TYPE OR PRINT NAME       Terry L. Reeves         This space for State Use       APPROMED BY	estimated date of starting any proposed ppg cement plug from 8000' to 7661'. POOH. same @ 6324'. Pulled up hole and spotted 35 sk. 14.8 ppg cement plug. $P_{ab} = 177 - 97$ $P_{ab} = 177 - 977 - 977$ $P_{ab} = 177 - 977 - $
OTHER       OTHER         12. Describe Proposed or Completed Operations (Clearly state all pertinent details and give pertinent dates, including work) SEE RULE 1103.       7-16-97         7-16-97       Release packer. POOH with tubing. Set CIBP @ 8000'.         7-17-97       RIH with tubing and loaded hole with 9.5 ppg mul laden brine. Spotted 25sk. Cl. C 14.8         7-18-97       Freepoint and severed 4-1/2" casing .a. 6403'. POOH with 6403' of 4-1/2" casing.         7-21-97       RIH with tubing and spotted 35 sk. 14 8 ppg cement plug from 6453' to 6324'. Tag top of from 5100' to 5200'.         7-22-97       Spotted additional 14.8 ppg Cl. C cement plugs as follows:         35 sk       3100' - 3000'         180 sk       1445' - 1201'         34 sk       545' - 445'         15 sk       3' - 63'         Installed dry hole marker.       7-23-97         7-23-97       Cleared location. P&A complete.         Thereby certify that the information above is true and complete to the best of my knowledge and belief.         SIGNATURE       Tertry L. Reeves ·         TYPE OR PRINT NAME       Tertry L. Reeves ·	estimated date of starting any proposed ppg cement plug from 8000' to 7661'. POOH. same @ 6324'. Pulled up hole and spotted 35 sk. 14.8 ppg cement plug. $P_{ab} = 177 - 97$ $P_{ab} = 177 - 977 - 977$ $P_{ab} = 177 - 977 - $