 
Submit 3 Copies To Appropriate District Office	State of New M		2 C13, (1)	Form C-103
District I	Energy, Minerals and Na	atural Resources	96	Revised March 25, 1999
1625 N. French Dr., Hobbs, NM 87240 District II			WELL API NO.	
811 South First, Artesia, NM 87210	OIL CONSERVATION	NAME OF THE PARTY	5 Indiant T	015- 30720
District III 1000 Rio Brazos Rd., Aztec, NM 87410	2040 South A	checo 63	5. Indicate Type of	_
District IV	Santa Fe, NM	87505 🖈 🚱	STATE 56. State Oil & Ga	
2040 South Pacheco, Santa Fe, NM 87505		27505 A 37505	O. State Off & G	
I IJU NOI USE THIS FORM FOR READORAL C	AND REPORTS ON WEL	C/V~"	11. Lease Name or	Unit Agreement Name:
DITTERENT RESERVOIR. USE "APPLICATI	ON FOR PERMIT" (FORM (\$\frac{1}{2}101)	PLUGA CEJO A N	7	<u> </u>
PROPOSALS.) 1. Type of Well:	\ .	9/2/ 7.51	OXY Bis Re	d State
Oil Well Gas Well	Other	OE 62821292 21 2/18		
2. Name of Operator	Other	62821280	8. Well No.	
OXY USA In	c.	16696	8. Well No.	
3. Address of Operator			9. Pool name or W	/ildcat
P.O. BOX 50	250 MIDLAND, TX 797	10-0250		Draw Marrow
4. Well Education				V-22 T Crrow
SL Unit Letter L : 178	feet from the	Hh line and	20 fan 6	
BHL L ZOO			feet from	the West line
Section 16	Township 175	Range R27E	NMPM FDI	OY County
10	. Elevation (Show whether	DR, RKB, RT, GR, etc.)	County
11 Check Appr	Opriate Poy to Indicate 3	Mataura - CNI-4' D		
NOTICE OF INTER	opriate Box to Indicate 1	Nature of Notice, R	eport or Other D	ata
	UG AND ABANDON 🔲	REMEDIAL WORK	SEQUENT REP	
TEMPORARIUM	IANGE PLANS			ALTERING CASING
— •	MINOC PENING	COMMENCE DRIL		PLUG AND ABANDONMENT
	ILTIPLE	CASING TEST AN		ADAINDONMEN!
	MPLETION	CEMENT JOB	_	
OTHER:		OTHER:		
 Describe proposed or completed or of starting any proposed work). SE or recompilation. 	erations. (Clearly state all p E RULE 1103. For Multiple	ertinent details, and gi Completions: Attach	ve pertinent dates, in wellbore diagram of	cluding estimated date proposed completion
NOTIFY NMOCD OF INTENT TO	Den Mini nu 4/6/	00		
NOTIFY NMOCD OF INTENT TO CIRC W/ 10# BW, REL PKR &	POOH W/ PKR & TRC	PIH & SET CIP	D 0 00661 0T	20 /
TOW MILE, SPOT ZUSX CL H (MT TO 8796', POOH.	RD BOP & WH D	TH & STORTON /	RC W/
COT 3 1/2 C3G G /300°, F	ATTEMPT TO WORK CSG	FREE, W/O SUCCE	SS MONTELED	
MMOCD, APPR CHANGES, SPOT	' 35sx CL C CMT. DIS	PL TO 70351 PO	OH W/ 205+c TI	BG,
WOC-SION. RIH & TAG CMT	@ 69/1', REC NMOCD	APPR TO SKIP PL	UG @ 6010', Po	OOH
	OO. BOOH BIRES	DONE ALASS OF C. C.	MTD 57/ 00 0 03	
RIH & CUT 5-1/2" CSG @ 52 5250-5051', WOC-1.5hrs.	RIH & TAG CMT @ 513	O'. RTH & SPA	MT W/ 2% $CaCl_2$	FROM
4905-4731', POOH W/ 33jts	TBG. SPOT 45sx CL	0'. RIH & SPO C CMT FROM 386	MT W/ 2% $CaCl_2$ T 45sx CMT FRO	FROM DM W/
4905-4731', POOH W/ 33jts 72jts TBG. SPOT 45sx CL	TBG. SPOT 45sx CL	0'. RIH & SPO C CMT FROM 386	MT W/ 2% CaCl ₂ T 45sx CMT FRO 0-3686', POOH	FROM DM W/ RIH &
4905-4731', POOH W/ 33jts 72jts TBG. SPOT 45sx CL TAG NO CMT, SPOT 45sx CL	TBG. SPOT 45sx CL C CMT W/ 2% CaCl ₂ FR C CMT FROM 1574-140	0'. RIH & SPO C CMT FROM 386 OM 1574-1400',	MT W/ 2% CaCl ₂ T 45sx CMT FRO 0-3686', POOH WOC-1.5hrs.	FROM DM W/ RIH &
4905-4731', POOH W/ 33jts 72jts TBG. SPOT 45sx CL TAG NO CMT, SPOT 45sx CL 1415', SPOT 35sx CL C CMT PLUG. RDPU 4/19/00, DUG	TBG. SPOT 45sx CL C CMT W/ 2% CaCl ₂ FR C CMT FROM 1574-140 FROM 412-377', POO OUT CELLAR, CUT OFF	0'. RIH & SPO C CMT FROM 386 OM 1574-1400', O', WOC-SION. H. SPOT 20sy C	MT W/ 2% CaCl ₂ T 45sx CMT FRO 0-3686', POOH WOC-1.5hrs. 1 RIH & TAG CMT	FROM DM W/ RIH &
4905-4731', POOH W/ 33jts 72jts TBG. SPOT 45sx CL TAG NO CMT, SPOT 45sx CL	TBG. SPOT 45sx CL C CMT W/ 2% CaCl ₂ FR C CMT FROM 1574-140 FROM 412-377', POO OUT CELLAR, CUT OFF	0'. RIH & SPO C CMT FROM 386 OM 1574-1400', O', WOC-SION. H. SPOT 20sy C	MT W/ 2% CaCl ₂ T 45sx CMT FRO 0-3686', POOH WOC-1.5hrs. 1 RIH & TAG CMT	FROM DM W/ RIH &
4905-4731', POOH W/ 33jts 72jts TBG. SPOT 45sx CL TAG NO CMT, SPOT 45sx CL 1415', SPOT 35sx CL C CMT PLUG. RDPU 4/19/00, DUG MARKER, CLEAN LOCATION, W	THE TAG CMT @ 513 TBG. SPOT 45sx CL C CMT W/ 2% CaCl ₂ FR C CMT FROM 1574-140 FROM 412-377', POO OUT CELLAR, CUT OFF ELL P&A'D.	0'. RIH & SPO C CMT FROM 386 OM 1574-1400', O', WOC-SION. H. SPOT 20sx C WH & ANCHORS,	MT W/ 2% CaCl ₂ T 45sx CMT FRO 0-3686', POOH WOC-1.5hrs. 1 RIH & TAG CMT L C CMT SURFAO INSTALL DRY HO	FROM DM W/ RIH &
4905-4731', POOH W/ 33jts 72jts TBG. SPOT 45sx CL TAG NO CMT, SPOT 45sx CL 1415', SPOT 35sx CL C CMT PLUG. RDPU 4/19/00, DUG	THE TAG CMT @ 513 TBG. SPOT 45sx CL C CMT W/ 2% CaCl ₂ FR C CMT FROM 1574-140 FROM 412-377', POO OUT CELLAR, CUT OFF ELL P&A'D.	0'. RIH & SPO C CMT FROM 386 OM 1574-1400', O', WOC-SION. H. SPOT 20sx C WH & ANCHORS,	MT W/ 2% CaCl ₂ T 45sx CMT FRO 0-3686', POOH WOC-1.5hrs. 1 RIH & TAG CMT L C CMT SURFAO INSTALL DRY HO	FROM DM W/ RIH &
4905-4731', POOH W/ 33jts 72jts TBG. SPOT 45sx CL TAG NO CMT, SPOT 45sx CL 1415', SPOT 35sx CL C CMT PLUG. RDPU 4/19/00, DUG MARKER, CLEAN LOCATION, W	THE TAG CMT @ 513 TBG. SPOT 45sx CL C CMT W/ 2% CaCl ₂ FR C CMT FROM 1574-140 FROM 412-377', POO OUT CELLAR, CUT OFF ELL P&A'D.	0'. RIH & SPO C CMT FROM 386 OM 1574-1400', O', WOC-SION. H. SPOT 20sx C WH & ANCHORS,	MT W/ 2% CaCl ₂ T 45sx CMT FRC 0-3686', POOH WOC-1.5hrs. IRIH & TAG CMT L C CMT SURFAC INSTALL DRY HO and belief.	FROM DM W/ RIH &
4905-4731', POOH W/ 33jts 72jts TBG. SPOT 45sx CL TAG NO CMT, SPOT 45sx CL 1415', SPOT 35sx CL C CMT PLUG. RDPU 4/19/00, DUG MARKER, CLEAN LOCATION, W I hereby certify that the information above	THE TAG CMT @ 513 TBG. SPOT 45sx CL C CMT W/ 28 CaCl ₂ FR C CMT FROM 1574-140 FROM 412-377', POOI OUT CELLAR, CUT OFF ELL P&A'D. TITLE	O'. RIH & SPO C CMT FROM 386 OM 1574-1400', O', WOC-SION. H. SPOT 20sx C WH & ANCHORS, best of my knowledge	MT W/ 2% CaCl ₂ T 45sx CMT FRC 0-3686', POOH WOC-1.5hrs. I RIH & TAG CMT L C CMT SURFAC INSTALL DRY HO and belief.	PROM W/ RIH & CE DLE Post DATE 5 (15 (20)
4905-4731', POOH W/ 33jts 72jts TBG. SPOT 45sx CL TAG NO CMT, SPOT 45sx CL 1415', SPOT 35sx CL C CMT PLUG. RDPU 4/19/00, DUG MARKER, CLEAN LOCATION, W I hereby certify that the information above	THE TAG CMT @ 513 TBG. SPOT 45sx CL C CMT W/ 2% CaCl ₂ FR C CMT FROM 1574-140 FROM 412-377', POOI OUT CELLAR, CUT OFF ELL P&A'D. Te is true and complete to the	O'. RIH & SPO C CMT FROM 386 OM 1574-1400', O', WOC-SION. H. SPOT 20sx C WH & ANCHORS, best of my knowledge	MT W/ 2% CaCl ₂ T 45sx CMT FRC 0-3686', POOH WOC-1.5hrs. IRIH & TAG CMT L C CMT SURFAC INSTALL DRY HO and belief.	DATE 5 (15 (20)
4905-4731', POOH W/ 33jts 72jts TBG. SPOT 45sx CL TAG NO CMT, SPOT 45sx CL 1415', SPOT 35sx CL C CMT PLUG. RDPU 4/19/00, DUG MARKER, CLEAN LOCATION, W I hereby certify that the information above SIGNATURE Type or print name DAVID S	THE TAG CMT @ 513 TBG. SPOT 45sx CL C CMT W/ 28 CaCl ₂ FR C CMT FROM 1574-140 FROM 412-377', POOI OUT CELLAR, CUT OFF ELL P&A'D. TITLE	O'. RIH & SPO C CMT FROM 386 OM 1574-1400', O', WOC-SION. H. SPOT 20sx C WH & ANCHORS, best of my knowledge	MT W/ 2% CaCl ₂ T 45sx CMT FRC 0-3686', POOH WOC-1.5hrs. I RIH & TAG CMT L C CMT SURFAC INSTALL DRY HO and belief.	PROM W/ RIH & CE DLE Post DATE 5 (15 (20)



OIL CONSERVATION DIVISION DISTRICT II ARTESIA 811 S. FIRST ST. ARTESIA, NM 88210 (505) 748-1283 FAX (505) 748-9720

Jennifer A. Salisbury cabinet secretary	June 1, 2000			
Oxy USA, Inc				
P.O. Box 50250				
Midland, TX 79710-0250				
Re: Plugging Reports			Ut S-T-R	
Form C-103 Report of Plugging for your Oxy Big Red State #1 L-16-17-27 cannot be approved until an NMOCD representative has made an inspection of the location and found it to be cleared to comply with OCD rules and regulations. Please check each item in the space provided to indicate that the work has been done and location is ready for final inspection.				
() 1. All pits have been fille	d and leveled.			
() 2. Rat hole and cellar have	been filled and leve	eled.		
() 3. A steel marker 4" in dia level has been set in co well. (Marker must hav location including quart township, range and API or otherwise engraved in	ncrete to mark the exe e operator name, leas er/quarter section or well ID number perman	wact location se name, well unit letter mently welded	of plugged number and , section,	
() 4. The location has been leground contour and has been legroun	veled as nearly as po een cleared of all ju	essible to or: onk and equip	iginal top ment.	
() 5. The dead men and tie down				
() 6. If a one well lease or 1 burn pit locations have	ast remaining well on been leveled and clea	n lease, the bared of all ju	oattery and unk & equipment	
The above are minimum requirements all locations for plugged and abandapproved.	and no plugging bond doned wells have been	lwill be cand inspected ar	celled until nd Form C-103	
When all of the work outlined above completing, signing and returning will not have to make more than one	this letter to us so e trip to the location	on.	resentative	
I certify that the above work has	peen done and the abo	ove mentioned	lease is ready	
for OCD inspection and approval.				
Name		Mike Stubble Field Rep II	efield	
Title	=	11010 100 11	-	