

Submit 3 Copies to Appropriate
District Office
DISTRICT I
1625 n. French Dr., Hobbs, NM 88240
DISTRICT II
811 South First, Artesia, NM 88210
DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410
DISTRICT IV
2040 S. Pacheco, Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION

2040 South Pacheco
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

WELL API NO.

30-015-31716

5. Indicate Type of Lease
STATE ☒ FEE ☐
6. State Oil & Gas Lease No.
647-324, E-135
B-2071, B-11593, B-8814
7. Lease Name or Unit Agreement Name:
Geronimo "27" State Com

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS)

1. Type of Well:
Oil Well ☐ Gas Well ☒ Other ☐
2. Name of Operator
Louis Dreyfus Natural Gas Corp. /
3. Address of Operator
14000 Quail Springs Parkway - Suite 600 - Oklahoma City, OK 73134
4. Well Location
Unit letter A :990' feet from the South line and 660' feet from the West line.
Section 27 Township 17S Range 28E NMPM Eddy County

10. Elevation (Show whether DR, RKB, RT, Gr, etc.)
3681'

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

- PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

- REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. Set CIBP in 5 1/2" @ 7800, 6850, 3370. Dump bail 4 x cmt on top of each plug.

2. TIH w/wireline & tag TOC.

3. Shoot off casing @ 2,155', pull casing.

4. TIH w/tubing, spot surface cement plugs as required by New Mexico OCD.

5. Remove BOP & casinghead

6. Weld on plate & install dry hole marker.

7. Clean and dress location as required.

Salt gel mud consisting of 10#
Brine W/25# of gel per bbl
must be placed between each plug

* 100' plug 2650'-2750' - TAG

* Stub Plug - 50' in? out
2105-2205 - TAG

* 100' plug 390'-490' - TAG

* Surface plug 0'-60'

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Carla Christian TITLE Regulatory Specialist DATE 05/28/02

Type or print name Carla Christian Telephone No. 405-749-5263

(This space for State use)

APPROVED BY [Signature] TITLE Wild Dog ID DATE MAY 31 2002

Conditions of approval, if any:

Notify OCD 24 hrs. prior to any work done



0250 0250 0250 0250 0250
0250 0250 0250 0250 0250
0250 0250 0250 0250 0250
0250 0250 0250 0250 0250

0250 0250 0250