					1,	
Submit 3 Copies to Appropriate District Office	State of Nev Ey, Minerals and Natur			US	Form C-100 Revised 1-1-89	
DISTRICT I P.O. Box 1930, Hobbs, NM 88240	OIL CONSERVAT			WELL API NO.	15, 22001	
DISTRICT II P.O. Drawer DD, Arlesia, NIA 88210	Santa Fe, New Mex			5. Indicate Type o	15-32091 (Lease STATE X FEE	—i] [
DISTRICT III 1000 Rio Brillot Rd., Allec, NM 87410	·			6. State Oil & Ga	Lesse Na	-
SUNDRY NOTICES AND REPORTS ON WELLS				111111111111111111111111111111111111111		<i>7</i>
(DO NOT USE THIS FORM FOR PROPERTY RESERVED (FORM C-1	7. Lease Name or	Unit Agreement Name				
I. Type of Well:					,	1
MEIT METT X	OTTEER		•	BIG CAT	STATE COM	
2. Name of Operator MURCHISON OIL & GAS, INC.			8. Well No. 1			
3. Address of Operator 1100 MIRA VISTA BLVD.			9. Pool name or Wildcat			
PLANO, TX. 75093-4698			UNDES EMPI	RE; MORROW, SOUTH		
4. Well Location Unit Letter G : 1500) m NORTH		198	30	- T. EAST	ine
Unit Letter : :	Feet From the		Line and	Ped Proc	in the L	100
Section 11	Township 17S		28E	NMPM	EDDY County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.)						
11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data						
• • •			SU	BSEQUENT F	REPORT OF:	
PERFORM REMEDIAL WORK	PLUG AND ABANDON		REMEDIAL WORK		ALTERING CASING	
TEMPORARILY ABANDON	CHANGE PLANS		COMMENCE DRILLIN	IG OPNS.	PLUG AND ABANDONMENT	$\cdot \square$
PULL OR ALTER CASING			CASING TEST AND C	EMENT XOR X		
TNE		TMEED	MEDIATE CASI	NC		
OTHER:			OTHER: INTER	MEDIATE CAST	.110	
12. Describe Proposed or Completed Opera work) SEE RULE 1103.	iloas (Clearly state all pertinent de	sails, an	d give pertinent dates, inc	luding estimated date	of starting any proposed	
Drilled 12 ¼" hole to 2	200'. POOH with drill st	tring a	and run 9 5/8" casir	ng as follows:	A	
		J		U	4	
l Float s			1'		Er.	
1 JT 9 5/8" 1 Float o	47 #/FT N-80 LTC		34' 1'		orfiffica	
	47 #/FT N-80 LTC		2164'		$C \in \mathcal{L}_{\mathcal{A}}}}}}}}}}$	
37 316 7 370			2200'			
Celloflake followed by	2200'. Cement w/ 900 200 SXS Class "C" + 2	2% CA	ACL. Bump plug.	Circulate while	pumping.	

Circulate 115 SXS to reserve pit. WOC. Nipple down and set slips. Lay down 13 5/8 3000 PSI BOP and Nipple up 5000 BOP. Test BOP and valves to 5000 PSI. Test casing to 1000 PSI. WOC total 22 Hrs. Trip in hole and resume drilling 8 1/2" bit.

(This space for State Uje)	ner 1:1 2
	(972)
SIONATURE Michael / /aughtitu	VICE PRESIDENT OPERATIONS DATE 11/29/01
I hereby certify that the information above is true and complete to the best of my	coperiodge and belief,

ORIGINAL SIGNED BY TIM W. GUM