

OIL CONSERVATION DIVISION

RECEIVED

Form C-103  
Revised 10-1-73

P. O. BOX 2088  
SANTA FE, NEW MEXICO 87501

SEP 29 1981

O. C. D.  
ARTESIA, OFFICE

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

3a. Indicate Type of Lease State <input checked="" type="checkbox"/> Free <input type="checkbox"/>
5. State Oil & Gas Lease No. E 6353
7. Unit Agreement Name CAVE POOL UNIT
8. Farm or Lease Name
9. Well No. 49
10. Field and Pool, or Wildcat CAVE-GREG
12. County Eddy

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT - " (FORM C-101) FOR SUCH PROPOSALS.)

OIL WELL <input type="checkbox"/>	GAS WELL <input type="checkbox"/>	OTHER - Injection
Name of Operator J E M Resources, Inc. ✓		
Address of Operator Box 648, Artesia, N. Mex. 88210		
Location of well UNIT LETTER L, 2310 FEET FROM THE S LINE AND 990 FEET FROM THE W LINE, SECTION 8, TOWNSHIP 17, RANGE 29, N.M.P.M.		

15. Elevation (Show whether DF, RT, GR, etc.)  
3638 Gr

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

INFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input checked="" type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
NULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	

7. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Well had previously been Plugged but had small gas leak.  
Surface Casing Shoe Plug was found to be low and of poor quality.  
Drilled out plug and found Salt Base plug to be in correct place and of good quality.  
Set 20 sx on top of Salt Base Plug and 35 sx at Shoe of Surface.  
(352) Set bottom of plug at 400' and shut down 24 Hrs. Tagged Plug with tubing at 290'. Left open 48 Hrs. No Leaks appeared. Set 10 sx and Marker at top.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Pres. DATE 9-29-81

APPROVED BY [Signature] TITLE OIL AND GAS INSPECTOR DATE DEC 18 1981

CONDITIONS OF APPROVAL, IF ANY:

SIGNED [Signature] TITLE  DATE

APPROVED BY [Signature] TITLE OIL AND GAS INSPECTOR DATE DEC 18 1981

CONDITIONS OF APPROVAL, IF ANY: