Form 3160-5 (July 1989)

UNITED STATES DEPARTMENT OF THE INTERIOR

CONTACT RECEIVING OFFICE FOR NUMBER OF COPIES REQUIRED (Other instructions on reverse **BLM Roswell District** Modified Form No. NM060-3160-4

ARANDONMENT*

5. LEASE DESIGNATION AND SERIAL NO. (Formerly 9-331) BUREAU OF LAND MANAGEMENT LC-028775-A IF INDIAN, ALLOTTEE OR TRIBE NAME SUNDRY NOTICES AND REPORTS ON WELLS (Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT-" for such proposals.) RECEIVED 7. UNIT AGREEMENT NAME WELL X WELL MAR - 2 1992 NAME OF OPERATOR FARM OR LEASE NAME SOUTHLAND ROYALTY COMPANY ~ O. C. D. **RJU TR1** 3a FENNESIO. ADDRESS OF OPERATOR WELL NO. P.O. Box 51810, Midland, TX 79710-1810 (915)688-6943 LOCATION OF WELL (Report location clearly and in accordance with any State requirements.4 10. FIELD AND POOL, OR WILDCAT See also space 17 below.) GRAYBURG JACKSON 7R-QN-G-≤A At surface P, 25' FSL & 1295' FEL 11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA SEC 27, T17S, R29E 14. PERMIT NO. 15. ELEVATIONS (Show whether DF, RT, GR, etc.) 12. COUNTY OR PARISH 13. STATE 3560' GR **EDDY** NM 16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF TEST WATER SHUT-OFF PULL OR ALTER CASING WATER SHUT-OFF REPAIRING WELL FRACTURE TREAT MULTIPLE COMPLETE FRACTURE TREATMENT ALTERING CASING

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) 17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)4

SHOOTING OR ACIDIZING

(Other) RETURN SI WELL TO PRODUCTION

1/15/92 PROJ: TO INSTALL RODS, TBG & PUMPING UNIT & RETURN TO PRODUCTION. TIH W/ BIT & SCR.

1/16/92 REPAIR WH & CSG.

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

SPOT 250 GALS 15% NEFE HCL @ 3057'. SWAB. RIH W/ STRESS FRAC TOOL. POSITION @ 3002-10' & 1/17/92 IGNITE. 6700# RECORDED. POSITION @ 2948-58' IGNITE. 7500 # RECORDED.

1/18/92 SWAB. SQZ OPEN HOLE 2880-3057' W/ 110 GALS TRETOLITE SP-358 MIXED IN 8 BBLS 2% KCL. TIH W/ PROD TBG. TIH W/ PLGR, SUB & RODS. 2 3/8" 4.7# J55 TBG @ 2827.96'.

1/19/92 - 1/20/92 SPACE OUT & HANG ON. TURN TO PRODUCTION.

ABANDON*

CHANGE PLANS

| 18. I hereby certify that the foregoing | \circ | TITLE | PRODUCTION ASST. | DATE | 02/25/92 |
|--|------------|-------|------------------|------|-------------|
| (This space for Federal or State | office use | | | | |
| APPROVED BY CONDITIONS OF APPROVAL, IF ANY | ·: | TITLE | | DATE | |