Form 3160-5 (June 1990)	UNITED STATES DEPARTMENT OF THE INTERIOR			FORM APPROVED Budget Bureau No. 1004-0135			
		F LAND MANAGE		<b>A A</b>	Expires	March 31, 1993	
	DUKLAU U				-	tion and Serial No.	
_	SUNDRY NOTICE					MM 014840	
Do not use this fo	orm for proposals to	drill or to deepen o	or reentry to a diffe	erent reservoir.	U. 11 1110001, 5110		
L	Jse "APPLICATION F	UR PERMII - " Tor	such proposals		1	N/A	
	SUBM	IT IN TRIPLICAT	E		7. If Uait or CA, Agreement Designation		
1. Type of Well					1	I/A	
Veli Gas	Other	1			8. Well Name and		
2. Name of Operator	/			100	Green A H	ederal #4	
<u>Southwest</u> Roy <b>3. Address and Telephone N</b>	yalties, Inc.		i		9. API Well No.		
-		70702 (0)	5) CO( COO.	See. 8		5-03182	
<u>c/o Box 953, Midland, Texas 79702 (915) 684-6381</u> 4. Location of Well (Footage, Sec., T., R., M., or Survey Description)						er Exploratory Area	
					Grayburg-J 11. County or Paris	lackson SR-	<u>v-(</u>
KOTO LOF Ø 3	DOUREL	Sec. 29, T-1	/S - R-29E		• • • •		
					Eddy Cour	ity, New Me	<u>xi</u> (
	APPROPRIATE BOX	(s) TO INDICATE	NATURE OF NO	DTICE, REPORT	, OR OTHE	R DATA	
TYPE OF S	UBMISSION		<u>т</u>	PE OF ACTION			
X Notice of	latent		Veadopment		Change of Pla		
			lecompletion		New Construe		
L. Subsequen	n Report	<u> </u>	lugging Back		Non-Routise	Fracturing	
	ndonment Notice		lasing Repair		Water Shut-O	6	
	ngoniment Notice		Mering Casing Meer_Mechanica		Conversion to	•	
				est	Dispose Wate	T F makipk completion on V	Vell
give subsurface locatio							
	Proposed p	rocedure for t	esting downho	ole/equipment	casing.		
		rocedure for t and wellbore d			casing.		
	Procedure a	and wellbore o	liagram attach	ned.			
	Procedure a		liagram attach	ned.			
	Procedure a	and wellbore o	liagram attach	ned.			
	Procedure a	and wellbore o	liagram attach	ned.	ng.	Ju	
	Procedure a	and wellbore o	liagram attach	ned.		Jun	
	Procedure a	and wellbore o	liagram attach	ned.	ng.		
	Procedure a	and wellbore o	liagram attach	ned.	ng. Anera		
	Procedure a	and wellbore o	liagram attach	ned.	ng. Anera		
	Procedure a	and wellbore o	liagram attach	ned.	ng. Anera		
~	Procedure a	and wellbore o	liagram attach	ned.	ng. Anera		
	Procedure a	and wellbore o	liagram attach	ned.	ng. Anera	necew 7 Here	
I hereby ceruly sharing have	Procedure a Will notify	and wellbore o	liagram attach	ned.	ng. Anera		
	Procedure a Will notify	and wellbore c	liagram attach	ned. Defore testin	ng. Ane.		
I hereby certury sharebe have	Procedure a Will notify	and wellbore of 505-887-6544	liagram attach - 48 hours h Regulatory Ag	ned. Defore testin	ng.	T II SIS IN 192	
I hereby certury shartpe pare Signed	Procedure a Will notify	and wellbore of 505-887-6544	liagram attach - 48 hours h	ned. Defore testin	ng.	T II SIS IN 192	
I hereby certury sharting have Signed	Procedure a Will notify wing a type and correct cutoffice use)	and wellbore of 505-887-6544	liagram attach - 48 hours h Regulatory Ag	ned. Defore testin	ng.	T II SIS IN 192	
I hereby certify sharting parts Signed	Procedure a Will notify wing a type and correct cutoffice use)	and wellbore of 505-887-6544	liagram attach - 48 hours h Regulatory Ag	ent	ng. → C → C → C → C → C → C → C → C	11 51 AN 192 -3-93	

.

## Green A Fed #4 2310' FSL & 330' FEL, Sec. 29-T17S-R29E Eddy County, New Mexico

Procedure to Test Well for Casing Integrity

- 1. Contact BLM in Carlsbad at 505-887-6544 48 hours before beginning procedure.
- 2. Build road and work location as necessary. Install anchors if required.
- 3. MI RU WU. Pull and lay down rods and pump if in well. NU BOP. Pull tubing and lay down.
- 4. RIH with 6-1/8" bit and casing scraper on 2-3/8" WS to below top perf @ 2358'. POH.
- 5. RIH with CIBP on WS and set at 2325'.
- 6. Circulate hole with inhibited fluid.
- 7. Close rams and pressure test casing to 500 psi for 30 minutes utilizing a chart. Maximum pressure bleed off is 10%. Send chart to Midland office.
- 8. POH laying down WS. Remove BOP and install wellhead with one joint of tubing and tubing valve. Leave well SI in temporarily abandoned status.

low 1

March all a ran a

Doug/Keathley Northern Regional Engineer



. **•** 

## MINIMUM REQUIREMENTS FOR CASING INTEGRITY TESTING OF WELLS ON FEDERAL LEASES IN THE CARLSBAD RESOURCE AREA

- 1. Contact the appropriate BLM office at least 24 hours prior to the scheduled test.
- NOTE: A BLM tecnician must be present to witness all casing integrity tests.
- 2. A retrievable bridge plug or packer shall be set a maximum of fifty (50) feet above any open perforations.
- 3. All downhole production equipment (tubing, rods, etc.) must be removed from the casing if they are not isolated by a packer.
- 4. The casing must be filled with fluid and pressure tested to 500 PSI. Further, the casing must be capable of holding this pressure for at least 30 minutes with a 10% allowable leak-off (ie., down to 450 PSI).
- 5. Wells that successfully pass the casing integrity test will be approved for Temporary Abandonment status for a period of 12 months provided that the operator submits a subsequent Sundry Notice requesting TA approval, and attaches a copy of The pressure test chart for the tested well.