


Operator Webb Oil Company  
 Well Parke #1  
 Unit A Section 3 Township 17 Range 30  
 API # 30-015-04060

TOPS

|            |   |       |
|------------|---|-------|
| Rusler     | ~ | 300'  |
| Salado     | ~ | 525'  |
| Base Salt  | ~ | 1245' |
| Gates      | ~ | 1400' |
| Primers    | ~ | 1700' |
| Bowers     | ~ | 2050' |
| Quaker     | ~ | 2300' |
| Grauberg   | ~ | 2720' |
| San Andres | ~ | 3020' |

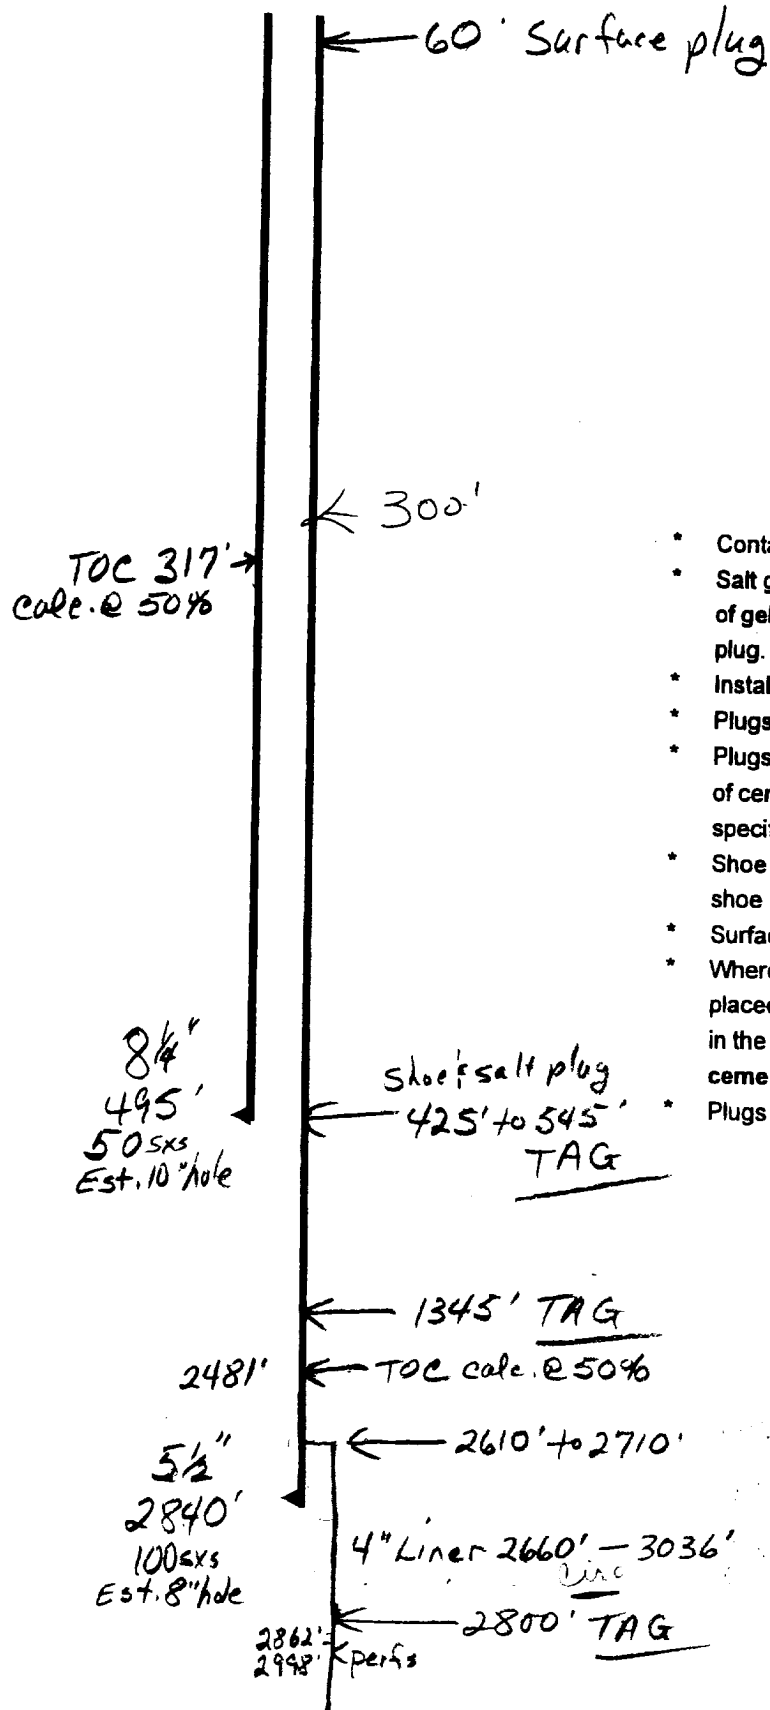

- \* Contact OCD 24 hrs. prior to any work done.
- \* Salt gel mud consisting of 10# brine with 25# of gel per barrel must be placed between each plug.
- \* Install dry hole marker as per Rule 202.B.2
- \* Plugs are to be set from point indicated up.
- \* Plugs must not be less than 100' or 25 Sacks of cement, whichever is greater, unless specifically indicated.
- \* Shoe and stub plugs will be 50' above and below shoe or stub and tagged.
- \* Surface plug will be from 0' - 60'
- \* Where plugs are required, cement must be placed inside and outside of all casing string(s) in the correct footage or sacks required, if no cement exists.
- \* Plugs to be tagged will be indicated.

WCB