

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Encl. Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs NM 88240

DISTRICT II
811 South First, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd, Aztec, NM 87410

OIL CONSERVATION DIVISION
2040 South Pacheco
Santa Fe, New Mexico 87505

WELL API NO.
30-015-04177

5. Indicate Type of Lease
STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

Randel State

8. Well No.
1

9. Pool name or Wildcat
Grbg Jackson SR Q Grbg SA

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
3681'

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS).

1. Type Of Well:
OIL WELL ☒ GAS WELL ☐ OTHER

2. Name of Operator
Mack Energy Corporation

3. Address of Operator
P.O. Box 960, Artesia, NM 88211-0960

4. Well Location
Unit Letter C : 990 Feet From The North Line and 2310 Feet From The West Line
Section 16 Township 17S Range 30E NMPM Eddy County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
3681'

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐ REMEDIAL WORK ☐ ALTERING CASING ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐ COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒

PULL OR ALTER CASING ☐ CASING TEST AND CEMENT JOB ☐

OTHER: ☐ OTHER ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

02/08/2002 RIH tag @ 1201'. Perforate casing @ 1140'. Spot 50 sx plug. WOC tag plug @ 997'. 150' outside & 143' inside casing, couldn't load hole. Spot 50 sx plug @ 997' WOC over weekend.

02/11/2002 RIH tag @ 616'. Perforate @ 544', pump 100 sx plug WOC. RIH didn't tag pump 50 sx plug. WOC tag plug @ 430'. Spot 25 sx plug @ 430' tag @ 365'. Spot 25 sx plug @ 360' Tag @ 345'. Spot 25 sx plug @ 331' load hole circ. Perforate 7" casing @ 300', pump 50 sx plug tag @ 290', pump 25 sx plug & WOC overnight.

02/12/2002 Tag cement. @ 150'. Perforate 7" @ 60' circ cement to surface down 7" & out 8 5/8" casing.

Install dry hole marker and backfill pit.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Crissa D. Carter TITLE Production Analyst DATE 2/14/02

TYPE OR PRINT NAME Crissa D. Carter TELEPHONE NO. 748-1288

(This space for State Use)

APPROVED BY [Signature] TITLE Wild Sep ID DATE FEB 21 2002

CONDITIONS OF APPROVAL, IF ANY: