<b>,</b> -	C) \$ 1 Form C-103
Submit 3 Copies To Appropriate District 10 State of Nev	v Mexico
Office Fneroy Minerals and	Natural Resources Revised March 25, 1999
1436N P. L. D 17-66 NIMINE 74(1	WELL API NO.
District II / 2 St. Wort CONCEDIAT	30-015-04422
811 South First, Artesia, NM 88210	5. Indicate Type of Lease
811 South First, Artesia, NM 88210  District III  1000 Rio Brazos Rd., Aztec, NM 87419CD - ARTESIA  District IV  Serv A1  RECEIVED  1230 South St.  Santa Fe, N	Francis Dr. STATE FEE X
1000 Rio Brazos Rd., Aztec, NW 87419CD - ARTESIA 1220 South St.  District IV	M 87505 6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM	
87505	ELLS 7. Lease Name or Unit Agreement Name:
SUNDRY NOTICES AND REPORTS ON WI	
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-1	101) FOR SUCH
PROPOSALS.)	
1 Type of Well:	Scheurich B
Oil Well Gas Well Other Plug & Ab	8. Well No.
2. Name of Operator	8. WEILING.
Yates Petroleum Corporation	9. Pool name or Wildcat
3. Address of Operator	
105 South Fourth Street - Artesia, NM 882	10
4. Well Location	
Unit Letter F : 2310 feet from the Nor	cth line and 2310 feet from the West line
Unit Letter F : 2310 feet from the NOT	
Section 32 Township 175	Range 30E NMPM Eddy County
10. Elevation (Show wheth	ner DR, RKB, RT, GR, etc.)
3584 ° G	R .
11. Check Appropriate Box to Indica	te Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF.
PERFORM REMEDIAL WORK   PLUG AND ABANDON	REMEDIAL WORK ALTERING CASING
PENT ONAL METALENIA TOTAL	COMMENCE DRILLING OPNS. T PLUG AND
TEMPORARII Y ARANDON	
TEMPORARILY ABANDON OF THE	
	ABANDONMENT
PULL OR ALTER CASING  MULTIPLE	CASING TEST AND
	CASING TEST AND CEMENT JOB
PULL OR ALTER CASING MULTIPLE COMPLETION	CASING TEST AND CEMENT JOB  OTHER:
PULL OR ALTER CASING MULTIPLE COMPLETION  OTHER:	ABANDONMENT  CASING TEST AND CEMENT JOB  OTHER:
PULL OR ALTER CASING MULTIPLE COMPLETION  OTHER:	ABANDONMENT  CASING TEST AND CEMENT JOB  OTHER:
PULL OR ALTER CASING MULTIPLE COMPLETION  OTHER:  12. Describe proposed or completed operations. (Clearly state a of starting any proposed work). SEE RULE 1103. For Multiple Completed operations.	ABANDONMENT  CASING TEST AND CEMENT JOB  OTHER:  all pertinent details, and give pertinent dates, including estimated date ciple Completions: Attach wellbore diagram of proposed completion
PULL OR ALTER CASING MULTIPLE COMPLETION  OTHER:  12. Describe proposed or completed operations. (Clearly state a of starting any proposed work). SEE RULE 1103. For Multiple Completed operations.	ABANDONMENT  CASING TEST AND CEMENT JOB  OTHER:  all pertinent details, and give pertinent dates, including estimated date ciple Completions: Attach wellbore diagram of proposed completion  g unit and plugging equipment. Well flowing
PULL OR ALTER CASING  OTHER:  12. Describe proposed or completed operations. (Clearly state a of starting any proposed work). SEE RULE 1103. For Mult or recompilation.  11-26-2002 - Moved in and rigged up pulling. She in the starting and starting and starting and starting and starting.	ABANDONMENT  CASING TEST AND CEMENT JOB  OTHER:  Call pertinent details, and give pertinent dates, including estimated date date diple Completions: Attach wellbore diagram of proposed completion  g unit and plugging equipment. Well flowing
PULL OR ALTER CASING MULTIPLE COMPLETION  OTHER:  12. Describe proposed or completed operations. (Clearly state a of starting any proposed work). SEE RULE 1103. For Multiple or recompilation.  11-26-2002 - Moved in and rigged up pulling water. Unseated pump. Still flowing. She water and pump. Still flowing. She water and pump. Nip	CASING TEST AND CEMENT JOB  OTHER:  all pertinent details, and give pertinent dates, including estimated date ciple Completions: Attach wellbore diagram of proposed completion g unit and plugging equipment. Well flowing ut well in for night.  pled down wellhead and nippled up BOP. Rigged
PULL OR ALTER CASING  MULTIPLE COMPLETION  OTHER:  12. Describe proposed or completed operations. (Clearly state a of starting any proposed work). SEE RULE 1103. For Mult or recompilation.  11-26-2002 - Moved in and rigged up pullin water. Unseated pump. Still flowing. Sh 11-27-2002 - POOH with rods and pump. Nip up floor and tubing equipment. POOH with	CASING TEST AND CEMENT JOB  OTHER:  all pertinent details, and give pertinent dates, including estimated date liple Completions: Attach wellbore diagram of proposed completion g unit and plugging equipment. Well flowing ut well in for night.  pled down wellhead and nippled up BOP. Rigged tubing. Shut well in for night.
PULL OR ALTER CASING  MULTIPLE COMPLETION  OTHER:  12. Describe proposed or completed operations. (Clearly state a of starting any proposed work). SEE RULE 1103. For Mult or recompilation.  11-26-2002 - Moved in and rigged up pullin water. Unseated pump. Still flowing. Sh 11-27-2002 - POOH with rods and pump. Nip up floor and tubing equipment. POOH with	CASING TEST AND CEMENT JOB  OTHER:  all pertinent details, and give pertinent dates, including estimated date liple Completions: Attach wellbore diagram of proposed completion g unit and plugging equipment. Well flowing ut well in for night.  pled down wellhead and nippled up BOP. Rigged tubing. Shut well in for night.
PULL OR ALTER CASING  MULTIPLE COMPLETION  OTHER:  12. Describe proposed or completed operations. (Clearly state a of starting any proposed work). SEE RULE 1103. For Multiple or recompilation.  11-26-2002 - Moved in and rigged up pullin water. Unseated pump. Still flowing. Shift 11-27-2002 - POOH with rods and pump. Nip up floor and tubing equipment. POOH with 11-28-12-2-2002 - Rigged up wireline. RIH with gauge ring. Rigged down wireline. R	CASING TEST AND CEMENT JOB  OTHER:  all pertinent details, and give pertinent dates, including estimated date tiple Completions: Attach wellbore diagram of proposed completion g unit and plugging equipment. Well flowing ut well in for night. pled down wellhead and nippled up BOP. Rigged tubing. Shut well in for night. with gauge ring and hung up at 930'. POOH III with tubing to 2759'. Shut well in for
PULL OR ALTER CASING  MULTIPLE COMPLETION  OTHER:  12. Describe proposed or completed operations. (Clearly state a of starting any proposed work). SEE RULE 1103. For Multiple or recompilation.  11-26-2002 - Moved in and rigged up pullin water. Unseated pump. Still flowing. Shift 11-27-2002 - POOH with rods and pump. Nip up floor and tubing equipment. POOH with 11-28-12-2-2002 - Rigged up wireline. RIH with gauge ring. Rigged down wireline. R	CASING TEST AND CEMENT JOB  OTHER:  all pertinent details, and give pertinent dates, including estimated date tiple Completions: Attach wellbore diagram of proposed completion g unit and plugging equipment. Well flowing ut well in for night. pled down wellhead and nippled up BOP. Rigged tubing. Shut well in for night. with gauge ring and hung up at 930'. POOH III with tubing to 2759'. Shut well in for
PULL OR ALTER CASING MULTIPLE COMPLETION  OTHER:  12. Describe proposed or completed operations. (Clearly state a of starting any proposed work). SEE RULE 1103. For Mult or recompilation.  11-26-2002 - Moved in and rigged up pullin water. Unseated pump. Still flowing. Sh 11-27-2002 - POOH with rods and pump. Nip up floor and tubing equipment. POOH with 11-28-12-2-2002 - Rigged up wireline. RIH with gauge ring. Rigged down wireline. R holiday weekend.  12-3-2002 - Spotted 30 sacks Class C Neat	CASING TEST AND CEMENT JOB  OTHER:  all pertinent details, and give pertinent dates, including estimated date ciple Completions: Attach wellbore diagram of proposed completion g unit and plugging equipment. Well flowing ut well in for night. pled down wellhead and nippled up BOP. Rigged tubing. Shut well in for night. with gauge ring and hung up at 930'. POOH all with tubing to 2759'. Shut well in for well in for might. Shut well in for Shut Well shut well shut shut shut shut shut shut shut shut
PULL OR ALTER CASING MULTIPLE COMPLETION  OTHER:  12. Describe proposed or completed operations. (Clearly state a of starting any proposed work). SEE RULE 1103. For Multiple or recompilation.  11-26-2002 - Moved in and rigged up pulling water. Unseated pump. Still flowing. Shelf 11-27-2002 - POOH with rods and pump. Nipup floor and tubing equipment. POOH with 11-28-12-2-2002 - Rigged up wireline. RIH with gauge ring. Rigged down wireline. Rigged holiday weekend.  12-3-2002 - Spotted 30 sacks Class C Neat well in for night. WOC.	CASING TEST AND CEMENT JOB  OTHER:  all pertinent details, and give pertinent dates, including estimated date siple Completions: Attach wellbore diagram of proposed completion  g unit and plugging equipment. Well flowing ut well in for night.  pled down wellhead and nippled up BOP. Rigged tubing. Shut well in for night.  with gauge ring and hung up at 930'. POOH III with tubing to 2759'. Shut well in for well i
PULL OR ALTER CASING MULTIPLE COMPLETION  OTHER:  12. Describe proposed or completed operations. (Clearly state a of starting any proposed work). SEE RULE 1103. For Multiple or recompilation.  11-26-2002 - Moved in and rigged up pulling water. Unseated pump. Still flowing. Shelf 11-27-2002 - POOH with rods and pump. Nipup floor and tubing equipment. POOH with 11-28-12-2-2002 - Rigged up wireline. RIH with gauge ring. Rigged down wireline. Rigged holiday weekend.  12-3-2002 - Spotted 30 sacks Class C Neat well in for night. WOC.  12-4-2002 - RIH with tubing and tagged plus and tagged	CASING TEST AND CEMENT JOB  OTHER:  all pertinent details, and give pertinent dates, including estimated date siple Completions: Attach wellbore diagram of proposed completion  g unit and plugging equipment. Well flowing ut well in for night.  pled down wellhead and nippled up BOP. Rigged tubing. Shut well in for night.  with gauge ring and hung up at 930'. POOH atth with tubing to 2759'. Shut well in for well in for might.  Cement at 2740'. POOH with 60 joints. Shut well in for well at 2556'. Circulated hole with plugging mud.
PULL OR ALTER CASING  MULTIPLE COMPLETION  OTHER:  12. Describe proposed or completed operations. (Clearly state a of starting any proposed work). SEE RULE 1103. For Multiple or recompilation.  11-26-2002 - Moved in and rigged up pullin water. Unseated pump. Still flowing. Shall-27-2002 - POOH with rods and pump. Nip up floor and tubing equipment. POOH with 11-28-12-2-2002 - Rigged up wireline. RIH with gauge ring. Rigged down wireline. Rigged weekend.  12-3-2002 - Spotted 30 sacks Class C Neat well in for night. WOC.  12-4-2002 - RIH with tubing and tagged plu POOH with tubing. Rigged up wireline. RIF with packer and	CASING TEST AND CEMENT JOB  OTHER:  all pertinent details, and give pertinent dates, including estimated date tiple Completions: Attach wellbore diagram of proposed completion g unit and plugging equipment. Well flowing ut well in for night.  pled down wellhead and nippled up BOP. Rigged tubing. Shut well in for night.  with gauge ring and hung up at 930'. POOH at with tubing to 2759'. Shut well in for well in for might.  Cement at 2740'. POOH with 60 joints. Shut well and perforated 7" caisng at 1225'. POOH & and perforated 7" caisng at 1225'. POOH & at tubing and set packer at 927'. Squeezed with
PULL OR ALTER CASING  MULTIPLE COMPLETION  OTHER:  12. Describe proposed or completed operations. (Clearly state a of starting any proposed work). SEE RULE 1103. For Multiple or recompilation.  11-26-2002 - Moved in and rigged up pullin water. Unseated pump. Still flowing. Shift 11-27-2002 - POOH with rods and pump. Nip up floor and tubing equipment. POOH with 11-28-12-2-2002 - Rigged up wireline. RIH with gauge ring. Rigged down wireline. Rigged down wireline. Rigged in for night. WOC.  12-4-2002 - RIH with tubing and tagged plu POOH with tubing. Rigged up wireline. RIF rigged down wireline. RIF with packer and	CASING TEST AND CEMENT JOB  OTHER:  all pertinent details, and give pertinent dates, including estimated date in the completions: Attach wellbore diagram of proposed completion gunit and plugging equipment. Well flowing ut well in for night.  pled down wellhead and nippled up BOP. Rigged tubing. Shut well in for night.  with gauge ring and hung up at 930'. POOH at the pool of the plugging mud. The proposed of tubing and set packer at 927'. Squeezed with the plugging and set packer at 927'. Squeezed with the plugging and set packer at 927'. Squeezed with the plugging and set packer at 927'. Squeezed with the plugging and set packer at 927'. Squeezed with the plugging and set packer at 927'. Squeezed with the plugging and set packer at 927'. Squeezed with
PULL OR ALTER CASING  MULTIPLE COMPLETION  OTHER:  12. Describe proposed or completed operations. (Clearly state a of starting any proposed work). SEE RULE 1103. For Multiple or recompilation.  11-26-2002 - Moved in and rigged up pulling water. Unseated pump. Still flowing. She of the still pump of the still pump of the still pump of the still pump. Nip up floor and tubing equipment. POOH with 11-28-12-2-2002 - Rigged up wireline. RIH with gauge ring. Rigged down wireline. Rigged down wireline. Rigged up wireline. Rigged down wireline. Rigged down wireline. Rigged down wireline. Rigged up wireline. Rigged down wireline.	CASING TEST AND CEMENT JOB  OTHER:  All pertinent details, and give pertinent dates, including estimated date in the completions: Attach wellbore diagram of proposed completion gunit and plugging equipment. Well flowing ut well in for night. pled down wellhead and nippled up BOP. Rigged tubing. Shut well in for night. with gauge ring and hung up at 930'. POOH III with tubing to 2759'. Shut well in for well in for might at 2556'. Circulated hole with plugging mud. It and perforated 7" caising at 1225'. POOH & tubing and set packer at 927'. Squeezed with in for night. WOC.  POOH with packer and tubing. Rigged up wireline.
PULL OR ALTER CASING  MULTIPLE COMPLETION  OTHER:  12. Describe proposed or completed operations. (Clearly state a of starting any proposed work). SEE RULE 1103. For Multiple or recompilation.  11-26-2002 - Moved in and rigged up pulling water. Unseated pump. Still flowing. Sheater. Unseated pump. Still flowing. Sheater. Unseated pump. Nipup floor and tubing equipment. Pooh with 11-28-12-2-2002 - Rigged up wireline. RIH with gauge ring. Rigged down wireline. Rigged down wireline. Rigged in for night. WOC.  12-4-2002 - Spotted 30 sacks Class C Neater well in for night. WOC.  12-4-2002 - RIH with tubing and tagged plup Pooh with tubing. Rigged up wireline. Rigged down wireline. Rigged down wireline. Rigged up wireline. Rigged down wireline. Rigged down wireline. Rigged up wireline. Rigged down wireline. Rigged up wireline. Rigged down wireline. Rigged up wireline. Rigged down wireline. Rigged down wireline. Rigged up wireline. Rigged down wireline.	CASING TEST AND CEMENT JOB  OTHER:  all pertinent details, and give pertinent dates, including estimated date in the Completions: Attach wellbore diagram of proposed completion gunit and plugging equipment. Well flowing ut well in for night. pled down wellhead and nippled up BOP. Rigged tubing. Shut well in for night. with gauge ring and hung up at 930'. POOH ITH with tubing to 2759'. Shut well in for cement at 2740'. POOH with 60 joints. Shut the line of the complete of th
PULL OR ALTER CASING  MULTIPLE COMPLETION  OTHER:  12. Describe proposed or completed operations. (Clearly state a of starting any proposed work). SEE RULE 1103. For Multiple or recompilation.  11-26-2002 - Moved in and rigged up pulling water. Unseated pump. Still flowing. Sheater. Unseated pump. Still flowing. Sheater. Unseated pump. Nipup floor and tubing equipment. Pooh with 11-28-12-2-2002 - Rigged up wireline. RIH with gauge ring. Rigged down wireline. Rigged down wireline. Rigged in for night. WOC.  12-4-2002 - Spotted 30 sacks Class C Neater well in for night. WOC.  12-4-2002 - RIH with tubing and tagged plup Pooh with tubing. Rigged up wireline. Rigged down wireline. Rigged down wireline. Rigged up wireline. Rigged down wireline. Rigged down wireline. Rigged up wireline. Rigged down wireline. Rigged up wireline. Rigged down wireline. Rigged up wireline. Rigged down wireline. Rigged down wireline. Rigged up wireline. Rigged down wireline.	CASING TEST AND CEMENT JOB  OTHER:  all pertinent details, and give pertinent dates, including estimated date in the Completions: Attach wellbore diagram of proposed completion gunit and plugging equipment. Well flowing ut well in for night. pled down wellhead and nippled up BOP. Rigged tubing. Shut well in for night. with gauge ring and hung up at 930'. POOH ITH with tubing to 2759'. Shut well in for cement at 2740'. POOH with 60 joints. Shut the line of the complete of th
PULL OR ALTER CASING MULTIPLE COMPLETION  OTHER:  12. Describe proposed or completed operations. (Clearly state a of starting any proposed work). SEE RULE 1103. For Multiple or recompilation.  11-26-2002 - Moved in and rigged up pulling water. Unseated pump. Still flowing. She water. Unseated pump. Still flowing. She water. Unseated pump. Nip up floor and tubing equipment. POOH with 11-28-12-2-2002 - Rigged up wireline. RIH with gauge ring. Rigged down wireline. RIH with gauge ring. Rigged down wireline. RIH with gauge ring water well in for night. WOC.  12-4-2002 - RIH with tubing and tagged plus POOH with tubing. Rigged up wireline. RIH rigged down wireline. RIH with packer and 65 sacks Class C Neat cement. Shut well in 12-5-2002 - RIH and tagged plug at 1091'. RIH and perforated 7" casing at 548'. POOT Thereby certify that the information above is true and complete to the comple	CASING TEST AND CEMENT JOB  OTHER:  All pertinent details, and give pertinent dates, including estimated date siple Completions: Attach wellbore diagram of proposed completion g unit and plugging equipment. Well flowing ut well in for night. pled down wellhead and nippled up BOP. Rigged tubing. Shut well in for night. with gauge ring and hung up at 930'. POOH I'M with tubing to 2759'. Shut well in for well in for might. Cement at 2740'. POOH with 60 joints. Shut it and perforated 7" caising at 1225'. POOH & I'M tubing and set packer at 927'. Squeezed with in for night. WOC.  POOH with packer and tubing. Rigged up wireline of the best of my knowledge and belief. CONTINUED ON NEXT PAGE
PULL OR ALTER CASING MULTIPLE COMPLETION  OTHER:  12. Describe proposed or completed operations. (Clearly state a of starting any proposed work). SEE RULE 1103. For Multiple or recompilation.  11-26-2002 - Moved in and rigged up pulling water. Unseated pump. Still flowing. She in 11-27-2002 - POOH with rods and pump. Nipp up floor and tubing equipment. POOH with 11-28-12-2-2002 - Rigged up wireline. RIH with gauge ring. Rigged down wireline. RIH with gauge ring. Rigged down wireline. RIH with in for night. WOC.  12-4-2002 - RIH with tubing and tagged plus POOH with tubing. Rigged up wireline. RIH rigged down wireline. RIH with packer and 65 sacks Class C Neat cement. Shut well in 12-5-2002 - RIH and tagged plug at 1091'. RIH and perforated 7" casing at 548'. POOT Thereby certify that the information above is true and complete to the c	CASING TEST AND CEMENT JOB  OTHER:  all pertinent details, and give pertinent dates, including estimated date in the completions: Attach wellbore diagram of proposed completion g unit and plugging equipment. Well flowing ut well in for night. pled down wellhead and nippled up BOP. Rigged tubing. Shut well in for night. with gauge ring and hung up at 930'. POOH ITH with tubing to 2759'. Shut well in for cement at 2740'. POOH with 60 joints. Shut the last and perforated 7" caising at 1225'. POOH & tubing and set packer at 927'. Squeezed with the for night. WOC.  POOH with packer and tubing. Rigged up wireline of the rigged down wireline. RIH with packer &
PULL OR ALTER CASING MULTIPLE COMPLETION  OTHER:  12. Describe proposed or completed operations. (Clearly state a of starting any proposed work). SEE RULE 1103. For Multiple or recompilation.  11-26-2002 - Moved in and rigged up pulling water. Unseated pump. Still flowing. Shelf 11-27-2002 - POOH with rods and pump. Nipup floor and tubing equipment. POOH with 11-28-12-2-2002 - Rigged up wireline. RIH with gauge ring. Rigged down wireline. RIH with gauge ring. Rigged down wireline. RIH with gauge ring. Rigged up wireline. RIH with for night. WOC.  12-4-2002 - RIH with tubing and tagged plup POOH with tubing. Rigged up wireline. RIF rigged down wireline. RIH with packer and 65 sacks Class C Neat cement. Shut well in 12-5-2002 - RIH and tagged plug at 1091'. RIH and perforated 7" casing at 548'. POOT I hereby certify that the information above is true and complete to	CASING TEST AND CEMENT JOB  OTHER:  all pertinent details, and give pertinent dates, including estimated date in the Completions: Attach wellbore diagram of proposed completion gunit and plugging equipment. Well flowing ut well in for night. Pled down wellhead and nippled up BOP. Rigged tubing. Shut well in for night. With gauge ring and hung up at 930'. POOH atth with tubing to 2759'. Shut well in for well in for might. Well in for might. The with tubing to 2759'. Shut well in for well in for might at 2556'. Circulated hole with plugging mud. The hand perforated 7" caising at 1225'. POOH & tubing and set packer at 927'. Squeezed with in for night. Woc.  POOH with packer and tubing. Rigged up wireline of the best of my knowledge and belief. CONTINUED ON NEXT PAGE TLE REGULATORY COMPLIANCE TECH DATE 12-18-02
PULL OR ALTER CASING MULTIPLE COMPLETION  OTHER:  12. Describe proposed or completed operations. (Clearly state a of starting any proposed work). SEE RULE 1103. For Multiple or recompilation.  11-26-2002 - Moved in and rigged up pulling water. Unseated pump. Still flowing. She in 11-27-2002 - POOH with rods and pump. Nipp up floor and tubing equipment. POOH with 11-28-12-2-2002 - Rigged up wireline. RIH with gauge ring. Rigged down wireline. RIH with gauge ring. Rigged down wireline. RIH with in for night. WOC.  12-4-2002 - RIH with tubing and tagged plus POOH with tubing. Rigged up wireline. RIH rigged down wireline. RIH with packer and 65 sacks Class C Neat cement. Shut well in 12-5-2002 - RIH and tagged plug at 1091'. RIH and perforated 7" casing at 548'. POOT Thereby certify that the information above is true and complete to the c	CASING TEST AND CEMENT JOB  OTHER:  All pertinent details, and give pertinent dates, including estimated date tiple Completions: Attach wellbore diagram of proposed completion g unit and plugging equipment. Well flowing ut well in for night. pled down wellhead and nippled up BOP. Rigged tubing. Shut well in for night. with gauge ring and hung up at 930'. POOH I'll with tubing to 2759'. Shut well in for well in for might. Cement at 2740'. POOH with 60 joints. Shut well and perforated 7" caising at 1225'. POOH & it tubing and set packer at 927'. Squeezed with in for night. WOC.  POOH with packer and tubing. Rigged up wireline of the best of my knowledge and belief. CONTINUED ON NEXT PAGE TLE REGULATORY COMPLIANCE TECH DATE 12-18-02  Telephone No. 505-748-1471
PULL OR ALTER CASING MULTIPLE COMPLETION  OTHER:  12. Describe proposed or completed operations. (Clearly state a of starting any proposed work). SEE RULE 1103. For Multiple or recompilation.  11-26-2002 - Moved in and rigged up pullin water. Unseated pump. Still flowing. Shill-27-2002 - POOH with rods and pump. Nip up floor and tubing equipment. POOH with 11-28-12-2-2002 - Rigged up wireline. RIH with gauge ring. Rigged down wireline. Riminating the sum of	CASING TEST AND CEMENT JOB  OTHER:  all pertinent details, and give pertinent dates, including estimated date in completions: Attach wellbore diagram of proposed completion g unit and plugging equipment. Well flowing ut well in for night.  pled down wellhead and nippled up BOP. Rigged tubing. Shut well in for night.  with gauge ring and hung up at 930'. POOH in the tubing to 2759'. Shut well in for cement at 2740'. POOH with 60 joints. Shut well in for night and perforated 7" caising at 1225'. POOH & it tubing and set packer at 927'. Squeezed with in for night. WOC.  POOH with packer and tubing. Rigged up wireline of the best of my knowledge and belief.  CONTINUED ON NEXT PAGE TLE REGULATORY COMPLIANCE TECH DATE 12-18-02  Telephone No. 505-748-1471
PULL OR ALTER CASING MULTIPLE COMPLETION  OTHER:  12. Describe proposed or completed operations. (Clearly state a of starting any proposed work). SEE RULE 1103. For Multiple or recompilation.  11-26-2002 - Moved in and rigged up pullin water. Unseated pump. Still flowing. Shill-27-2002 - POOH with rods and pump. Nip up floor and tubing equipment. POOH with 11-28-12-2-2002 - Rigged up wireline. RIH with gauge ring. Rigged down wireline. RIH with gauge ring. Rigged down wireline. RIH with in for night. WOC.  12-4-2002 - Spotted 30 sacks Class C Neat well in for night. WOC.  12-4-2002 - RIH with tubing and tagged plu POOH with tubing. Rigged up wireline. RIH rigged down wireline. RIH with packer and 65 sacks Class C Neat cement. Shut well in 12-5-2002 - RIH and tagged plug at 1091'. RIH and perforated 7" casing at 548'. POOI I hereby certify that the information above is true and complete to SIGNATURE  Type or print name DONNA J CLACK  (This space for State use)	CASING TEST AND CEMENT JOB  OTHER:  all pertinent details, and give pertinent dates, including estimated date in completions: Attach wellbore diagram of proposed completion g unit and plugging equipment. Well flowing ut well in for night.  pled down wellhead and nippled up BOP. Rigged tubing. Shut well in for night.  with gauge ring and hung up at 930'. POOH in the pauge ring and hung up at 930'. POOH in for night with tubing to 2759'. Shut well in for points. Shut well in for might at 2556'. Circulated hole with plugging mud. It with plugging mud. It with packer at 927'. Squeezed with in for night. Woc.  POOH with packer and tubing. Rigged up wireline. By a rigged down wireline. RIH with packer & othe best of my knowledge and belief. CONTINUED ON NEXT PAGE TLEREGULATORY COMPLIANCE TECH DATE 12-18-02  Telephone No. 505-748-1471  Gerry Guye Compliance Officer
PULL OR ALTER CASING MULTIPLE COMPLETION  OTHER:  12. Describe proposed or completed operations. (Clearly state a of starting any proposed work). SEE RULE 1103. For Multiple or recompilation.  11-26-2002 - Moved in and rigged up pullin water. Unseated pump. Still flowing. Shill-27-2002 - POOH with rods and pump. Nip up floor and tubing equipment. POOH with 11-28-12-2-2002 - Rigged up wireline. RIH with gauge ring. Rigged down wireline. Rih holiday weekend.  12-3-2002 - Spotted 30 sacks Class C Neat well in for night. WOC.  12-4-2002 - RIH with tubing and tagged plu POOH with tubing. Rigged up wireline. RIF rigged down wireline. RIF rigged down wireline. RIF rigged down wireline. RIF and perforated 7" casing at 548'. POOI I hereby certify that the information above is true and complete to SIGNATURE.  Type or print name DONNA J CLACK	CASING TEST AND CEMENT JOB  OTHER:  all pertinent details, and give pertinent dates, including estimated date in completions: Attach wellbore diagram of proposed completion g unit and plugging equipment. Well flowing ut well in for night.  pled down wellhead and nippled up BOP. Rigged tubing. Shut well in for night.  with gauge ring and hung up at 930'. POOH if with tubing to 2759'. Shut well in for cement at 2740'. POOH with 60 joints. Shut in gat 2556'. Circulated hole with plugging mud. He and perforated 7" caising at 1225'. POOH & it tubing and set packer at 927'. Squeezed with in for night. WOC.  POOH with packer and tubing. Rigged up wireline. OH & rigged down wireline. RIH with packer & othe best of my knowledge and belief. CONTINUED ON NEXT PAGE.  TLEREGULATORY COMPLIANCE TECH DATE 12-18-02  Telephone No. 505-748-1471  Gerry Guye  Compliance Officer

YATES PETROLEUM CORPORATION Scheurich B #6 Section 32-T17S-R30E Eddy County, New Mexico

## SUNDRY NOTICE CONTINUED:

tubing. Squeezed with 100 sacks Class C Neat cement. WOC 4 hours. RIH and tagged plug at 432'. POOH with packer and tubing. Shut well in for night. 12-6-2002 - Rigged up wireline. RIH and perforated 7" casing at 60'. POOH & rigged down wireline. Rigged down tubing equipment and floor. Nippled down BOP & 7" casinghead. Installed 7" X 2" swedge with valve. Squeezed with 60 sacks Class C Neat cement. WOC 4 hours. Cement at 5' from surface. Rigged down pulling unit and plugging equipment. Installed regulation abandonment marker. PLUGGED AND ABANDONED - FINAL REPORT. Plugging completed 12-5-2002.

my 16 300 g