

NO. OF COPIES RECEIVED	4
DISTRIBUTION	
SANTA FE	1
FILE	1 ✓
U.S.G.S.	
LAND OFFICE	
OPERATOR	2

NEW MEXICO OIL CONSERVATION COMMISSION

JUN 12 1970

O. C. C.

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. B-2130
7. Unit Agreement Name
8. Farm or Lease Name State BU
9. Well No. 6
10. Field and Pool, or Wildcat Loco Hills (G.SA)
12. County Eddy

SUNDY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. Name of Operator
Cities Service Oil Company

3. Address of Operator
Box 69 - Hobbs, New Mexico 88240

4. Location of Well
UNIT LETTER **P** **330** FEET FROM THE **South** LINE AND **990** FEET FROM THE **East** LINE, SECTION **32** TOWNSHIP **17S** RANGE **30E** NMPM.
15. Elevation (Show whether DF, RT, GR, etc.)
3581 DF

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

The above well was plugged and abandoned in the following manner:

1. Set a 50 sack cement plug @ PBTD 3640-3382.
2. Loaded hole with mud laden fluid.
3. Set a 50 sack cement plug @ 3090-2898 (7" csg. set @ 2994 w/100 sacks).
4. Cut and pulled 1510' of 7" casing.
5. Set a 30 sack cement plug @ 1565-1468 (½ in and ½ out of 7" csg. Stub @ 1510').
6. Set a 30 sack cement plug at the base of the salt @ 1350-1262.
7. Set a 30 sack cement plug @ 566-466 (½ in and ½ out of 8-5/8" csg. set @ 514').
8. Set a 10 sack cement surface plug @ 30-0' w/a 4" pipe extending 4' above the surface to designate a P&A location.
9. Location has been cleaned of all debris and equipment and is ready for final inspection.

P.A. (Pow)

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

ORIGINAL SIGNED D. O. ROBERTSON	TITLE District Admin. Supervisor	DATE June 10, 1970
SIGNED BY <i>[Signature]</i>	TITLE OIL AND GAS INSPECTOR	DATE JUL 21 1970
REMARKS OF APPROVAL, IF ANY:		