	~	') سم	
Submit 3 Copies To Appropriate Discort 12 13 7. State of New	Mexico	ンととして	Form C-103
Office Ab Friend Minerals and I		97	Revised March 25, 1999
Disult 9		<b>WELL API NO.</b> 30-015	-04438
BII South First Artesia, NM 882000 CO OIL CONSERVATI		5. Indicate Type of	f Lease
District II  District III  1000 Rio Brazos Rd., Aztec, NM 87410 P.C.  District IV  District IV		STATE 🖾	
District IV	M 87505	6. State Oil & Ga	
1220 S. St. Francis Dr., Santa Fa, NM		B-41	08
SUNDRY ROZZIOES AND REPORTS ON WE	ELLS	7. Lease Name or	Unit Agreement Name:
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN O DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-10 PROPOSALS.)	R PLUG BACK TO A		
1. Type of Well: Oil Well Gas Well Other Plug & Aba	ındon	Scheu	rich
2. Name of Operator		8. Well No.	
Yates Petroleum Corporation		3	
3. Address of Operator		9. Pool name or W	ildcat s-Q-GB-SA
105 South Fourth Street - Artesia, NM 882	210	LOCO HIII	s-Q-GD-SA
4. Well Location			
Unit Letter L : 2310 feet from the Sou	th line and 33	0 feet from	the West line
Section 32 Township 17S	Range 30E	NMPM Eddy	County
10. Elevation (Show whether			
	CAT ALL D	Other D	o to
11. Check Appropriate Box to Indicate	e Nature of Notice, K	EQUENT REP	ala ODT OE:
NOTICE OF INTENTION TO:	REMEDIAL WORK		ALTERING CASING $\Box$
PERFORM REMEDIAL WORK PLUG AND ABANDON		<del></del>	
TEMPORARILY ABANDON	COMMENCE DRIL	LING OPNS. 🔲	PLUG AND
	l '		AHANIJUMMENI
PULL OR ALTER CASING  MULTIPLE  COMPLETION	CASING TEST AN		ABANDONMENT
COMPLETION	CEMENT JOB		ABANDONMEN1
OTHER:	OTHER:	ye pertinent dates, ir	cluding estimated date
OTHER:	OTHER:	ye pertinent dates, ir	cluding estimated date
OTHER:  12. Describe proposed or completed operations. (Clearly state al of starting any proposed work). SEE RULE 1103. For Multiplications.	OTHER:  I pertinent details, and giple Completions: Attach	ve pertinent dates, ir wellbore diagram of	acluding estimated date f proposed completion
OTHER:  12. Describe proposed or completed operations. (Clearly state al of starting any proposed work). SEE RULE 1103. For Multipor recompilation.	OTHER:  I pertinent details, and giple Completions: Attach	ve pertinent dates, ir wellbore diagram of	cluding estimated date f proposed completion Nippled down well
OTHER:  12. Describe proposed or completed operations. (Clearly state al of starting any proposed work). SEE RULE 1103. For Multipor recompilation.  7-19-2002 - Moved in and rigged up pulling	OTHER:  I pertinent details, and gi ple Completions: Attach  unit and plugging	ve pertinent dates, in wellbore diagram of g equipment.	cluding estimated date f proposed completion Nippled down well 5'. POOH. RIH
OTHER:  12. Describe proposed or completed operations. (Clearly state al of starting any proposed work). SEE RULE 1103. For Multipor recompilation.  7-19-2002 - Moved in and rigged up pulling head and nippled up BOP. Rigged up wireling the starting apparent of the starti	OTHER:  I pertinent details, and giple Completions: Attach  unit and plugging ne. RIH with gau	ve pertinent dates, in wellbore diagram of gequipment. If ge ring to 277, to repair wire.	cluding estimated date f proposed completion Nippled down well 5'. POOH. RIH
OTHER:  12. Describe proposed or completed operations. (Clearly state al of starting any proposed work). SEE RULE 1103. For Multipor recompilation.  7-19-2002 - Moved in and rigged up pulling head and nippled up BOP. Rigged up wirelime with CIBP to 2750' - wireline shorted out.  With CIBP to 2750' - would not fire. POOH	OTHER:  I pertinent details, and giple Completions: Attach  unit and plugging ne. RIH with gau  POOH with CIBP  with CIBP and ri	ve pertinent dates, in wellbore diagram of gequipment. It ge ring to 277 to repair wire gged down wire	acluding estimated date for proposed completion Nippled down well 5'. POOH. RIH line. RIH line. Moved in
OTHER:  12. Describe proposed or completed operations. (Clearly state all of starting any proposed work). SEE RULE 1103. For Multipor recompilation.  7-19-2002 - Moved in and rigged up pulling head and nippled up BOP. Rigged up wireling with CIBP to 2750' - wireline shorted out. With CIBP to 2750' - would not fire. POOH 2-3/8" workstring. Shut well in for night	CEMENT JOB OTHER:  I pertinent details, and giple Completions: Attach unit and plugging ne. RIH with gau POOH with CIBP with CIBP and ri d set CIBP at 275	ve pertinent dates, in wellbore diagram of gequipment. It ge ring to 277 to repair wire gged down wire	acluding estimated date for proposed completion Nippled down well 5'. POOH. RIH line. RIH line. Moved in d hole with
OTHER:  12. Describe proposed or completed operations. (Clearly state all of starting any proposed work). SEE RULE 1103. For Multipor recompilation.  7-19-2002 - Moved in and rigged up pulling head and nippled up BOP. Rigged up wireling with CIBP to 2750' - wireline shorted out. With CIBP to 2750' - would not fire. POOH 2-3/8" workstring. Shut well in for night	CEMENT JOB OTHER:  I pertinent details, and giple Completions: Attach unit and pluggingne. RIH with gau POOH with CIBP with CIBP and ri d set CIBP at 275	we pertinent dates, in wellbore diagram of gequipment. It ge ring to 277 to repair wire gged down wire O'. Circulate POOH. Rigge	reluding estimated date for proposed completion  Nippled down well  5'. POOH. RIH  line. RIH  line. Moved in  d hole with  d up wireline.
OTHER:  12. Describe proposed or completed operations. (Clearly state all of starting any proposed work). SEE RULE 1103. For Multipor recompilation.  7-19-2002 - Moved in and rigged up pulling head and nippled up BOP. Rigged up wireling with CIBP to 2750' - wireline shorted out. With CIBP to 2750' - would not fire. POOH 2-3/8" workstring. Shut well in for night	CEMENT JOB OTHER:  I pertinent details, and gi ple Completions: Attach unit and plugging ne. RIH with gau POOH with CIBP with CIBP and ri d set CIBP at 275 ss C Neat cement. POOH and rigged	ve pertinent dates, in wellbore diagram of ge quipment. It ge ring to 277 to repair wire gged down wire POOH. Rigge down wireline	cluding estimated date for proposed completion Nippled down well 5'. POOH. RIH line. RIH line. Moved in d hole with d up wireline RIH with packe
OTHER:  12. Describe proposed or completed operations. (Clearly state all of starting any proposed work). SEE RULE 1103. For Multipor recompilation.  7-19-2002 - Moved in and rigged up pulling head and nippled up BOP. Rigged up wirelime with CIBP to 2750' - wireline shorted out. with CIBP to 2750' - would not fire. POOH 2-3/8" workstring. Shut well in for night 7-20-22-2002 - RIH with tubing and CIBP and plugging mud. Capped CIBP with 35' of Clar RIH with wireline and perforated at 1209'.  and tubing and set packer at 894'. Squeez	CEMENT JOB OTHER:  I pertinent details, and giple Completions: Attach unit and pluggingne. RIH with gau POOH with CIBP with CIBP and ri d set CIBP at 275 ss C Neat cement. POOH and rigged ed with 95 sacks	ve pertinent dates, ir wellbore diagram of gequipment. It ge ring to 277 to repair wire gged down wire.  O'. Circulate POOH. Rigge down wireline Class C Neat c	Cluding estimated date for proposed completion  Nippled down well  '. POOH. RIH  line. RIH  line. Moved in  d hole with  d up wireline.  RIH with packe ement. WOC.
OTHER:  12. Describe proposed or completed operations. (Clearly state all of starting any proposed work). SEE RULE 1103. For Multipor recompilation.  7-19-2002 - Moved in and rigged up pulling head and nippled up BOP. Rigged up wirelime with CIBP to 2750' - wireline shorted out. with CIBP to 2750' - would not fire. POOH 2-3/8" workstring. Shut well in for night 7-20-22-2002 - RIH with tubing and CIBP and plugging mud. Capped CIBP with 35' of Claur RIH with wireline and perforated at 1209'. and tubing and set packer at 894'. Squeez Shut well in for night.	CEMENT JOB OTHER:  I pertinent details, and giple Completions: Attach unit and pluggingne. RIH with gaugener. RIH with gaugener. RIH with CIBP with CIBP and ried set CIBP at 275 as C Neat cement. POOH and rigged ed with 95 sacks	ve pertinent dates, in wellbore diagram of gequipment. It ge ring to 277 to repair wire gged down wire POOH. Rigge down wireline Class C Neat c	Cluding estimated date for proposed completion  Nippled down well  '. POOH. RIH  line. RIH  line. Moved in  d hole with d up wireline RIH with packe ement. WOC.
OTHER:  12. Describe proposed or completed operations. (Clearly state all of starting any proposed work). SEE RULE 1103. For Multipor recompilation.  7-19-2002 - Moved in and rigged up pulling head and nippled up BOP. Rigged up wirelime with CIBP to 2750' - wireline shorted out. with CIBP to 2750' - would not fire. POOH 2-3/8" workstring. Shut well in for night 7-20-22-2002 - RIH with tubing and CIBP and plugging mud. Capped CIBP with 35' of Claur RIH with wireline and perforated at 1209'. and tubing and set packer at 894'. Squeez Shut well in for night.  7-23-2002 - POOH with packer. Rigged up with 35' of Claur RIH with packer. Rigged up with 35' of Claur RIH with wireline and perforated at 1209'.	CEMENT JOB OTHER:  I pertinent details, and giple Completions: Attach unit and pluggingne. RIH with gaugener. RIH with gaugener. RIH with CIBP with CIBP and right of the complete section of the complete section. Pooh and rigged sed with \$\frac{4}{5}\$ sacks where the complete section is a sack of the complete section. RIH with the complete section is a sack of the complete section in the complete section in the complete section is a sack of the complete section in the complete section in the complete section in the complete section is a sack of the complete section in the complete section in the complete section is a sack of the complete section i	ve pertinent dates, in wellbore diagram of gequipment. It ge ring to 277 to repair wire gged down wire POOH. Rigge down wireline Class C Neat con wireline and OOH and rigged	ncluding estimated date for proposed completion  Nippled down well  5'. POOH. RIH  line. RIH  line. Moved in  d hole with  d up wireline.  RIH with packe  ement. WOC.  tagged cement at  down wireline.
OTHER:  12. Describe proposed or completed operations. (Clearly state all of starting any proposed work). SEE RULE 1103. For Multipor recompilation.  7-19-2002 - Moved in and rigged up pulling head and nippled up BOP. Rigged up wirelime with CIBP to 2750' - wireline shorted out. with CIBP to 2750' - would not fire. POOH 2-3/8" workstring. Shut well in for night 7-20-22-2002 - RIH with tubing and CIBP and plugging mud. Capped CIBP with 35' of Claur RIH with wireline and perforated at 1209'. and tubing and set packer at 894'. Squeez Shut well in for night.  7-23-2002 - POOH with packer. Rigged up with 1068'. POOH with wireline. RIH and perforated at 1209'.	CEMENT JOB OTHER:  Il pertinent details, and gi ple Completions: Attach unit and plugging ne. RIH with gau POOH with CIBP with CIBP and ri d set CIBP at 275 ss C Neat cement. POOH and rigged ed with 95 sacks vireline. RIH with orated at 536'. Poorated at 536'. Poorated at 536'.	ve pertinent dates, in wellbore diagram of gequipment. It ge ring to 277 to repair wire gged down wire POOH. Rigge down wireline Class C Neat con wireline and OOH and rigged d with 125 sac	reluding estimated date for proposed completion  Nippled down well 5'. POOH. RIH line. RIH line. Moved in  d hole with d up wireline RIH with packe ement. WOC.  tagged cement at down wireline. ks Class C Neat
OTHER:  12. Describe proposed or completed operations. (Clearly state all of starting any proposed work). SEE RULE 1103. For Multipor recompilation.  7-19-2002 - Moved in and rigged up pulling head and nippled up BOP. Rigged up wirelime with CIBP to 2750' - wireline shorted out. with CIBP to 2750' - would not fire. POOH 2-3/8" workstring. Shut well in for night 7-20-22-2002 - RIH with tubing and CIBP and plugging mud. Capped CIBP with 35' of Clar RIH with wireline and perforated at 1209'. and tubing and set packer at 894'. Squeez Shut well in for night.  7-23-2002 - POOH with packer. Rigged up with 1068'. POOH with wireline. RIH and perforated at 1209'. RIH with packer and tubing and set packer cement. WOC 4 hours. POOH with packer.	CEMENT JOB OTHER:  I pertinent details, and giple Completions: Attach unit and pluggingne. RIH with gau POOH with CIBP and ri d set CIBP at 275 ss C Neat cement. POOH and rigged ed with 95 sacks vireline. RIH with orated at 536'. Pat 255'. Squeeze RIH with open end ger at 255'. Squeeze at 255'. Squeeze RIH with open end ger at 255'. Squeeze	ve pertinent dates, in wellbore diagram of gequipment. It ge ring to 277 to repair wire gged down wire.  O'. Circulate POOH. Rigge down wireline Class C Neat conduction of the wireline and OOH and rigged dowith 125 saced tubing — diezed with 125	reluding estimated date for proposed completion Nippled down well 5'. POOH. RIH line. RIH line. Moved in d hole with d up wireline RIH with packe ement. WOC.  tagged cement at down wireline. ks Class C Neat d not tag. POOH
OTHER:  12. Describe proposed or completed operations. (Clearly state all of starting any proposed work). SEE RULE 1103. For Multipor recompilation.  7-19-2002 - Moved in and rigged up pulling head and nippled up BOP. Rigged up wirelime with CIBP to 2750' - wireline shorted out. with CIBP to 2750' - would not fire. POOH 2-3/8" workstring. Shut well in for night 7-20-22-2002 - RIH with tubing and CIBP and plugging mud. Capped CIBP with 35' of Clar RIH with wireline and perforated at 1209'. and tubing and set packer at 894'. Squeez Shut well in for night.  7-23-2002 - POOH with packer. Rigged up with 1068'. POOH with wireline. RIH and perforated at 1209'. RIH with packer and tubing and set packer cement. WOC 4 hours. POOH with packer.	CEMENT JOB OTHER:  I pertinent details, and giple Completions: Attach unit and pluggingne. RIH with gau. POOH with CIBP and ri. d set CIBP at 275 ss C Neat cement. POOH and rigged ed with 95 sacks wireline. RIH with orated at 536'. Pat 255'. Squeeze RIH with open end ger at 255'. Squeeze the best of my knowledge.	ve pertinent dates, in wellbore diagram of gequipment. It ge ring to 277 to repair wire gged down wire.  O'. Circulate POOH. Rigge down wireline Class C Neat conduction to the wireline and OOH and rigged downth 125 saced tubing — diezed with 125 eand belief.	Cluding estimated date for proposed completion  Nippled down well  '. POOH. RIH  line. RIH  line. Moved in  d hole with d up wireline. RIH with packe ement. WOC.  tagged cement at down wireline. ks Class C Neat d not tag. POOH sacks Class C
OTHER:  12. Describe proposed or completed operations. (Clearly state al of starting any proposed work). SEE RULE 1103. For Multip or recompilation.  7-19-2002 - Moved in and rigged up pulling head and nippled up BOP. Rigged up wirelime with CIBP to 2750' - wireline shorted out. with CIBP to 2750' - would not fire. POOH 2-3/8" workstring. Shut well in for night 7-20-22-2002 - RIH with tubing and CIBP and plugging mud. Capped CIBP with 35' of Clar RIH with wireline and perforated at 1209'. and tubing and set packer at 894'. Squeez Shut well in for night.  7-23-2002 - POOH with packer. Rigged up with 1068'. POOH with wireline. RIH and perforated RIH with packer and tubing and set packer cement. WOC 4 hours. POOH with packer. with tubing. RIH with packer and set packer tubing. RIH with packer and set packer in the packer in the packer and set packer in the pa	CEMENT JOB OTHER:  Il pertinent details, and giple Completions: Attach unit and pluggingne. RIH with gau POOH with CIBP with CIBP and ri d set CIBP at 275 ss C Neat cement. POOH and rigged ed with 95 sacks vireline. RIH with trated at 536'. P at 255'. Squeeze RIH with open end cer at 255'. Squeed the best of my knowledg	ve pertinent dates, in wellbore diagram of gequipment. It ge ring to 277 to repair wire gged down wire O'. Circulate POOH. Rigge down wireline Class C Neat con wireline and OOH and rigged d with 125 saced tubing — diezed with 125 e and belief.	Including estimated date of proposed completion  Nippled down well of the proposed completion  Nippled down well of the proposed completion of the proposed completion of the proposed complete of the proposed completion of the proposed com
OTHER:  12. Describe proposed or completed operations. (Clearly state all of starting any proposed work). SEE RULE 1103. For Multipor recompilation.  7-19-2002 - Moved in and rigged up pulling head and nippled up BOP. Rigged up wirelime with CIBP to 2750' - wireline shorted out. with CIBP to 2750' - would not fire. POOH 2-3/8" workstring. Shut well in for night 7-20-22-2002 - RIH with tubing and CIBP and plugging mud. Capped CIBP with 35' of Clar RIH with wireline and perforated at 1209'. and tubing and set packer at 894'. Squeez Shut well in for night.  7-23-2002 - POOH with packer. Rigged up with 1068'. POOH with wireline. RIH and perforated at 1209'. RIH with packer and tubing and set packer cement. WOC 4 hours. POOH with packer.	CEMENT JOB OTHER:  Il pertinent details, and giple Completions: Attach unit and pluggingne. RIH with gau POOH with CIBP with CIBP and ri d set CIBP at 275 ss C Neat cement. POOH and rigged ed with 95 sacks vireline. RIH with trated at 536'. P at 255'. Squeeze RIH with open end cer at 255'. Squeed the best of my knowledg	ve pertinent dates, in wellbore diagram of gequipment. It ge ring to 277 to repair wire gged down wire O'. Circulate POOH. Rigge down wireline Class C Neat con wireline and OOH and rigged d with 125 saced tubing — diezed with 125 e and belief.	reluding estimated date for proposed completion Nippled down well 5'. POOH. RIH line. RIH line. Moved in d hole with d up wireline RIH with packe ement. WOC.  tagged cement at down wireline. ks Class C Neat d not tag. POOH sacks Class C T PAGE: _DATE8-12-02
OTHER:  12. Describe proposed or completed operations. (Clearly state all of starting any proposed work). SEE RULE 1103. For Multipor recompilation.  7-19-2002 - Moved in and rigged up pulling head and nippled up BOP. Rigged up wirelime with CIBP to 2750' - wireline shorted out. with CIBP to 2750' - would not fire. POOH 2-3/8" workstring. Shut well in for night 7-20-22-2002 - RIH with tubing and CIBP and plugging mud. Capped CIBP with 35' of Clar RIH with wireline and perforated at 1209'. and tubing and set packer at 894'. Squeez Shut well in for night.  7-23-2002 - POOH with packer. Rigged up with 1068'. POOH with wireline. RIH and perforated at 1209'. With tubing. RIH with packer and set packer cement. WOC 4 hours. POOH with packer. with tubing. RIH with packer and set packer.  I hereby certify that the information above is true and complete to 1000.	CEMENT JOB OTHER:  Il pertinent details, and giple Completions: Attach unit and pluggingne. RIH with gau POOH with CIBP with CIBP and ri d set CIBP at 275 ss C Neat cement. POOH and rigged ed with 95 sacks vireline. RIH with trated at 536'. P at 255'. Squeeze RIH with open end cer at 255'. Squeed the best of my knowledg	ve pertinent dates, in wellbore diagram of gequipment. It ge ring to 277 to repair wire gged down wire O'. Circulate POOH. Rigge down wireline Class C Neat con wireline and OOH and rigged d with 125 sace ded tubing — diezed with 125 e and belief.	reluding estimated date for proposed completion  Nippled down well 5'. POOH. RIH line. RIH line. Moved in  d hole with d up wireline RIH with packe ement. WOC.  tagged cement at down wireline. ks Class C Neat d not tag. POOH sacks Class C  T PAGE: DATE 8-12-02
OTHER:  12. Describe proposed or completed operations. (Clearly state al of starting any proposed work). SEE RULE 1103. For Multipor recompilation.  7-19-2002 - Moved in and rigged up pulling head and nippled up BOP. Rigged up wirelime with CIBP to 2750' - wireline shorted out. with CIBP to 2750' - would not fire. POOH 2-3/8" workstring. Shut well in for night 7-20-22-2002 - RIH with tubing and CIBP and plugging mud. Capped CIBP with 35' of Clar RIH with wireline and perforated at 1209'. and tubing and set packer at 894'. Squeez Shut well in for night.  7-23-2002 - POOH with packer. Rigged up with 1068'. POOH with wireline. RIH and perforated at 1209'. With tubing. RIH with packer and set packer cement. WOC 4 hours. POOH with packer. with tubing. RIH with packer and set packer.  I hereby certify that the information above is true and complete to the	CEMENT JOB OTHER:  Il pertinent details, and giple Completions: Attach unit and pluggingne. RIH with gau POOH with CIBP with CIBP and ri d set CIBP at 275 ss C Neat cement. POOH and rigged ed with 95 sacks vireline. RIH with rated at 536'. Pat 255'. Squeeze RIH with open end ger at 255'. Squeeze	ve pertinent dates, in wellbore diagram of gequipment. It ge ring to 277 to repair wire gged down wire POOH. Rigge down wireline Class C Neat con wireline and OOH and rigged downth 125 saced tubing — diezed with 125 e and belief.  NTINUED ON NEXTOR	ncluding estimated date for proposed completion  Nippled down well 5'. POOH. RIH line. RIH line. Moved in  d hole with d up wireline RIH with packe ement. WOC.  tagged cement at down wireline. ks Class C Neat d not tag. POOH sacks Class C  T PAGE: DATE 8-12-02  one No. 748-1471
OTHER:  12. Describe proposed or completed operations. (Clearly state all of starting any proposed work). SEE RULE 1103. For Multipor recompilation.  7-19-2002 - Moved in and rigged up pulling head and nippled up BOP. Rigged up wirelime with CIBP to 2750' - wireline shorted out. with CIBP to 2750' - would not fire. POOH 2-3/8" workstring. Shut well in for night 7-20-22-2002 - RIH with tubing and CIBP and plugging mud. Capped CIBP with 35' of Clar RIH with wireline and perforated at 1209'. and tubing and set packer at 894'. Squeez Shut well in for night.  7-23-2002 - POOH with packer. Rigged up with 1068'. POOH with wireline. RIH and perforated at 1209'. With tubing. RIH with packer and set packer cement. WOC 4 hours. POOH with packer. with tubing. RIH with packer and set packer.  I hereby certify that the information above is true and complete to 1000.	CEMENT JOB OTHER:  I pertinent details, and giple Completions: Attach unit and pluggingne. RIH with gau POOH with CIBP with CIBP and ri d set CIBP at 275 ss C Neat cement. POOH and rigged ded with 95 sacks vireline. RIH with rated at 536'. P at 255'. Squeeze RIH with open end cer at 255'. Squeeze RIH with open end cer at 255'. Squeeze REM with open end cer at 255'. Squeeze	ve pertinent dates, in wellbore diagram of gequipment. It ge ring to 277 to repair wire gged down wire POOH. Rigge down wireline Class C Neat con wireline and OOH and rigged downth 125 saced tubing — diezed with 125 e and belief.  NTINUED ON NEXTOR	ncluding estimated date for proposed completion  Nippled down well 5'. POOH. RIH line. RIH line. Moved in  d hole with d up wireline RIH with packe ement. WOC.  tagged cement at down wireline. ks Class C Neat d not tag. POOH sacks Class C  T PAGE: DATE 8-12-02  one No. 748-1471
OTHER:  12. Describe proposed or completed operations. (Clearly state al of starting any proposed work). SEE RULE 1103. For Multipor recompilation.  7-19-2002 - Moved in and rigged up pulling head and nippled up BOP. Rigged up wirelime with CIBP to 2750' - wireline shorted out. with CIBP to 2750' - would not fire. POOH 2-3/8" workstring. Shut well in for night 7-20-22-2002 - RIH with tubing and CIBP and plugging mud. Capped CIBP with 35' of Clar RIH with wireline and perforated at 1209'. and tubing and set packer at 894'. Squeez Shut well in for night.  7-23-2002 - POOH with packer. Rigged up with 1068'. POOH with wireline. RIH and perforated at 1209'. With tubing. RIH with packer and set packer cement. WOC 4 hours. POOH with packer. with tubing. RIH with packer and set packer.  I hereby certify that the information above is true and complete to the	CEMENT JOB OTHER:  Il pertinent details, and giple Completions: Attach unit and pluggingne. RIH with gau POOH with CIBP with CIBP and ri d set CIBP at 275 ss C Neat cement. POOH and rigged ed with 95 sacks vireline. RIH with rated at 536'. Pat 255'. Squeeze RIH with open end ser at 255'. Squeeze Compliance Officery Gerry Guye	ve pertinent dates, in wellbore diagram of gequipment. It ge ring to 277 to repair wire gged down wire POOH. Rigge down wireline Class C Neat con wireline and OOH and rigged downth 125 saced tubing — diezed with 125 e and belief.  NTINUED ON NEXTOR	reluding estimated date for proposed completion  Nippled down well 5'. POOH. RIH line. RIH line. Moved in  d hole with d up wireline RIH with packe ement. WOC.  tagged cement at down wireline. ks Class C Neat d not tag. POOH sacks Class C  T PAGE: DATE 8-12-02

YATES PETROLEUM CORPORATION Scheurich #3 Section 32-T17S-R30E Eddy County, New Mexico

## SUNDRY NOTICE CONTINUED:

Neat cement. WOC. Shut well in for night.

7-24-2002 - POOH with packer. RIH with open ended tubing and tagged cement at 446'. POOH with tubing. Rigged up wireline. RIH with wireline and perforated at 60'. POOH and rigged down wireline. Nippled down BOP and nippled down wellhead. Nippled up swedge. Squeezed with 50 sacks Class C Neat cement. WOC 4 hours. RIH with tubing - did not tag. POOH with tubing. Squeezed with 50 sacks Class C Neat cement. WOC. Shut well in for night.

7-25-2002 - RIH with tubing - did not tag. POOH with tubing. Circulated 40 sacks Class C Neat cement down 7" casing and up through 8-5/8" casing. Rigged down pulling unit and plugging equipment. Installed regulation abandonment marker. PLUGGED AND ABANDONED

Michille Taylor

- FINAL REPORT. Plugging completed 7-24-2002.

)4 (20°)