November 1983) Formerly 9-331) DEPARTMENT OF THE INTERIOR (Other Instructions of THE INTERIOR)	TON Expires August 31, 1985 5. LEASE DESIGNATION AND BERIAL NO. LC 028936-g
SUNDRY NOTICES AND REPORTS ON WELLS (The not like this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT—" for such proposals."	6. IF INDIAN, ALLOTTEE OR TRIBE NAME
WELL WELL OTHER PEA MILL RECEIVED BY	l L
Yates Petroleum Corporation V DEC 12 1985	8. FATM OR LEASE NAME Brigham
	9. WBL, NO.
O(C, C)	4
207 South 4th St., Artesia, NM 88210 4. LOCATION OF WELL (Report location clearly and in accordance with any State requirementARTESIA, OFFIC See also space 17 below.) At surface	Loco Hills-Q-G-SA
1320 FSL & 5 FEL, Sec. 31-17S-30E	11. SBC., T., B., M., OR BLK. AND SURVBY OB ARMA
	Unit I, Sec. 31-17S-30E
14. PERMIT NO. 15. ELEVATIONS (Show whether DF, RT, GR, etc.) 3567 KB	12. COUNTY OR PARISH 13. STATE Eddy NM
16. Check Appropriate Box To Indicate Nature of Notice, Report, or C	Other Data
NOTICE OF INTENTION TO:	UENT REPORT OF:
TEST WATER SHUT-OFF PULL OR ALTER CASING WATER SHUT-OFF FRACTURE TREAT SHOOT OR ACIDIZE REPAIR WELL CHANGE PLANS WATER SHUT-OFF FRACTURE TREATMENT SHOOTING OR ACIDIZING (Other) (NOTE: Report result)	ALTERING CASING ABANDONMENT® B of multiple completion on Well
17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates proposed work. If well is directionally drilled, give subsurface locations and measured and true vertice near to this work.)	pletion Report and Log form.) s. including estimated date of starting any cal depths for all markers and zones perti-
Propose to plug well as follows: 1. Spot sufficient cement across producing interval to tie back shoe. <u>Tag plug</u> .	50' into production casing
2. Isolate Queen formation from overlying zones with 100' cement $2335'$; top of cement is at $2189'$.	plug. Top of Queen is at
3. Perforate 50' below base of salt at 1193 ' and squeeze with plug in casing. Tag plug.	50 sx cement, leaving 100
 4. Perforate 50' above top of salt at 390' and squeeze with 50 plug in casing. Tag plug. 5. Set 30' surface plug and install regulation abandonment marke 	-
NOTE: 1) NOTIFY BLM, CARLSBAD, NM, (887-6544) 24 HOURS PRIOR TO	
2) Mud between plugs to be 10#/gallon mud-laden fluid.	
18. I befels certify that the foregoing is true and correct SIGNATULA DOS CHITT TITLE Production Supervisor	DATE 11-26-85
(This space for Federal or State office use) APPROVED BY	DATE 12.10 83