	•		\wedge	
Submit 3 Copies To Appropriate District	State of New M	exico		Form C-103
			1	Revised March 25, 1999
Office District I 1625 N. French Dr., Hobbs, NM 88240 District II 811 South First, Artesia, NM 88210 District III 1000 Rio Brazos Rd., Aztec, NM 8710	202122		WELL API NO.	
District II	ON CORPEDIATION	A DIMEION	30-015-0)4461
811 South First, Artesia, NM 88210 6	OL CONSERVATION	A DI AISION	5. Indicate Type of	Lease
District III	JUL 2012 South St. Fra	incis Dr.	STATE 🔼	FEE 🗆
District IV	ECEIVE Santa Fe, NM 8	7505	6. State Oil & Gas	
1220 S. St. Francis Dr., Santa Fe, NM	- APTER		B-41	
87505	S AND REPORTS ON WELL	<u> </u>		Init Agreement Name:
(DO NOT USE THIS FORM FOR PROPOSAL			7. Double Name of C	Ant A 16 contain 1 tame.
DIFFERENT RESERVOIR. USE "APPLICAT	TON FOR PERMIT" (FORM C-101) F	OR SUCH		
PROPOSALS.)		į		
1. Type of Well: Oil Well Gas Well	Other Plug & Abanc	ion	Scheurich	n B
2. Name of Operator	Ould 11dg a libane		8. Well No.	
Yates Petroleum Corporat	ion /		9	
3. Address of Operator	1011		9. Pool name or Wi	ldcat
105 South Fourth Street	- Artesia, NM 88210		Loco Hills	
4. Well Location				
			_	
Unit Letter L : 16	50 feet from the South	line and99	0feet from t	the West line
	- 11 170 B	205	ND(D) (Edd., (3
Section 32			NMPM Eddy (ounty
	0. Elevation (Show whether D 3575 GR	K, KKB, KI, GK, etc.)		
		eture of Motice D	enort or Other Do	nta .
	ropriate Box to Indicate N	ature of Notice, A	EQUENT REPO	NOT OF:
NOTICE OF INTE		REMEDIAL WORK		ALTERING CASING 🗆
PERFORM REMEDIAL WORK P	FOR AND ARANDON	REMEDIAL WORK		ELEVINO CYCINO C
TEMPORARILY ABANDON C	HANGE PLANS	COMMENCE DRILL	LING OPNS. 🔲 🛚 F	PLUG AND
				ABANDONMENT (A)
		ļ ·	A	ADMINDO INVIENT
	IULTIPLE	CASING TEST AND		ABANDONMENT
	IULTIPLE OMPLETION	CASING TEST AND CEMENT JOB		ADMINDONNEN I
C				
OTHER:	OMPLETION	CEMENT JOB OTHER:		
OTHER:	OMPLETION Decrations. (Clearly state all per	CEMENT JOB OTHER: tinent details, and giv	ve pertinent dates, inc	cluding estimated date
OTHER: 12. Describe proposed or completed of starting any proposed work). Si	OMPLETION Decrations. (Clearly state all per	CEMENT JOB OTHER: tinent details, and giv	ve pertinent dates, inc	cluding estimated date
OTHER: 12. Describe proposed or completed of starting any proposed work). Si or recompilation.	OMPLETION Operations. (Clearly state all per EE RULE 1103. For Multiple C	OTHER: rtinent details, and give Completions: Attach	ve pertinent dates, inc	cluding estimated date proposed completion
OTHER: 12. Describe proposed or completed of starting any proposed work). Sign or recompilation. 7-16-2002 - Moved in and	OMPLETION Operations. (Clearly state all per EE RULE 1103. For Multiple (CEMENT JOB OTHER: tinent details, and giv Completions: Attach v it and plugging	ve pertinent dates, incovered diagram of great and the second sec	cluding estimated date proposed completion
OTHER: 12. Describe proposed or completed of starting any proposed work). Stor recompilation. 7-16-2002 - Moved in and equipment. POOH with roment. Shut well in for	operations. (Clearly state all per EE RULE 1103. For Multiple Coll rigged up pulling un ods and pump. Rigged night.	CEMENT JOB OTHER: tinent details, and give Completions: Attach with and plugging down rod equipments.	ve pertinent dates, incovered wellbore diagram of great equipment. Research Rigged up	cluding estimated date proposed completion igged up rod p tubing equip-
OTHER: 12. Describe proposed or completed of starting any proposed work). Stor recompilation. 7-16-2002 - Moved in and equipment. POOH with roment. Shut well in for 7-17-2002 - Nippled down	operations. (Clearly state all per EE RULE 1103. For Multiple Coll rigged up pulling un ods and pump. Rigged night.	CEMENT JOB OTHER: tinent details, and give Completions: Attach with and plugging down rod equipm up BOP. POOH	ve pertinent dates, incovered wellbore diagram of grequipment. Rigged upwith 2-7/8" tu	cluding estimated date proposed completion igged up rod p tubing equip- bing. RIH with
OTHER: 12. Describe proposed or completed of starting any proposed work). Stor recompilation. 7-16-2002 - Moved in and equipment. POOH with roment. Shut well in for 7-17-2002 - Nippled down tubing and tagged CIBP as	ompletion perations. (Clearly state all per EE RULE 1103. For Multiple Coloring un eds and pump. Rigged night. wellhead and nippled at 2800'. Circulated	CEMENT JOB OTHER: tinent details, and give Completions: Attach with and plugging down rod equipm up BOP. POOH hole with plugg	ve pertinent dates, incomellbore diagram of grequipment. Rigged upon with 2-7/8" turning mud. Cappo	cluding estimated date proposed completion ligged up rod p tubing equip- bing. RIH with ed CIBP with
OTHER: 12. Describe proposed or completed of starting any proposed work). Stor recompilation. 7-16-2002 - Moved in and equipment. POOH with roment. Shut well in for 7-17-2002 - Nippled down tubing and tagged CIBP at 35' of Class C Neat ceme	OMPLETION Operations. (Clearly state all per EE RULE 1103. For Multiple Colored and pump. Rigged night. Wellhead and nippled at 2800'. Circulated ent. POOH. Rigged up	CEMENT JOB OTHER: tinent details, and give Completions: Attach with and plugging down rod equipm up BOP. POOH hole with plugg wireline. RIH	ve pertinent dates, incomellbore diagram of great and a real with 2-7/8" turning mud. Cappell with CIBP and	cluding estimated date proposed completion ligged up rod p tubing equip- bing. RIH with ed CIBP with set CIBP at
OTHER: 12. Describe proposed or completed of starting any proposed work). Stor recompilation. 7-16-2002 - Moved in and equipment. POOH with roment. Shut well in for 7-17-2002 - Nippled down tubing and tagged CIBP at 35' of Class C Neat cemes 2555'. POOH. RIH and continued to the continued of the continued to	operations. (Clearly state all per EE RULE 1103. For Multiple Color of the color of	CEMENT JOB OTHER: tinent details, and give Completions: Attach with and plugging down rod equipm up BOP. POOH hole with plugg wireline. RIH of Class C Neat	ve pertinent dates, incomellbore diagram of gequipment. Rigged upon with 2-7/8" turning mud. Cappel with CIBP and cement. POOH.	cluding estimated date proposed completion igged up rod p tubing equip- bing. RIH with ed CIBP with set CIBP at RIH and perf-
OTHER: 12. Describe proposed or completed of starting any proposed work). Stor recompilation. 7-16-2002 - Moved in and equipment. POOH with roment. Shut well in for 7-17-2002 - Nippled down tubing and tagged CIBP at 35' of Class C Neat cemes 2555'. POOH. RIH and corated casing at 1222'.	operations. (Clearly state all per EE RULE 1103. For Multiple Control of and pump. Rigged night. In wellhead and nippled at 2800'. Circulated ent. POOH. Rigged up eapped CIBP with 35' or POOH and rigged down	CEMENT JOB OTHER: tinent details, and give completions: Attach with and plugging down rod equipm up BOP. POOH hole with plugg wireline. RIH of Class C Neat wireline. RIH	ve pertinent dates, incomellbore diagram of great and gr	cluding estimated date proposed completion igged up rod p tubing equip- bing. RIH with ed CIBP with set CIBP at RIH and perf- nd tubing and
OTHER: 12. Describe proposed or completed of starting any proposed work). Stor recompilation. 7-16-2002 - Moved in and equipment. POOH with roment. Shut well in for 7-17-2002 - Nippled down tubing and tagged CIBP at 35' of Class C Neat cemes 2555'. POOH. RIH and corated casing at 1222'. set packer at 918'. Squ	operations. (Clearly state all per EE RULE 1103. For Multiple Coloring and pump. Rigged night. In wellhead and nippled at 2800'. Circulated ent. POOH. Rigged up apped CIBP with 35' or POOH and rigged down neezed with 50 sacks C	CEMENT JOB OTHER: tinent details, and give completions: Attach with and plugging down rod equipm up BOP. POOH hole with plugg wireline. RIH Class C Neat wireline. RIH lass C Neat cem	ve pertinent dates, incomelbore diagram of gequipment. Rigged upon with 2-7/8" turning mud. Cappel with CIBP and cement. POOH. I with packer at the control of the control	cluding estimated date proposed completion igged up rod p tubing equip- bing. RIH with ed CIBP with set CIBP at RIH and perf- nd tubing and ut in for night.
OTHER: 12. Describe proposed or completed of starting any proposed work). Stor recompilation. 7-16-2002 - Moved in and equipment. POOH with roment. Shut well in for 7-17-2002 - Nippled down tubing and tagged CIBP a 35' of Class C Neat ceme 2555'. POOH. RIH and corated casing at 1222'. set packer at 918'. Squ 7-18-2002 - Rigged up with the second control of the second case of the second ca	operations. (Clearly state all per EE RULE 1103. For Multiple Coloring and pump. Rigged night. I wellhead and nippled at 2800'. Circulated ent. POOH. Rigged up apped CIBP with 35' o POOH and rigged down neezed with 50 sacks Careline. RIH and tagg	CEMENT JOB OTHER: tinent details, and give completions: Attach with and plugging down rod equipm up BOP. POOH hole with plugg wireline. RIH of Class C Neat wireline. RIH lass C Neat cemed cement at 10	ve pertinent dates, incovellbore diagram of gequipment. Rigged upon with 2-7/8" turning mud. Cappel with CIBP and cement. POOH. I with packer among the composition of the composition o	cluding estimated date proposed completion igged up rod p tubing equip- bing. RIH with ed CIBP with set CIBP at RIH and perf- nd tubing and ut in for night. rigged down
OTHER: 12. Describe proposed or completed of starting any proposed work). Stor recompilation. 7-16-2002 - Moved in and equipment. P00H with rement. Shut well in for 7-17-2002 - Nippled down tubing and tagged CIBP a 35' of Class C Neat ceme 2555'. P00H. RIH and corated casing at 1222'. set packer at 918'. Squ 7-18-2002 - Rigged up will wireline. P00H with pace	operations. (Clearly state all per EE RULE 1103. For Multiple Control of the state and pump. Rigged night. I wellhead and nippled at 2800'. Circulated ent. POOH. Rigged up eapped CIBP with 35' or POOH and rigged down neezed with 50 sacks Careline. RIH and taggeter. Rigged up wirel	CEMENT JOB OTHER: tinent details, and give completions: Attach with and plugging down rod equipm up BOP. POOH hole with plugg wireline. RIH f Class C Neat wireline. RIH lass C Neat cemed cement at 10 ine. RIH and p	ve pertinent dates, incomelbore diagram of sequipment. Rigged upon with 2-7/8" turning mud. Cappal with CIBP and cement. POOH. I with packer and the composition of t	cluding estimated date proposed completion ligged up rod p tubing equip- bing. RIH with ed CIBP with set CIBP at RIH and perf- nd tubing and ut in for night. rigged down 13'. POOH and
OTHER: 12. Describe proposed or completed of starting any proposed work). Since of recompilation. 7-16-2002 - Moved in and equipment. P00H with rement. Shut well in for 7-17-2002 - Nippled down tubing and tagged CIBP at 35' of Class C Neat cemes 2555'. P00H. RIH and corated casing at 1222'. set packer at 918'. Squit 7-18-2002 - Rigged up with wireline. P00H with packer at 90H with packer	operations. (Clearly state all per EE RULE 1103. For Multiple Coloring and pump. Rigged night. I wellhead and nippled at 2800'. Circulated ent. POOH. Rigged up eapped CIBP with 35' o POOH and rigged down neezed with 50 sacks Circline. RIH and tagged with packer and tu	CEMENT JOB OTHER: tinent details, and give completions: Attach with and plugging down rod equipmed up BOP. POOH hole with plugg wireline. RIH f Class C Neat wireline. RIH lass C Neat cemed cement at 10 ine. RIH and phing. Squeezed	ve pertinent dates, incomelbore diagram of sequipment. Rigged us with 2-7/8" turning mud. Cappel with CIBP and cement. POOH. I with packer as lent. WOC. Shows 178'. POOH and perforated at 5 l with 100 sack	cluding estimated date proposed completion ligged up rod p tubing equip- bing. RIH with ed CIBP with set CIBP at RIH and perf- nd tubing and ut in for night. rigged down 13'. POOH and s Class C Neat
OTHER: 12. Describe proposed or completed of starting any proposed work). Since of recompilation. 7-16-2002 - Moved in and equipment. POOH with rement. Shut well in for 7-17-2002 - Nippled down tubing and tagged CIBP at 35' of Class C Neat cemes 2555'. POOH. RIH and corated casing at 1222'. set packer at 918'. Squit reline. PooH with packer at 918'. Squit regret down wireline. For rigged down wireline. For rigged down wireline. For rigged down wireline. For rigged down rigged down rigged down.	operations. (Clearly state all per EE RULE 1103. For Multiple Control of the Rule 1103. For Mult	CEMENT JOB OTHER: tinent details, and give completions: Attach with and plugging down rod equipm up BOP. POOH hole with plugg wireline. RIH f Class C Neat wireline. RIH lass C Neat cemed cement at 10 ine. RIH and pbing. Squeezed IH and tagged ced 30 sacks CI	we pertinent dates, incomelbore diagram of grequipment. Rigged upon with 2-7/8" turning mud. Cappel with CIBP and cement. POOH. I with packer and the packer at 38'. Lass C Neat cement at 387'.	cluding estimated date proposed completion igged up rod p tubing equip- bing. RIH with ed CIBP with set CIBP at RIH and perf- nd tubing and ut in for night. rigged down 13'. POOH and s Class C Neat Perforated at ent down 5-1/2"
OTHER: 12. Describe proposed or completed of starting any proposed work). Stor recompilation. 7-16-2002 - Moved in and equipment. POOH with roment. Shut well in for 7-17-2002 - Nippled down tubing and tagged CIBP at 35' of Class C Neat cemes 2555'. POOH. RIH and corated casing at 1222'. set packer at 918'. Squ 7-18-2002 - Rigged up with wireline. POOH with packer of the packer of the pooh with packer of the packer	operations. (Clearly state all per EE RULE 1103. For Multiple Control of the Rule 1103. For Mult	CEMENT JOB OTHER: tinent details, and give completions: Attach with and plugging down rod equipm up BOP. POOH hole with plugg wireline. RIH f Class C Neat wireline. RIH lass C Neat cement at 10 ine. RIH and pbing. Squeezed IH and tagged coted 30 sacks Clawn pulling unit	we pertinent dates, incomelbore diagram of gequipment. Rigged with 2-7/8" turning mud. Cappel with CIBP and cement. POOH. I with packer and the perforated at 5 with 100 sack tement at 387'. ass C Neat cement. Installed r	cluding estimated date proposed completion igged up rod p tubing equip- bing. RIH with ed CIBP with set CIBP at RIH and perf- nd tubing and ut in for night. rigged down 13'. POOH and s Class C Neat Perforated at ent down 5-1/2"
OTHER: 12. Describe proposed or completed of starting any proposed work). Stor recompilation. 7-16-2002 - Moved in and equipment. POOH with rement. Shut well in for 7-17-2002 - Nippled down tubing and tagged CIBP a 35' of Class C Neat ceme 2555'. POOH. RIH and corated casing at 1222'. set packer at 918'. Squ 7-18-2002 - Rigged up wi wireline. POOH with pace rigged down wireline. Fooh with pace rigged down wireline. Fooh and rigged down wireline. Fooh and rigged down wireline. It cement. WOC 4 hours. Fool and rigged down wireline. Fooh and rigged down wireline. Thereby certify that the information about the starting with the proposed work).	operations. (Clearly state all per EE RULE 1103. For Multiple Coloring and pump. Rigged night. I wellhead and nippled at 2800'. Circulated ent. POOH. Rigged up apped CIBP with 35' o POOH and rigged down neezed with 50 sacks Careline. RIH and tagged with with packer and turn Rigged up wirel RIH with packer and turn Rigged up wireline. Rown wireline. Circula (8" casing. Rigged do ove is true and complete to the lower strue and complete to the lower structure.	CEMENT JOB OTHER: tinent details, and give completions: Attach with and plugging down rod equipm up BOP. POOH hole with plugg wireline. RIH f Class C Neat wireline. RIH lass C Neat cemed cement at 10 ine. RIH and pbing. Squeezed IH and tagged coted 30 sacks Clawn pulling unit pest of my knowledge	ve pertinent dates, incomelbore diagram of gequipment. Rigged upon with 2-7/8" turning mud. Cappel with CIBP and cement. POOH. I with packer and with packer and the complete of the complete	cluding estimated date proposed completion igged up rod p tubing equip- bing. RIH with ed CIBP with set CIBP at RIH and perf- nd tubing and ut in for night. rigged down 13'. POOH and s Class C Neat Perforated at ent down 5-1/2" egulation abandon-
OTHER: 12. Describe proposed or completed of starting any proposed work). Since of recompilation. 7-16-2002 - Moved in and equipment. P00H with resemble to the proposed work of the proposed work. Show the proposed work is a set of the proposed work of the proposed work. Show the proposed work with the proposed work with the proposed work of the proposed work. Show the proposed work with the proposed work with the proposed work. Show the proposed work with the proposed work with the proposed work. Show the proposed work with the proposed work with the proposed work. Show the proposed work with the proposed work. Show the proposed work with the proposed work. Show the proposed work the proposed work. Show the proposed work the propose	operations. (Clearly state all per EE RULE 1103. For Multiple Coloring and pump. Rigged night. I vigged up pulling un ods and pump. Rigged night. I wellhead and nippled at 2800'. Circulated and Pooh. Rigged up eapped CIBP with 35' of POOH and rigged down neezed with 50 sacks Circline. RIH and tagged with the ligged up wirelaster. Rigged up wireline. Rown wireline. Circulaster with a ligged up wireline. Rigged down is true and complete to the NaBANDONED - FINAL REP	CEMENT JOB OTHER: tinent details, and give completions: Attach with and plugging down rod equipmed up BOP. POOH hole with plugg wireline. RIH f Class C Neat wireline. RIH lass C Neat cemed cement at 10 ine. RIH and phing. Squeezed IH and tagged county to the compuling unit pest of my knowledge ORT. Plugging	ve pertinent dates, incomelbore diagram of sequipment. Rigged upon with 2-7/8" turning mud. Cappel with CIBP and cement. POOH. I with packer and ent. WOC. Shows and the sement at 387'. Lass C Neat cement. Installed remains and belief.	cluding estimated date proposed completion ligged up rod p tubing equip- bing. RIH with ed CIBP with set CIBP at RIH and perf- nd tubing and ut in for night. rigged down 13'. POOH and s Class C Neat Perforated at ent down 5-1/2" egulation abandon-2002.
OTHER: 12. Describe proposed or completed of starting any proposed work). Since of recompilation. 7-16-2002 - Moved in and equipment. P00H with resemble the ment. Shut well in for 7-17-2002 - Nippled down tubing and tagged CIBP at 35' of Class C Neat cemes 2555'. P00H. RIH and corated casing at 1222'. set packer at 918'. Square 7-18-2002 - Rigged up with wireline. P00H with pacting down wireline. For each of the work of the pool of	operations. (Clearly state all per EE RULE 1103. For Multiple Control of the Rule 1103. For Mult	CEMENT JOB OTHER: tinent details, and give completions: Attach with and plugging down rod equipmed up BOP. POOH hole with plugg wireline. RIH f Class C Neat wireline. RIH lass C Neat cemed cement at 10 ine. RIH and phing. Squeezed IH and tagged county to the compuling unit pest of my knowledge ORT. Plugging	ve pertinent dates, incomelbore diagram of sequipment. Rigged upon with 2-7/8" turning mud. Cappel with CIBP and cement. POOH. I with packer and ent. WOC. Shows and the sement at 387'. Lass C Neat cement. Installed remains and belief.	cluding estimated date proposed completion igged up rod p tubing equip- bing. RIH with ed CIBP with set CIBP at RIH and perf- nd tubing and ut in for night. rigged down 13'. POOH and s Class C Neat Perforated at ent down 5-1/2" egulation abandon-
OTHER: 12. Describe proposed or completed of starting any proposed work). Si or recompilation. 7-16-2002 - Moved in and equipment. POOH with roment. Shut well in for 7-17-2002 - Nippled down tubing and tagged CIBP a 35' of Class C Neat ceme 2555'. POOH. RIH and corated casing at 1222'. set packer at 918'. Squ 7-18-2002 - Rigged up wireline. POOH with packer in the pool of t	operations. (Clearly state all per EE RULE 1103. For Multiple Coloring and pump. Rigged night. I vigged up pulling un ods and pump. Rigged night. I wellhead and nippled at 2800'. Circulated and Pooh. Rigged up eapped CIBP with 35' of POOH and rigged down neezed with 50 sacks Circline. RIH and tagged with the ligged up wirelaster. Rigged up wireline. Rown wireline. Circulaster with a ligged up wireline. Rigged down is true and complete to the NaBANDONED - FINAL REP	CEMENT JOB OTHER: tinent details, and give completions: Attach with and plugging down rod equipmed up BOP. POOH hole with plugg wireline. RIH f Class C Neat wireline. RIH lass C Neat cemed cement at 10 ine. RIH and phing. Squeezed IH and tagged county to the compuling unit pest of my knowledge ORT. Plugging	wellbore diagram of equipment. Rigged with 2-7/8" turning mud. Capper with CIBP and cement. WOC. Ships POOH and perforated at 5 with 100 sack ement at 387'. ass C Neat cement. Installed reand belief.	cluding estimated date proposed completion igged up rod p tubing equip- bing. RIH with ed CIBP with set CIBP at RIH and perf- nd tubing and ut in for night. rigged down 13'. POOH and s Class C Neat Perforated at ent down 5-1/2" egulation abandon- -2002. DATE July 22, 2002
OTHER: 12. Describe proposed or completed of starting any proposed work). Si or recompilation. 7-16-2002 - Moved in and equipment. P00H with roment. Shut well in for 7-17-2002 - Nippled down tubing and tagged CIBP a 35' of Class C Neat ceme 2555'. P00H. RIH and corated casing at 1222'. set packer at 918'. Squ 7-18-2002 - Rigged up wi wireline. P00H with packer at 918'. Squ 7-18-2004 - Rigged down wireline. Footh and rigged down wireline.	operations. (Clearly state all per EE RULE 1103. For Multiple Coloring and pump. Rigged night. I vigged up pulling un ods and pump. Rigged night. I wellhead and nippled at 2800'. Circulated and Pooh. Rigged up eapped CIBP with 35' of POOH and rigged down neezed with 50 sacks Circline. RIH and tagged with the ligged up wirelaster. Rigged up wireline. Rown wireline. Circulaster with a ligged up wireline. Rigged down is true and complete to the NaBANDONED - FINAL REP	CEMENT JOB OTHER: tinent details, and give completions: Attach with and plugging down rod equipmed up BOP. POOH hole with plugg wireline. RIH f Class C Neat wireline. RIH lass C Neat cemed cement at 10 ine. RIH and phing. Squeezed IH and tagged county to the compuling unit pest of my knowledge ORT. Plugging	wellbore diagram of equipment. Rigged with 2-7/8" turning mud. Capper with CIBP and cement. WOC. Ships POOH and perforated at 5 with 100 sack ement at 387'. ass C Neat cement. Installed reand belief.	cluding estimated date proposed completion ligged up rod p tubing equip- bing. RIH with ed CIBP with set CIBP at RIH and perf- nd tubing and ut in for night. rigged down 13'. POOH and s Class C Neat Perforated at ent down 5-1/2" egulation abandon-2002.
OTHER: 12. Describe proposed or completed of starting any proposed work). Si or recompilation. 7-16-2002 - Moved in and equipment. P00H with rement. Shut well in for 7-17-2002 - Nippled down tubing and tagged CIBP a 35' of Class C Neat ceme 2555'. P00H. RIH and corated casing at 1222'. set packer at 918'. Squ 7-18-2002 - Rigged up wireline. P00H with pace rigged down wireline. For cement. WOC 4 hours. For comment. WOC 4 hours. For casing & up through 8-5/ I hereby certify that the information about ment marker. PLUCGED & SIGNATURE Type or print name Rusty Klein (This space for State use)	operations. (Clearly state all per EE RULE 1103. For Multiple Coloring and pump. Rigged night. I vigged up pulling un ods and pump. Rigged night. I wellhead and nippled at 2800'. Circulated and Pooh. Rigged up eapped CIBP with 35' of POOH and rigged down neezed with 50 sacks Circline. RIH and tagged with the ligged up wirelaster. Rigged up wireline. Rown wireline. Circulaster with a ligged up wireline. Rigged down is true and complete to the NaBANDONED - FINAL REP	CEMENT JOB OTHER: tinent details, and give completions: Attach with and plugging down rod equipmed up BOP. POOH hole with plugg wireline. RIH f Class C Neat wireline. RIH lass C Neat cemed cement at 10 ine. RIH and phing. Squeezed IH and tagged county to the compuling unit pest of my knowledge ORT. Plugging	we pertinent dates, incomelbore diagram of gequipment. Rigged upon with 2-7/8" turning mud. Cappel with CIBP and cement. POOH. I with packer and with packer and belief. Telephore and belief.	cluding estimated date proposed completion igged up rod p tubing equip- bing. RIH with ed CIBP with set CIBP at RIH and perf- nd tubing and ut in for night. rigged down 13'. POOH and s Class C Neat Perforated at ent down 5-1/2" egulation abandon- -2002. DATE July 22, 2002 ne No. 746-6565
OTHER: 12. Describe proposed or completed of starting any proposed work). Si or recompilation. 7-16-2002 - Moved in and equipment. P00H with roment. Shut well in for 7-17-2002 - Nippled down tubing and tagged CIBP a 35' of Class C Neat ceme 2555'. P00H. RIH and corated casing at 1222'. set packer at 918'. Squ 7-18-2002 - Rigged up wireline. P00H with pace rigged down wireline. For ement. WOC 4 hours. For emen	operations. (Clearly state all per EE RULE 1103. For Multiple Control of the Rule 1103. Final Rul	CEMENT JOB OTHER: tinent details, and give Completions: Attach with and plugging down rod equipm up BOP. POOH hole with plugg wireline. RIH f Class C Neat wireline. RIH lass C Neat cemed cement at 10 ine. RIH and pbing. Squeezed IH and tagged of the 30 sacks Clay pulling unit pest of my knowledge ORT. Plugging gent for BCM & Gerry Guye	we pertinent dates, incomelbore diagram of gequipment. Rigged upon with 2-7/8" turning mud. Cappel with CIBP and cement. POOH. I with packer and with packer and belief. Telephore and belief.	cluding estimated date proposed completion igged up rod p tubing equip- bing. RIH with ed CIBP with set CIBP at RIH and perf- nd tubing and ut in for night. rigged down 13'. POOH and s Class C Neat Perforated at ent down 5-1/2" egulation abandon- -2002. DATE July 22, 2002 ne No. 746-6565
OTHER: 12. Describe proposed or completed of starting any proposed work). Si or recompilation. 7-16-2002 - Moved in and equipment. P00H with rement. Shut well in for 7-17-2002 - Nippled down tubing and tagged CIBP a 35' of Class C Neat ceme 2555'. P00H. RIH and corated casing at 1222'. set packer at 918'. Squ 7-18-2002 - Rigged up wireline. P00H with pace rigged down wireline. For cement. WOC 4 hours. For comment. WOC 4 hours. For casing & up through 8-5/ I hereby certify that the information about ment marker. PLUCGED & SIGNATURE Type or print name Rusty Klein (This space for State use)	operations. (Clearly state all per EE RULE 1103. For Multiple Coloring and pump. Rigged night. I vigged up pulling un ods and pump. Rigged night. I wellhead and nippled at 2800'. Circulated and Pooh. Rigged up eapped CIBP with 35' of POOH and rigged down neezed with 50 sacks Circline. RIH and tagged with the ligged up wirelaster. Rigged up wireline. Rown wireline. Circulaster with a ligged up wireline. Rigged down is true and complete to the NaBANDONED - FINAL REP	CEMENT JOB OTHER: tinent details, and give Completions: Attach with and plugging down rod equipmed up BOP. POOH hole with plugg wireline. RIH f Class C Neat wireline. RIH lass C Neat cemed cement at 10 ine. RIH and phing. Squeezed IH and tagged of ted 30 sacks Clay many knowledge ORT. Plugging gent for BCM &	we pertinent dates, incomelbore diagram of gequipment. Rigged upon with 2-7/8" turning mud. Cappel with CIBP and cement. POOH. I with packer and with packer and belief. Telephore and belief.	cluding estimated date proposed completion igged up rod p tubing equip- bing. RIH with ed CIBP with set CIBP at RIH and perf- nd tubing and ut in for night. rigged down 13'. POOH and s Class C Neat Perforated at ent down 5-1/2" egulation abandon- -2002. DATE July 22, 2002