

Green A Fed #3
1980' FSL & 660' FEL, Sec. 29-T17S-R29E
Eddy County, New Mexico

Procedure to Test Well for Casing Integrity

1. Contact BLM in Carlsbad at 505-887-6544 48 hours before beginning procedure.
2. MI RU WL. Run guage ring to 7150'. Run CIBP and set at 7140'
3. Load hole with 2% KCL water with inhibitor.
4. Dump bail 2 sx cement on top of CIBP.
5. Pressure test casing to 500 psi for 30 minutes utilizing a chart. Maximum pressure bleed off is 10%. Send chart to Midland office.
6. Leave well SI in temporary abandoned status.

Note: By running CIBP and capping with cement this will prepare well for any future possible recompletion in Grayburg-Jackson interval.


Doug Keathley
Northern Regional Engineer