

Well #9  
Eddy, N.M.

09/15/90: Drlg. cement retainer 7273-7278'.  
09/17/90: GIH w/4-5/8" bit drlg cement 7278-7557;.  
09/18/90: GIH w/cement retainer and set 7300'. RU Howco and pressure  
backside to 750# and establish injection rate 2300 psi. Could not  
pump into formation. POOH and GIH w/bit and start drlg on cement  
retainer.  
09/19/90: Drlg cement retainer 7300-7301 cement retainer fell loose. Drlg &  
push down hole to 10645'. Drlg cement to 10685'.  
09/20/90: Drlg on CIBP 10685. Drlg and push CIBP to 10834'.  
09/23/90: Perf 5-1/2" csg 10678-10686' 8' 48 holes. 10709'-10722' 18' 108  
holes.  
09/28/90: Drop from report until further evaluation.