

10. RU selected service company. Establish injection into perfs with 2% KCL water. Acidize zone with 5000 gals 20% NEFE acid dropping 80 1.2 sp grav ball sealers spaced evenly throughout job. Flush to bottom perf with 2% KCL water.
11. Swab well and evaluate for production equipment.
12. Unset packer and TOH. Shut well in and either TA according to BLM standards or wait on production equipment.

  
R. D. Keathley

