

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-101
Revised 1-1-88

DISTRICT I
P.O. Box 1986, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87501-2088

RECEIVED

APR 16 1993

WELL API NO.

30-015-25077

5. Indicate Type of Lease

STATE ☒

FEE ☐

6. State Oil & Gas Lease No.

E-742

7. Lease Name or Unit Agreement Name

New Mexico "E0" State Com

8. Well No.

1

9. Pool name or Wildcat

South Empire Morrow Gas

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

OIL
WELL ☐

GAS
WELL ☒

OTHER

2. Name of Operator

Mewbourne Oil Company

3. Address of Operator

P.O. Box 5270 Hobbs, New Mexico 88241

4. Well Location

Unit Letter E : 1980 Feet From The North Line and 660 Feet From The West Line

Section 20 Township 17S Range 29E NMPM Eddy County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

3637.60' G.R.

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Set 5-1/2" CIBP @ 8740'. Cap w/35 sx. cement.
2. Tagged cement @ 8519'. Spotted 2 sx. cement.
3. Set 25 sx. plug @ 8100'
4. Set 25 sx. plug @ 7245'.
5. Set 25 sx. plug @ 5975'.
6. Set 25 sx. plug @ 5325'.
7. Set 25 sx. plug @ 3845'.
8. Set 25 sx. plug @ 3050'.
9. Tagged plug @ 2900'.
10. Set 25 sx. plug @ 1712'.
11. Cut casing off 1300'. Lay down casing.
12. Set 35 sx. plug @ 1346'.
13. Tag plug @ 1248'.
14. Set 35 sx. plug @ 500'.

15. Cut off casing head.
16. Spot 10 sx. surface plug.
17. Install P & A marker & clean location.

Post ID-2
4-30-93
PXA

*Note: Plugged as per MNOCD field representative.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Erick W. Nelson TITLE Engineer DATE April 8, 1993

TYPE OR PRINT NAME Erick W. Nelson

TELEPHONE NO.

(This space for State Use)

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

Page 2 of 2

Page 2 of 2