State of New Mexico Energy, Minerals and Natural Resource: Department

Revised 1-1-89

DISTRICT!
P.O. Box 1980, Hobba NM 88240

OIL CONSERVATION DIVISION P.O. Box 2088

WELL API NO. 30-015-25077

DISTRICT II	Santa Fe. New Mexico	87504-2088		
P.O. Drawer DD, Artesia, NM 88210		MECEIVED	5. Indicate Type of Lease STATE X FEE	
DISTRICT III 1000 Rio Brazos Rd., Azzec, NM 87410		APR 1 6 1993	6. State Oil & Gas Lease No. E-742	
CUNDRY NOTICES	AND REPORTS ON WEL	15 🗪		
(DO NOT USE THIS FORM FOR PROPOSAI DIFFERENT RESERVOIR.	LISTO DRILL OR TO DEEPEN USE "APPLICATION FOR PER OR SUCH PROPOSALS.)	OB DITTS BACK TO A	7. Lease Name or Unit Agreement Name	
1. Type of Well:	· · · · · · · · · · · · · · · · · · ·		New Mexico "EO" State Com	
MEIT MEIT X	OTHER		0 77.11.77	
2. Name of Operator			8. Well No.	
Mewbourne Oil Company 3. Address of Operator			9. Pool name or Wildcat	
P.O. Box 5270 Hobbs, New	Mexico 88241		South Empire Morrow Gas	
4. Well Location			·	
Unit Letter E :1980 Fe	et From The North	Line and660	Feet From The West Line	
Section 20 To	ownship 17S Ra	unge 29E	NMPM Eddy County	
Section 20 To	10. Elevation (Show whether		VIIIIIIIIIIIIIII	
	3637.60'	G.R.	<u> </u>	
11. Check Appro	opriate Box to Indicate	Nature of Notice, R	leport, or Other Data	
NOTICE OF INTENT	-		SSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WORK	ALTERING CASING	
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRILLIN	G OPNS. PLUG AND ABANDONMENT	
PULL OR ALTER CASING		CASING TEST AND C	EMENT JOB	
OTHER:		OTHER:		
12. Describe Proposed or Completed Operations (C	learly state all pertinent details, a	nd give pertinent dates, incli	iding estimated date of starting any proposed	
work) SEE RULE 1103.				
1. Set 5-1/2" CDBP @ 8740	'. Cap w/35 sx. ce	ement. 15.	Cut off casing head.	
2. Tagged cement @ 8519'.	Spotted 2 sx. cer	nent. 16.	Spot 10 sx. surrace plug.	
3. Set 25 sx. plug @ 8100' 4. Set 25 sx. plug @ 7245'. 17. Install P & A marker & clean location.				
4. Set 25 sx. plug @ 7245 5. Set 25 sx. plug @ 5975	1		ioca cron:	
6. Set 25 sx. plug @ 5325				
7. Set 25 sx. plug @ 3845	1.			
8. Set 25 sx. plug @ 3050	· ·			
9. Tagged plug @ 2900'.				
10. Set 25 sx. plug @ 1712	•	*Not	e: Plugged as per MNOCD field	
11. Cut casing off 1300'.	Lay down casing.		representative.	
12. Set 35 sx. plug @ 1346			, 	
13. Tag plug @ 1248'.				
14. Set 35 sx. plug @ 500'	·			
I hereby certify that the information above is true and co	mplete to the best of my knowledge and	_	4 13 0 3000	
SIGNATURE 4	byl m	næ <u>Engineer</u>	April 8, 1993	
TYPEOR PRINT NAME Erick W. Nel	son		TELEPHONE NO.	
(This space for State Use)	* *			

Field Rep I

with 177	
	1