GRAYBURG #10 CONTINUED

- MIRU HES CTU, N2, PMP TRK & GUARDIAN, OPEN UP W/720#, BLD OFF, GIH W/1-1/2" CT, CO SAND F/+/-8537' +/-04/22/99 10747', COULDN'T GET PST 10747', COOH, RIG CT DWN OFF WH, RIG GUARDIAN UP T/FLOWBK, OPEN UP T/PIT, FLOW BK FOAM & WTR.
- RU 1.9" DH MTR W/1.94" BIT ON CT, RU ON WH, GIH W/TLS & CT, TAG @ +/-10650', WASH & DRL COULDN'T MK 04/23/99 HOLE, COOH W/CT & TLS, RD CT F/WH, MIRU JSI, GIH W/1-1/4" SAMPLE BAILER TAG @ +/-10653', COOH. NO
- RU HYDROBLAST JET ON CT. RU IN WH, GIH W/CT, TG @ +/-10737', JET WASH TRY T/CO, COULDN'T MK HOLE, 04/24/99
- COOH, RDMO CUT, MIRU JIS, GIH W/1-1/4" TLS, TAG @ +/-10653', COOH, TK OFF BAILER, PUT ON IMPRESN BLK & GIH, TAG BLK, COOH, RDMO JSI.
- 04/25/99 SD
- MIRU JSI, TRIP GUAGE RING, GIH & SET COLLAR STOP & PLUG @ +/-10403', MIRU ROT WL, GIH SHOOT 4 HOLES IN 04/26/99 TBG @ +/-10400', RDMO ROTARY, RU SWAB, SWAB DWN TBG & BKSIDE.
- RU SWAB, MK 5 RUNS, SWAB HUNG UP JAR ON SWAB, PART SANDLINE, COOH W/REMAIN LINE, LEAVE SWAB & EST 04/27/99 400' LINE IN HOLE, UNFLANGE WH & NU BOP, MIRU HES SNUB UNIT, TRY T/REL PKR, COULDN'T.
- MIRU ROTARY WL, GIH W/FREEPNT TL, TAG SANDLINE @ 9145' RUN FREEPOINT, TBG FREE, COOH, RD HES SNUB 04/28/99 UNIT, GIH W/STRING SHOT, TAG @ +/-9075', PU T/+/-9030', TRQ UP TBG, SHOOT STRING SHOT, TRQ STAY IN TBG. COOH, CAP FIRED BUT CORD DIDN'T, GIH WINEW CAP & CORD, SPOT SHOT @ +/-9000', TRQ TBG & FIRE SHOT, TBG UNTROD & UNSCREWED, COOH W/TBG, GIH W/SIDE PORT & TBG, TAG & SCREW BK IN TBG.
- GIH W/OUTSIDE STRING SHOT, WK DWN T/+/-10250', SHOT DIDN'T FIRE, COOH REPAIR SHOT, GIH T/+/-10250' BK 04/29/99 OFF TBG, COOH W/TBG, REC SWAB, TBG PLUG & COLLAR STOP, GIH W/TBG, SCREW BK INTO TBG, GIH FREEPOINT @ 10630', TBG FREE, COOH, SISD.
- GIH W/1" CCL & STRING SHOT, SHOOT IN PKR, DIDN'T REL, COOH, GIH W/SHOT T/10737-NO BKOFF, COOH, GIH 04/30/99 SHOOT @ 10700' NO BKOFF, COOH, GIH W/1" FREEPOINT, COULDN'T GET PST 10650', COOH GIH SHOOT @ 10700' NO BKOFF, COOH, GIH SHOOT @ 10700' NO BKOFF, COOH, GIH SHOOT @ 10604', BKOFF, COOH W/TBG, SISD.
- NU ANNULAR T/TOP BOP, WO HAIL & RAIN T/PASS, PU START IN HOLE W/5 JTS WASH PIPE, 6 COLLARS, WO HAIL & 05/01/99 RAIN, FIN GIH W/COLLARS, JARS & TBG T/+/-7000', FIN RU OF AIR UNIT, PRESS UP & BLOW WTR OUT CSG, GIH W/10 STDS TBG, BLOW WTR OUT, GIH W/10 STDS TBG, BLOW WTR OUT, GIH W/10 STDS TBG, BLOW WTR OUT, BLOW DRY F/+/-10300'-SURF.
- GIH W/10 STDS, PU SWIVEL & 1 JT BLOW DRY, START WASH W/FOAM & AIR, GET OVER TOP FISH, WASHDWN +/-2', 05/02/99 TBG TRQD UP, PU ON STRING, COULDN'T GET FREE & AIR PRESSURED UP, JAR ON TLS, WO NEW TBG LN & INSTALLATION, JAR ON TLS, DIDN'T APPEAR MOVING FISH, SISD.
- FREEPOINT WASH PIPE, WASH PIPE FREE ON OUTSIDE, SHOWED STK INSIDE, GIH BK OFF TOP BTM JT OF WASH PIPE, 05/03/99 COOH, STD BK TBG & COLLARS, LD WASH PIPE, UNLD & RK + /-4000' PH6 2-7/8" TBG.
- GIH W/SPEAR, BMPR SUB, ACCELERATORS, COLLARS, JARS, +/-7000' N80 TBG, PU GIH W/+/-3500' PH6 TBG, CATCH 05/04/99 FISH & JAR, PULL T/150 PSI OR 60 PTS OVER WT, COULDN'T SEE MOVEMENT.
- JAR ON FISH, MOVE + /-6", JARS QUIT, REL SPEAR, COOH. 05/05/99
- GIH W/SPEAR, BMPR SUB, NEW JARS, COLLARS, ACCELERATORS, & TBG, JAR ON FISH, CAME LOOSE, COOH W/TBG & 05/06/99 TLS, HAD +/-28' WASH PIPE.
- GIH W/CONCAVE BTM MILL, STABALIZERS, JARS, COLLARS, & TBG, FIN RU REV UNIT, FILL UP HOLE W/KCL WTR, 05/07/99 START MILLING ON FISH, MAKE + /-6", CIRC CLEAN.
- MILL ON FISH, MAKE + /-30", CIRC CLEAN. 05/08/99
- MILL ON FISH, NOT MAKING HOLE, COOH CHG MILL, GIH, START MILLING ON FISH, MAKE +/-10", SISD. 05/10/99
- MILL F/+/-10608' T/+/-10610', CIRC CLEAN. 05/11/99
- MILL ON FISH @ +/-10610', MADE 6" OF HOLE THEN STOPPED, COOH, MILL APPEARED T/BE ON TBG, GIH 05/12/99 W/OVERSHOT W/CUTRIGHT SHOE, WK T/GET FISH CAUGHT, OVERSHOT WOULDN'T FALL OVER FISH.
- COOH W/OVERSHOT, SHOWED T/HAVE CUT ON BTM OF SHOE W/NICKS INSIDE, GIH W/MILL F/+/-10610-10613', 05/13/99 RUPTURED HYDROLIC HOSE ON REV UNIT, CIRC CLN, COOH LD PH6 WS.
- COOH LD COLLARS & MILL, WO F NIP, GIH W/TBG PATCH OVERSHOT & TBG T/TOP OF FISH, WK T/GET OVERSHOT ON 05/14/99 TBG, COULDN'T CATCH TBG, RD REV UNIT, ND BOP, FLNG UP WH.
- TEMP DROP F/REPORT RDMO DDU. 05/15/99
- MIRU DDU & STAR TL REV UNIT, UNFLNG TREE & NU BOP, COOH W/TBG, PU GIH W/SHOE, DRESS OFF MILL, JARS, 06/29/99 COLLARS & TBG, WO STIFFARM F/REV UNIT, MILL ON FISH, PU CIRC CLN.
- MILL/WASH + /-1", PLUGGED TBG LOSING CIRC, SWAB & COOH W/TLS, PU GIH W/NEW SHOE, 3 JTS WASH PIPE, NEW 06/30/99 MILL & STRING AS BEFORE.
- FIN GIH W/20 STD TBG, LD & BRK CIRC, WASH/MILL F/+/-10610 T/+/-10701', CIRC CLN, PULL ABOVE FISH. 07/01/99
- GIH WASH/MILL +/-4', STOPPED MKNG HOLE, WK T/TRY T/MK HOLE, RD PWR SWVL, COOH W/TBG & TLS, LD 07/02/99 WASHPIPE, REC 1 FULL & 5' TBG OUT WASHPIPE, WO EXTEN T/BE DELIVERED, GIH W/EXTENDED OVERSHOT, JARS, COLLARS & TBG.
- FIN GIH W/OVERSHOT, WKOVER FISH & CATCH, COOH W/+/-18' TBG, GIH W/OVERSHOT, WKOVER & CATCH FISH, 07/03/99 COULDN'T JAR LSE, STND BY & WO ROTARY WL, MIRU ROTARY WL, GIH RUN FREEPOINT, TBG FREE + /-40' ABOVE PKR, GIH & BK OFF TBG (FOUND 2 JTS TBG & 10' SUB ABOVE PKR), RDMO ROTARY WL.
- COOH W/BKOFF, REC 1 FULL JT & 2' JT ABOVE, GIH W/PROD TBG, TAG TOP FISH, CIRC BTMS UP T/WASH OFF TOP OF 07/04/99 FISH, WO TBG SUBS, SUB OUT TBG, SCREW ONTO FISH, WK TRQ UP & DWN TBG, PKR DIDN'T MOVE, ND BOP, FLNG **UP TREE**
- SHUT DOWN. 07/05/99
- RDMO DDU, MIRU BJ CT UNIT, N2 & PMP TRK, PRIME N2, GIH W/CT & N2, JET TBG DRY T/+/-9000', START WTR, TAG 07/06/99 FILL @ 10770', WASH DWN T/10798', COOH T/CIRC, COULDN'T WASH BK BELOW 10788', COOH, CHG BTM HOLE TLS, GIH, TAG @ 10763', WK TRY T/MK HOLE, COULDN'T MK HOLE, SHUT OFF N2 & WK CT, STILL COULDN'T MK HOLE, START N2 T/BLOW HOLE DRY, COOH.
- WO ENGRNG, RDMO BJ CT UNIT, N2 & PMP TRK, WO RIG T/MOVE BK, MIRU DDU, OPEN UP WELL & FLOW DWN N2, 07/07/99 UNFLNG TREE, NU BOP.
- MIRU ROT WL, GIH GET BK OFF @ +/-10707', RDMO ROTARY, COOH W/TBG, PU GIH W/SHOE, DP, JARS, COLLARS & 07/08/99 TBG, BRK CIRC, WASH/MILL F/+/-10707 - 10737', CIRC CLN, PULL ABOVE FISH, SISD.