

DELTA WING FEDERAL #110/09/91

FIN RIH W/2-7/8", N80 PROD TBG TO 8803'/ RU BJ/ SPOT 500 GAL 20% NEFE HCL 8803-8299'/ POOH/ RIH W/5-1/2" OTIS PERMALATCH PKR W/ON/OFF TOOL ON 2-7/8", N80 PROD TBG TO 7405'/ SDFN/ PREP TO FIH, NDBOP, NUWH & TEST/

10/10/91

FIH W/PKR & TBG/ SET PKR @ 8299'/ ND BOP & NU 5M TREE/ TEST TREE TO 4000 PSI/ TRAP 2000 PSI ON ANNULUS/ SI WELL/ SDFN/ PREP TO ACDZ/

10/11/91

RU BJ/ LOAD TBG W/10 GAL 2% KCL WTR, 200 GAL HEATED 20% NEFEHCL & 43 BBL CO2/ SHEARED PUMP-OUT PLUG @ 4500 PSI/ ACDZ WOLFCAMP AS PER PROCEDURE W/ADD'L 500 GAL 20% NEFEHCL & CO2, 7 BPM @ 4800 PSI/ JC @ 4:00 PM/ -29 BLAW/ PUMPED 39 TONS OF CO2/ FLOW 3 HRS ON VARIOUS CHOKES, TP 3185-0, NO FLUID RECOVERY/ SWAB 1/2 HR, FL @ 1000', REC 0 BO, 14 BLAW/ LOON TO TT ON 10/64" CHK/ SDFN/ PREP TO CONT SWABBING/ -15 BLAW/

10/12/91

SWAB 5 HRS/ FL 1400-1000'/ STAB @ 1000' 1ST HR/ REC 15 BLAW, 131 BW, & SOME CO2/ NO TR OIL OR GAS/ LEFT WELL OPEN TO TEST ON TANK ON 10/64" CHK/ SDFN/

10/13/91

SHUT DOWN/

10/14/91

SHUT DOWN/PREP TO SWAB WHILE WOO/

10/15/91

NO REC OVER WEEKEND/ NO PRESSURE/ SWAB 6-1/2 HRS/ REC 0 BO, 188 BW, NO GAS/ FL 1400-1900'/ ND TREE/ NU BOP/ RLS PKR/ POOH TO 4585'/ SDFN/ PREP TO F/ POOH & RIH W/RBP & PKR TO SWAB TEST PERFS/

10/16/91

FOH W/TBG & PKR/ TIH W/5-1/2" WATSON RBP & PKR ON 2-7/8" PROD TBG/ SET RBP @ 8905'/ SET PKR @ 8666'/ SWAB 4 HRS, FL 1300-8600/ REC 4 BO, 42 BLW, 9 BW, STRONG GAS BLOW DECREASING TO FAIR GAS BLOW/ SI WELL/ SDFN/ PREP TO CHECK TP THRU AM/

10/17/91

SITP 550 PSI/ FLOW 1/2 HR, 3/4" CHK, FTP 550-0 PSI, REC DRY GAS/ SWAB 1-1/2 HRS/ FL 5700-8600'/ REC 10 BO, 5 BW, & GOOD GAS SHOW/ UNSEAT PKR & RETRIEVE RBP/ RESET RBP @ 8602'/ RESET PKR @ 8480'/ SWAB TEST PERFS 8522-36' 2-1/2 HRS/ FL 1700-8400'/ REC NO OIL & 40 BLW/ FE 100' PER HR/ UNSEAT PKR & RETRIEVE RBP/ RESET RBP @ 8482'/ RESET PKR @ 8295'/ SWAB TEST PERFS 8390-8428' 1-1/2 HRS/ FL STAB @ 1400'/ REC 27 BW W/NO OIL OR GAS/ SHUT WELL IN/ SDFN/ PREP TO SPOT SAND ON RBP & SQZ TOP SET OF PERFS 8390-8428'/

10/18/91

SITP 150 PSI, H2S 18000 PPM/ SWAB 1 RUN, FL @ 1400', REC 0 BO, 7 BW/ HOWCO EIR INTO PERFS 8390-8428', 5 BPM @ 1200 PSI/ SPOT 2 SX SD ON RBP @ 8480/ TOH W/TBG & PKR/ TIH W/5-1/2" WATSON CMT RET ON 2-7/8" WS/ SET RET @ 8295'/ TRAP 500 PSI ON ANNULUS/ HOWCO SQZ WOLFCAMP PERFS 8390-8428' W/150 SX CLASS "H" NEAT/ FP 3500/ SNAP OUT OF RET/ REV 115 SX TO PIT/ TOH W/TBG & STINGER/ SDFN/ PREP TO DO SQZ/

10/19/91

TIH W/4-3/4" BIT & 6- 3-1/2" DC'S ON 2-7/8" TBG/ TAG & DRILL HARD CMT FROM 8291-8295'/ DRILL CMT RETAINER AT 8295' & HARD CMT TO 8311'/ CIRC CLEAN/ SDFN/ PREP TO FIN DRILL OUT & TEST PERFS/

10/20/91

CREWS OFF/

10/21/91

CREWS OFF/

