

Set whipstock at 4788 to correct deviation. Drilled off whipstock 4788-4803. Reamed 6 $\frac{1}{4}$ hole to 7 5/8. Reamed 5' & twisted pin off reamer. Fishing. Did not recover fish. Left 1 - 7 7/8 reamer & body, 1 - 7 5/8 hole opener & 1 whipstock guide plug in hole. Plugged back 4803-4550 w/60 sx cmt. Drld off whipstock. Drld 6 $\frac{1}{4}$ rat hole 4696-4710 & reamed to 7 7/8". Dressed rat hole w/7 7/8 hole opener & reamer. Reset whipstock at 4704. Drilled off ledge & rat hole. Dressed whipstock setting, 5 $\frac{1}{2}$ twisted off. Recovered fish. Started drilling & went back into old hole. Plugged back 4300-4146 w/75 sx 2% HA5 reg cmt. Plug no good. Set plug 4208-3874 w/75 sx reg neat cmt w/2% HA5 & 10% sand. Dressed plug 3874-4115. Set whipstock at 4115 facing South 10 degrees West. Drilled off whipstock. Ran survey - North 73 degrees East. Reamed 6 3/4 hole to 7 7/8. Resumed drilling 7 7/8 hole at 4130.