

submit 3 Copies To Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

C15
Form C-103
Revised March 25, 1999

WELL API NO. 30-015-00907
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name: Empire Abo Unit
8. Well No. T-6
9. Pool name or Wildcat Empire Abo

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
Oil Well ☐ Gas Well ☒ Other SWD

2. Name of Operator
B-P America Production Co.

3. Address of Operator
P.O. Box 1089, Eunice, New Mexico 88231

4. Well Location
Unit Letter N : 990 feet from the South line and 1650 feet from the West line
Section 16 Township 18S Range 27E NMPM Eddy County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)
3435' DF

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPLETION <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.
PROCEDURE TO P&A. T.D. 5985'. PBTD 5982'. CIBP @ 2981'. 4 1/2 csg. 9.5#

- (1) MIRU pulling unit. ND well head. NU BOP & Enviro-vat.
- (2) RIH w/tbg. Tag CIBP @ 2981' & cap w/25 sxs. cmt.
- (3) Circulate hole w/9.5# salt gel mud.
- (4) PUH w/tbg. to 1584' & spot 25 sx. 100' cmt. plug from 1584' to 1484' WOC & tag shoe plug.
- (5) PUH w/tbg. to 620' & spot 25 sx. cmt. plug from 620' to 520'.
- (6) PUH w/tbg. to 60' & spot cmt. to surface.
- (7) POH w/tbg.
- (8) Cut off well head & anchors 3' BGL. Clean up location & set dry hole marker.

Notify OCD 24 hrs. prior to any work done

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kellie D. Murrish TITLE Sr. Admin. Asst. DATE 12.12.02
Type or print name Kellie D. murrish Telephone No. 505.394.1600
(This space for State use)

APPROVED BY [Signature] TITLE Wild Sup ID DATE DEC 31 2002
Conditions of approval, if any: